



City of Dunn

2021 CITYWIDE PAVEMENT CONDITION SURVEY REPORT

October 20, 2021



SEPI

TABLE OF CONTENTS

SECTION 1 – EXECUTIVE SUMMARY	1
SECTION 2 – INTRODUCTION	1
2.1 Pavement Management System	1-2
2.2 Pavement Condition Survey	2
2.3 Pavement Condition Survey Methodology	3
2.4 Pavement Distresses	3-7
SECTION 3 – GENERAL OBSERVATIONS	8
3.1 Road Condition Overview	8-12
SECTION 4 – MAINTENANCE RECOMMENDATIONS	13
4.1 Strategic Approach	13
4.2 Pavement Treatment Options.....	13-14
4.3 Preliminary Recommendations	14-17
4.4 Pavement Management Plan Considerations	17-18
4.5 Parking Lots	18-19
SECTION 5 – ACKNOWLEDGEMENTS	19
APPENDICES	
A Alphabetical List of Segments	
B Ranked List of Segments	
C Dunn Maps_PCI	
D Dunn Maps_Patching & Crack Sealing	
E Dunn Maps_Preservation & Overlays	
F Distress Types_Extent Definitions	



SECTION 1 – EXECUTIVE SUMMARY

The City of Dunn retained SEPI Engineering and Construction, Inc. (SEPI) to perform a Pavement Condition Survey on the City's Street system and develop maintenance recommendations for repairs or treatments on each street.

SEPI conducted a visual pavement condition survey in April and 749 street segments were created and evaluated. The SEPI staff performed the pavement condition survey of the town streets by collecting distress data in accordance with FHWA-RD-03-031, Distress Identification Manual for the Long-Term Pavement Performance Project (June 2003).

The assessment of the City's streets found that 3% (2.01 miles) of the network is in Excellent condition and 26% (17.27 miles) is in good condition. The remaining portions of the network are rated as 67% (44.18 miles) Fair, 3% (2.27 miles) Poor, and 1% (0.39 mile) Failed.

Consequently, the majority of the City's Street system falls into the fair category and is suited for preservation and minor rehabilitation with limited structural deficiencies that will require reconstruction. To preserve pavement and improve the overall condition of City streets, SEPI recommends a mix of rehabilitation and preventative maintenance activities. SEPI has developed a two-tiered program that addresses the “poor” and “fair” roads with rehabilitation and the “good” roads with more cost-effective preventative maintenance treatments.

The rehabilitation strategy for “poor” and “fair” roads is to patch, mill, and/or crack seal the street in preparation for applying an overlay of plant mix asphalt to restore ride quality and prevent water from penetrating the pavement substructure. The preventative maintenance strategy for the “good” roads is to apply a variety of proactive and cost-effective treatments to slowdown the natural deterioration processes.

Based on the recommended approach, outlined in this report, the City's current maintenance and repair backlog for pavement rehabilitation and preventative maintenance was determined to be \$15,717,120 in today's dollars. With the City's current annual Powell Bill allocation of approximately \$295,000, SEPI recommends that Dunn be proactive in implementing a pavement management system to make informed decisions and prioritize work to ensure the best return on investment. SEPI also recommends increasing yearly funding due to the large backlog the City currently has.

SECTION 2 – INTRODUCTION

2.1 PAVEMENT MANAGEMENT SYSTEM

A municipality's pavement network allows residents and commerce to move from place to place, provides for efficient response time during emergencies, and offers safe bus routes to get children to school. Paved roads are often a municipality's primary mode of transportation. For this reason, maintaining and preserving the condition of the pavement should be a top priority.

What is a pavement management system? A pavement management system is a long-term, formalized approach to gathering information about a municipality's roadway network. The system is used to measure a municipality's entire road network, evaluate its road conditions, and log this data in a comprehensive database. The data is then analyzed and used to develop several important tracking

metrics, including the average Pavement Condition Index (PCI). The backlog of needs is expressed in both miles and dollars. The idea is to take a comprehensive, long-range view of a municipality's roadway assets. Decision-makers then can use the data to make informed roadway repair and maintenance decisions, prioritizing work to ensure the best return on investment.

When used effectively, a pavement management system is a cost-effective tool for improving pavement conditions and maximizing the limited roadway repair and reinvestment dollars available to municipalities (see Figure 1 below). A pavement management system can also help to build a case for additional funding for roadway infrastructure. The SEPI Team developed this report to assist the City of Dunn staff to build a pavement management system that provides the level of service desired by the City.

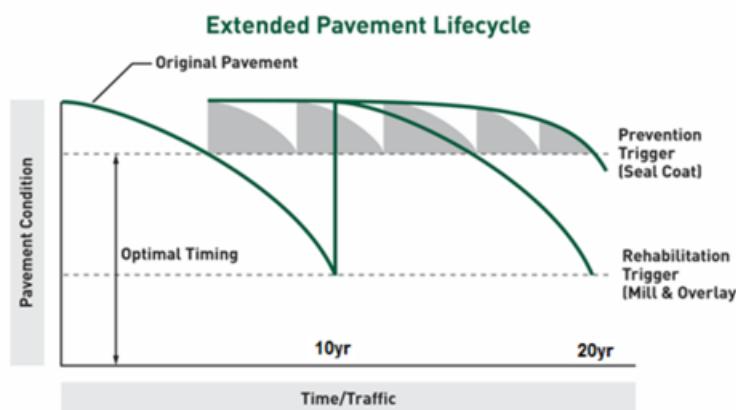


Figure 1: Demonstrates how pavement deteriorates over time to the point rehabilitation is necessary at a high cost. However, if treated earlier and more frequently in its life, pavement condition is maintained at a higher level and less expensive cost overall.

2.2 PAVEMENT CONDITION SURVEY

In March of 2021, the City of Dunn retained SEPI to perform a Pavement Condition Survey on the City's Street system and to develop pavement maintenance treatment options along with the associated estimated treatment costs. City staff indicated that no previous pavement condition study results were available for historical or comparative purposes.

In accordance with the latest Dunn Powell Bill map, the City maintains approximately 66 miles of paved roadways. The City's roadway network predominantly serves residential and light commercial traffic along with some heavy-duty trucks such as delivery, sanitation, and construction vehicles. The City provided SEPI with a list of streets and SEPI conducted a visual pavement condition survey in April and May of 2021. Our condition assessment included collecting street properties i.e., street name, to/from descriptions, block number, length, width, type of pavement, whether sidewalks or curb and gutter were present and asphalt pavement distresses.

2.3 PAVEMENT CONDITION SURVEY METHODOLOGY

SEPI's pavement management system utilizes observed distresses collected in accordance with FHWA-RD-03-031, Distress Identification Manual for the Long-Term Pavement Performance Project (June 2003), and ASTM D6433-18 for calculating a pavement condition index (PCI). Each street segment is ridden and observed for the following pavement distresses: fatigue cracking, transverse cracking, block cracking, reflective cracking, rutting and roughness, raveling and oxidation, and potholes and patching. Each distress level is measured for severity and extent according to the LTPP Method for conducting a Pavement Condition Survey (distress definitions are included in Section 2.4). The quantity of a distress type at each severity level is used to determine deduct values for each distress type and severity level combination. This is done by assessing the quantity and severity of a distress against deduct value curves for each distress/severity. Examples of deduct value curves can be found in ASTM D6433-18. The result is a deduction in PCI value for each distress and an overall PCI value for each road segment.

The data from the observations on the rated streets is entered into SEPI's pavement management program which generates a Pavement Condition Index (PCI) for each street segment. Streets are listed based on the Pavement Condition Index (PCI) assigned as the "SEPI PCI" attribute within the database. Figure 2 represents the numerical ranges and categories for street segments.

PCI CATEGORIES	
100-90	Excellent
89-70	Good
69-45	Fair
44-20	Poor
<20	Failed

Figure 2

The PCI is a numerical indicator that rates the surface condition of the pavement. The PCI provides a measure of the present condition of the pavement based on the distress observed on the surface of the pavement. It provides an objective and rational basis for determining maintenance and repair needs and priorities. Continuous monitoring of the PCI is used to establish the rate of pavement deterioration, which permits early identification of major rehabilitation needs. The PCI provides feedback on pavement performance for validation or improvement of current maintenance procedures.

2.4 PAVEMENT DISTRESSES

The following distress definitions are related to all pavements and were the basis of our pavement condition survey.

Fatigue Cracking: A load-associated structural failure due to excessive deflections or bending of the HMA layer. This type of failure is generally full depth and extends from the bottom of the pavement upwards. Fatigue cracking is typically observed along wheel paths initially and may present as intermittent longitudinal cracking at low severity. Two primary things must occur for Fatigue Cracking to develop. First, excessive traffic loading and second, deficient pavement system strength. Poor drainage and infiltration of water can exacerbate fatigue cracking by weakening the underlying base or subgrade.

As fatigue cracking becomes higher in intensity, cracks usually become an interconnected system resembling alligator skin or chicken wire. If left unresolved, fatigue cracking typically progresses from low to high severity unless the primary causes of distress are addressed. The rate of progression is entirely dependent upon the scale and frequency of loading versus the thickness and strength of pavement and subgrade in place. See figures 3 & 4 below for an example of moderate to high intensity fatigue cracking.



Figures 3 & 4: Fatigue Cracking as seen on W. Harnett Street and S. King Avenue

Transverse and Block Cracking: Transverse cracking (Figure 5) is a distress associated with shrinkage and daily temperature cycling. Transverse cracks develop across a road segment and are not load associated but generally extend through the full depth of the pavement. Transverse cracking can become block cracking (Figure 6) as a pavement ages and becomes less able to resist dimensional changes without cracking. Transverse cracks become closer together and more frequent while also being broken into smaller longitudinal sections or blocks. The initiation and further development of Transverse and Block cracking is a factor of the asphalt mixture characteristics, level of oxidation, and intensity of climate cycles. This type of distress is usually relatively slow in its progression but can develop into fatigue cracking or potholes due to water infiltration especially in thin pavement sections with poor drainage or bird baths.



Figures 5 & 6: Transverse Cracking and Block Cracking as seen on Orange Avenue and W. Pearsall Street

Patching and Potholes: Patching is indicated on a street when the surface of the existing pavement has been repaired by replacing or covering up part of the old asphalt with new asphalt. This can be done by surface patching or full depth (dig out) patching. The quality and condition of the patch are considered in evaluating patching—*failing patches* (Figure 7) are the only ones evaluated. If not done carefully and properly, patching can lead to a rougher riding road.

Potholes are failures in the pavement resulting in an open hole in the pavement. They are caused by various issues, and care to determine the root cause is essential to choosing the correct repair method. The size and frequency of potholes are considered when evaluating the streets.



Figures 7: Patching that is failing (patches sinking and cracking) on Ponderosa Avenue

Surface Distresses

Raveling and Oxidation: Raveling is the surface distress known as the partial or total loss of the pavement wearing surface caused by the loss of asphalt binder, aggregate, or fines. Raveling is seen more often on AST or BST streets or slurry seal type streets than on plant mix asphalt surfaces. Raveling leads to rougher riding streets and the loss of skid resistance due to loss of aggregate and fines on the surface. Raveling can lead to water intrusion into the underlying pavement layers and subgrade if not properly repaired.


The surface distress known as oxidation (Figure 8) is the hardening and aging of the asphalt cement or binder. Visually the asphalt turns from a black color to a lighter gray color with time as the asphalt weathers. The surface binder has been worn away by traffic to expose the aggregate. The pavement stiffens and becomes more brittle. This weathering of the asphalt usually covers the entire surface and pitting can become evident. Oxidation can be seen where the asphalt has turned a much lighter gray than when first placed.



Figure 8: Oxidation versus newer pavement (top of picture)

Rutting and Roughness: Rutting is a depression-type failure normally found in the wheel path(s) resulting from consolidation or lateral movement of any of the pavement layers or the subgrade under traffic loads. It is caused by insufficient pavement thickness; lack of proper compaction of the asphalt, stone base, or subgrade; improper asphalt mix types; or weakening of the pavement system due to moisture infiltration. Pavement uplift and shearing can occur in more serious rutting instances. Rutting can present safety concerns due to trapping water on the roadway and should be evaluated carefully to determine the root cause.

Roughness (Figures 9 & 10) is what the public perceives as the rideability of a street. One of the most important aspects of a street to the traveling public, roughness is also sometimes referred to as smoothness and is first controlled by the initial construction quality. An initially smooth street tends to stay smooth longer and deteriorate more slowly, than an initially bumpy street. The street should be properly maintained and repaired to prevent rough riding roads. Special attention to the smoothness of patching and crack sealing, and timely repair of potholes is important, or the public will observe the street as a poor or bumpy road.

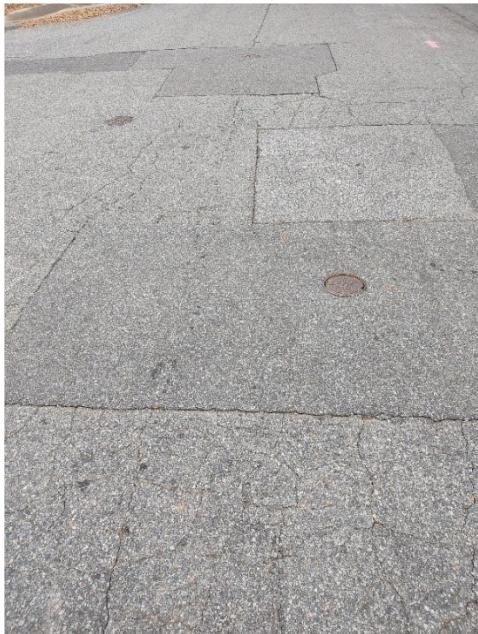

Figures 9 & 10: Utility patches can affect ride quality. Tree roots buckling pavement on W. Godwin Street creating an uneven, rough riding surface.

SECTION 3 – GENERAL OBSERVATIONS

3.1 ROAD CONDITION OVERVIEW

The results of the pavement condition survey indicate that the City of Dunn's street system is fairly healthy and is suited for preservation and minor rehabilitation repair treatments. With such a large portion of roads in the fair category, an aggressive paving and repair approach is suggested to keep more roads from falling into the poor category. Again overall, the assessment found that 3% of the City's street network is in Excellent condition, 26% is in Good condition and 67% is in Fair condition. The remaining portion of the network is rated as 3% Poor and 1% Failed. Figure 11 below provides a summary of the PCI results.

PCI Category	PCI Range	Powell Bill Streets		
		# of Sections	Length (miles)	% of Miles
Excellent	100 to 90	23	2.01	3%
Good	89 to 70	216	17.27	26%
Fair	69 to 45	484	44.18	67%
Poor	44 to 20	22	2.27	3%
Failed	<20	4	0.39	1%
TOTALS		749	66.11	100%

Figure 11: PCI Summary-Total Street System

The top three distresses observed and recorded during the pavement assessment were surface distresses, fatigue cracking, and transverse cracking. These three distresses reflect the natural aging process of pavements that have not been part of a pavement maintenance program. These aging roads are becoming more dry and brittle due to the oxidation and shrinking of the asphalt. Failure to timely treat these distresses may ultimately lead to water intrusion and ultimately structural failures and more costly repairs. Table 1 and Figures 12-17 on the following pages, provide an overall summary and breakdown of each distress type measured, the frequency of occurrence, and severity.

Table 1 on the following page indicates each distress recorded on the total street system in Dunn. It also shows the severity of each recorded distress recorded as a percent of the overall street network, measured in both miles and percentage of the network.

The graphs on the following pages further show the degree of the severity of each distress as part of the overall network in pie graph form. This makes it easy to see how much or how little of the overall street network is affected by distress. The least frequent distress in Dunn is reflective cracking (RC) which is only seen on streets with concrete pavement under the asphalt surface course.

Distress Items	Total Street System	
	Miles	% of Miles
Transverse Cracking (TC)		
A. High	12.38	18.70%
B. Medium	31.22	47.18%
C. Low	9.30	14.05%
D. None	13.28	20.07%
Total	66.18	100.00%
Surface Defects (SD)		
A. High	20.27	30.62%
B. Medium	23.00	34.76%
C. Low	20.87	31.54%
D. None	2.04	3.08%
Total	66.18	100.00%
Patch Deterioration/Potholes (PP)		
A. High	4.15	6.27%
B. Medium	11.24	16.98%
C. Low	14.45	21.83%
D. None	36.35	54.92%
Total	66.18	100.00%
Rutting/Roughness (RR)		
A. High	3.67	5.55%
B. Medium	7.26	10.97%
C. Low	5.02	7.58%
D. None	50.23	75.90%
Total	66.18	100.00%
Block Cracking (BC)		
A. High	0.00	0.00%
B. Medium	34.62	52.32%
C. Low	1.01	1.52%
D. None	30.55	46.16%
Total	66.18	100.00%
Reflective Cracking (RC)		
A. High	0.41	0.61%
B. Medium	0.00	0.00%
C. Low	0.00	0.00%
D. None	65.77	99.39%
Total	66.18	100.00%

Table 1: Pavement Condition Survey Distress Summary

Fatigue Cracking		
Severity	Length (mi)	% of Network
High	0.9	3.53%
Medium	8.5	34.37%
Low	13.9	56.02%
None	1.5	6.08%
24.8		100.00%

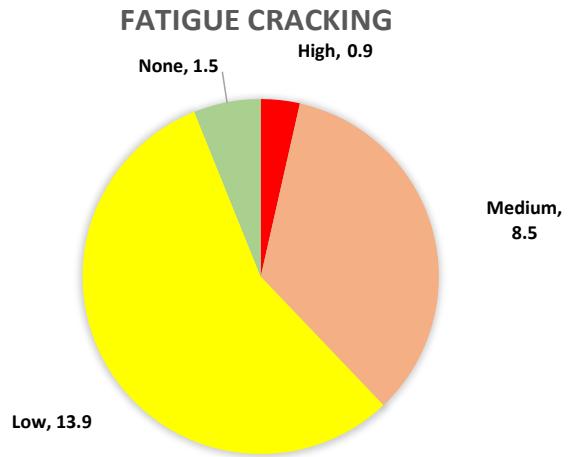


Figure 12

Transverse Cracking		
Severity	Length (mi)	% of Network
High	1.1	4.28%
Medium	10.7	43.27%
Low	9.1	36.58%
None	3.9	15.86%
24.8		100.00%

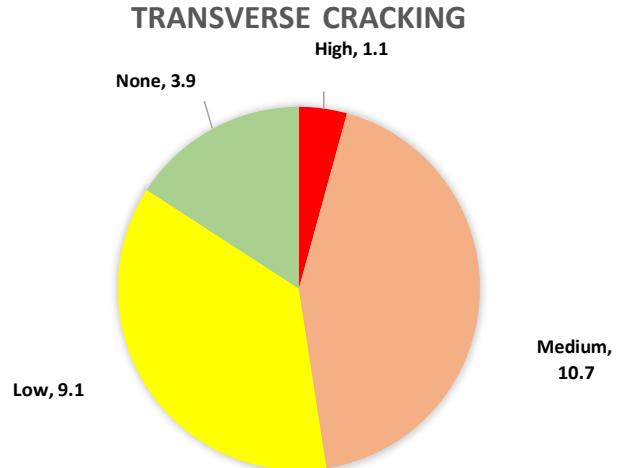


Figure 13

Patch Deterioration/Potholes		
Severity	Length (mi)	% of Network
High	1.8	7.44%
Medium	5.1	20.56%
Low	5.1	20.70%
None	12.7	51.29%
	24.8	100.00%

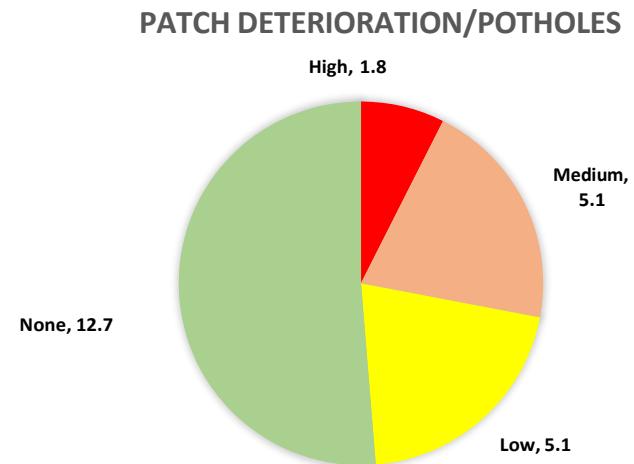


Figure 14

Surface Defects		
Severity	Length (mi)	% of Network
High	2.2	8.83%
Medium	14.3	57.73%
Low	6.6	26.60%
None	1.7	6.83%
	24.8	100.00%

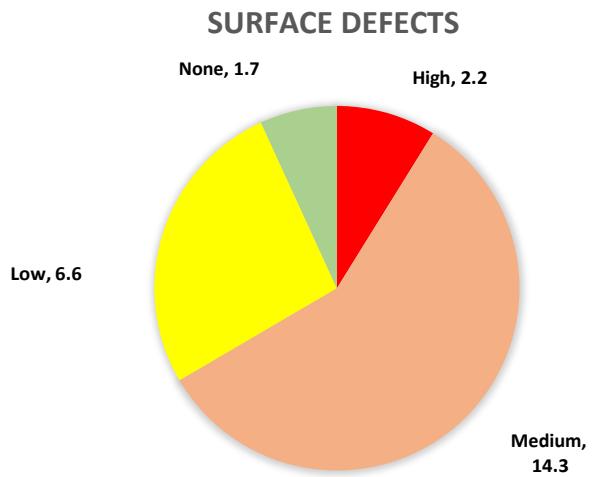


Figure 15

Rutting/Roughness		
Severity	Length (mi)	% of Network
High	2.6	10.46%
Medium	3.3	13.37%
Low	1.3	5.29%
None	17.5	70.87%
	24.8	100.00%

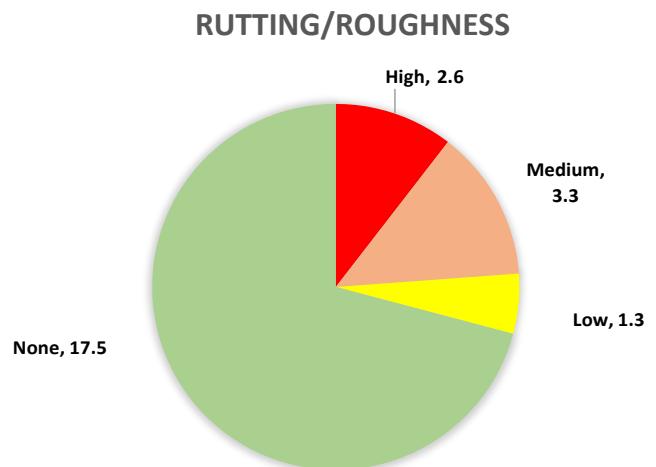


Figure 16

Block Cracking		
Severity	Length (mi)	% of Network
High	0.0	0.00%
Medium	15.5	62.43%
Low	0.6	2.26%
None	8.7	35.31%
	24.8	100.00%

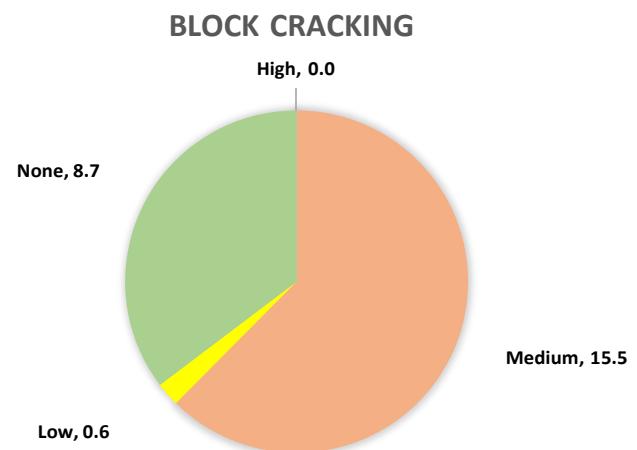


Figure 17

SECTION 4 – MAINTENANCE RECOMMENDATIONS

4.1 STRATEGIC APPROACH

Studies have shown that the right treatment on the right road at the right time is the best use of limited maintenance dollars. However, for most public agencies there are typically more maintenance needs than funds available. Therefore, maintenance activities need to be prioritized to maximize available funding. **One strategy is to allocate funds and plan maintenance activities that focus on keeping the good roads good. Keeping good roads good with cost-effective and proactive treatments is the general concept of pavement preservation.**

SEPI has seen great success with a mixed pavement maintenance program often heavily utilizing pavement preservation. Pavement preservation is a planned system of treating pavements to maximize their useful life. All pavements require some form of maintenance due to the effects of traffic and the environment on the exposed pavement materials over time. For example, applying a relatively low-cost surface treatment to a pavement with light to moderate distresses can efficiently increase the life of a pavement.

The most obvious benefit of pavement preservation is the extended service life of the pavement. Other benefits of a pavement preservation program are the ability to impact significant portions of the system by utilizing lower-cost treatments, better forecasting of maintenance cost demands, fewer premature pavement failures, keeping good roads good, and reduced user inconveniences due to construction.

The City should consider initially focusing its maintenance funding on pavement preservation practices and limited structural repair. These types of treatments include surface patching, full-depth patching, crack sealing and surface treatments such as microsurfacing or asphalt surface treatments (AST). Also, other emerging treatments and technologies may fit in a future pavement management plan and can be discussed further if the City is interested in trying new products and procedures.

4.2 PAVEMENT TREATMENT OPTIONS

The exclusive purpose of the SEPI pavement management plan is to preserve pavements, delay future deterioration, and improve overall conditions cost-effectively and efficiently. Since SEPI determined that the overall system health of the City's roads was fair, the main goal of the recommended treatment options is to improve the number of good and further raise the overall condition of the City's network by applying cost-effective treatments to correct pavement deficiencies. For Dunn, treatment options will fall into two (2) categories:

1. *Preventive Maintenance*

Preventive maintenance applies lower-cost treatments (Pavement Preservation) to slow down a street's deterioration, maintain or improve the functional condition, and extend the pavement's service life. With various short-term treatments, preventive maintenance can extend pavement life an average of 3 to 10 years. Applied to the right road at the right time—when the pavements are mostly in good condition—preventive maintenance can improve the network condition significantly at a lower unit cost.

2. ***Rehabilitation***

Rehabilitation applies structural enhancements to improve a pavement's load-carrying capability and extend the service life. Most rehabilitation projects are designed to last 10 to 15 years.

It should be noted that reconstruction is typically a third category that is included in a treatment option menu. This category is for roads that have failed and require the complete replacement of the pavement structure with a new equivalent structure. Although some streets in the City's network could benefit from reconstruction, the number of candidates is small, and the relatively low volume of traffic further minimizes the candidates and allows most of those streets to be repaired and repaved rather than reconstructed.

PCI CATEGORIES		MAINTENANCETIER	REPAIR TYPES
100-90	Excellent	Do Nothing	None
89-70	Good	Preservation	Crack Seals, SurfacePatching, SurfaceTreatments
69-45	Fair	Minor Rehabilitation	Patching plus AsphaltOverlays
44-20	Poor	Major Rehabilitation	Significant Street RepairsPlus Asphalt Overlays
<20	Failed	Reconstruction	Reconstruction Varies afterEvaluating the Individual Street Failure Types

Maintenance Treatment Matrix

4.3 PRELIMINARY RECOMMENDATIONS

For Dunn's recommendations, SEPI developed a two-tiered program of rehabilitation and preventative maintenance. The approach addresses the "poor" and "fair" roads by rehabilitation and the "good" roads with preventative maintenance. As a disclaimer, it is customary for pavement engineers to translate pavement condition ratings into simple categories for ease of understanding. For this pavement study, an "excellent" road indicates a road with a PCI of 90 or higher, a "good" road indicates a road with a PCI between 70 and 90, a "fair" road indicates a road with a PCI between 45 and 70, and a "poor" road indicates a road with a PCI of 20 to 45. Anything less than 20 is considered a failed road.

For roads with "poor" or "failing" designation the recommended treatment activity is full-depth patching and other repairs performed as needed followed by a hot mix overlay. This could include milling then an overlay with an appropriate pavement surface. For roads with "fair" designation, the recommended treatment activity is a combination of minor repairs and a hot mix asphalt overlay. For some roads, milling may be required.

For the good roads, preventative maintenance of some type (minor repair or an AST seal) is the recommended application. The treatment recommendations along with associated costs are shown in Table 2 below. SEPI recommends that the City use the above maintenance options to get the maximum life out of the roads in the system. The “mix-of-fixes” approach helps optimize available funds to meet network condition needs.

Maintenance	Cost	Maintenance	Cost
Minor Rehab - 1.25" Overlay	\$14.00/SY	Surface Patching	\$40.00/SY
Major Rehab - 1.5" Overlay/Other	\$23.00/SY	Crack Sealing	\$5000/mile
Preservation – Microsurfacing/AST	\$4.00/SY	Full Depth Patching	\$100.00/SY

Table 2

Table 3 summarizes the suggested maintenance activities and total cost for the City’s entire street network. **The current maintenance backlog has been determined to be \$15,717,120.** A detailed maintenance and repair analysis of each road segment based upon segment PCI may be found in Appendices C and D.

ESTIMATED NETWORK MAINTENANCE & REPAIR COST				
TREATMENT	Study Roads			
	# of Sections	Miles	SqYds	Cost
Crack Seal	495	44.76		\$223,545
Surface Patching	355	-	46,200.59	\$2,038,012
Full Depth Patching	98	-	11,712.34	\$1,171,225
Preservation	221	17.99		\$1,017,822
Minor Rehabilitation	433	38.67		\$8,439,305
Major Rehabilitation	68	7.03		\$2,827,211
Totals				\$15,717,120

Table 3

*Preservation Cost was calculated utilizing microsurfacing which would require a minimum of five (5) miles of work to be cost-effective.

While the above table details the total cost of maintenance and repair of the road network, it is important to prioritize road improvements and develop a yearly budget that will adequately address the network deficiencies. Normally, the cost of maintenance and repair of a network exceeds that of the City’s budget, so it is necessary to establish a plan to prioritize improvements that maximize the overall network health. It is also important to note that the estimated costs are meant to serve as a guide; therefore, SEPI strongly encourages the City to engage those with expertise and relevant knowledge when developing its annual budget and contracts. Appendix C, Appendix D, and Appendix E provide detailed maps of the PCI and recommended treatments which can help inform priority and budgeting decisions.

For Fair and good pavements, one alternative treatment that has proven to be very successful both regionally and nationally is microsurfacing. Microsurfacing (also known as a type of slurry seal) is a mixture of asphalt emulsion and fine aggregate that is applied uniformly to the pavement with specialized equipment. Microsurfacing is a preventative maintenance treatment that is slightly more expensive (approximately \$0.50/SY increase) than AST, but it provides a relatively low-cost treatment that is more similar in appearance to Hot Mix Asphalt. Dunn has some residential roadways that have recently been paved. It may be favorable to utilize an application in these areas that is aesthetically similar. In addition, there are a small handful of higher volume roadways in this system. Microsurfacing may be more appropriate for moderate volume, moderate-speed applications than AST due to its differences in surface characteristics. Please see figure 18 below for a picture of typical microsurfacing.



Figure 18: Typical Microsurfacing for preservation of roads

It should be noted that due to the specialty nature of microsurfacing, sufficient contract quantities would be necessary to generate contractor interest and project viability. Our conversations with the industry indicate that contract quantities including a minimum of five (5) miles of microsurfacing would be preferred for mobilization of the equipment and to keep costs reasonable. If the City is interested in learning more about this type of treatment, we can provide additional information.

In addition to the pavement preservation practices referenced above, **the SEPI Team also identified a need for drainage improvements on the shoulders and the ditches in Dunn**. High shoulders should be cut down and shaped to direct the water into the ditches. There are places where the ditches are not draining properly which can create issues in the road subgrade. **SEPI strongly recommends some funding be set aside to address the drainage issues prior to pavement improvements.**

The maintenance activities discussed are the preliminary recommended treatments for the type and extent of distresses observed. Some sections require multiple treatments for optimal performance. To provide the most benefit where multiple activities are recommended, activities should be completed within the same calendar year. Validation of the preliminary recommendations should be done in the field prior to developing a project or yearly program activities.

The recommended repairs are best judgments given the pavement conditions, but other needs such as utility repairs, conditions of curb and gutter, drainage, and traffic volume may dictate a variation of the activity. Field observations by an engineer are highly recommended prior to project development because of the ever-changing characteristics associated with pavement maintenance. **This final evaluation prior to letting a contract is vital to ensuring the right treatment on the right road at the right time and will help to ensure forecasted budgetary needs are as accurate as they can be.**

4.4 PAVEMENT MANAGEMENT PLAN CONSIDERATIONS

Given the results of the PCI survey, the availability of funds, and utilizing the two-tiered program of rehabilitation and preventative maintenance outlined in Section 4.2, a 20-year life cycle was determined to be reasonable for the City of Dunn's Street network. As a comparison, NCDOT uses a resurfacing cycle length of 15 years for urban & secondary roads

Key highlights of the considerations are as follows:

1. Preservation/Preventative Maintenance strategy for the “good” roads – Surface Patching, Full-depth patching, and crack sealing/repairs
2. Rehabilitation strategy for “poor” and “fair” roads – Patching and Overlays (Plant Mix or Microsurfacing.) Microsurfacing assumes a 5-mile minimum contract quantity and requires technical support (inspection) to ensure quality workmanship.

We also recommend all work be done under the supervision of certified inspectors. Certified inspectors play a vital role in municipalities getting the product they are paying for on the ground, within specifications, and with cost-efficiency.

Further, SEPI encourages that the City implement the recommended pavement maintenance strategy in phases and organize needed contracts in the following order:

- Patching – Since there is a need for a great deal of prep work such as patching, we recommend patching be done in one of two ways: 1) Partner with the local NCDOT office to have their crews review the streets and patch the areas of need; or 2) Let a contract to patch areas under the supervision of a certified inspector. The inspector and their engineer can mark the areas to be patched in the field prior to letting the contract. The contract can be properly managed through inspection for both quality and quantity control.
- Asphalt Paving – Asphalt paving contract should follow the patching contract. Consideration could be given to let the two contracts together if desired. This contract would include the patching then any resurfacing or milling and resurfacing with asphalt.
- Preservation – Preservation should be the final contract since patching and crack sealing/repair needs to be done prior to the preservation. The recommended preservation treatments are either thin overlays, microsurfacing, or asphalt surface treatment (AST.) There is the option of

partnering with the local NCDOT office and utilizing their yearly AST contracts to get the best prices on this method. NCDOT would provide an inspector on the job with the agreement. If microsurfacing is the chosen method of preservation, it is strongly recommended that an engineering firm with certified inspectors be hired to manage and/or supervise the work being done. This is again necessary to control the quantity and the quality of the work.

- Given the number of relatively short sections of roadways within this system, it would also be beneficial to consider letting contracts with like-type roads requiring the same treatments. This will establish better prices through an economy of scale.

SEPI recommends that the City of Dunn follow the pavement preservation philosophy outlined in this report. The City's approach should combine traditional medium to long-term strategies (reconstruction and resurfacing) with short-term preventative maintenance strategies to achieve the highest level of service while maximizing available Powell Bill funds each year. These funds should be augmented when additional funds are available. The experienced SEPI Team is available to assist the City with future planning if desired.

Lastly, SEPI recommends that the City of Dunn plan for future pavement condition surveys on regular four to five (4-5) year intervals so that the status of the road system can be monitored, and maintenance plans altered as necessary.

4.5 Parking Lots

At the request of the Assistant City Manager, SEPI conducted a maintenance assessment of three City-owned parking lots. In general, the current condition of the asphalt parking lots is fair and typical of aging, low-volume car parking areas. Parking lots are highly susceptible to transverse cracking, oxidation and localized drainage issues all leading to problem spots in the pavement. This parking areas are serviceable but in need of a plan to keep issues that are currently serviceable from becoming more significant problems. The types of failures present suggest that the parking area is not significantly deficient in structure as most of the cracking is random in nature other than in areas where drainage appears to be an issue. Some site specific observations include:

1. At **Tyler Park**:
 - a. The lot beside the tennis courts (off N. General Lee Avenue) has high shoulders causing standing water after rains (See Figure 1).
 - b. The "C" shaped parking lot on the other side of the tennis courts is in relatively good condition but has transverse cracking.
 - c. The third parking lot at Tyler is off W. Edgerton Street has transverse and surface cracking present
2. At **Tart Park**, the lot off S. Elm Avenue has drainage issues, transverse (See Figure 2) and surface cracking.
3. The larger parking lot off Jackson Road has high shoulders affecting drainange, transverse and surface cracking.

SEPI recommends that at a minimum, the City develop a maintenance plan and strategy for the parking lots that include the following:

- Address drainage issues at each parking lot
- Full Depth Patch and level as necessary to address isolated failures.
- Perform crack sealing (including grass eradication)
- Seal the surface of the pavement with an appropriate treatment such as slurry, AST or microsurfacing (Next 3-5 years after maintenance repairs completed)



Figure 1-High shoulders holding water on parking lot



Figure 2-Grass growing in large cracks in parking lot

SECTION 5 – ACKNOWLEDGEMENTS

SEPI would like to thank the City of Dunn for this opportunity. The City staff was professional, conscientious, knowledgeable, and very supportive of the SEPI Team. The background information and open discussions with staff provided also helped ensure a very successful project. It would be a pleasure to work with Elizabethtown again should our services be needed.

The SEPI team has a wide range of expertise, offering unique solutions to our clients across North Carolina and the Southeast. SEPI staff is prepared to offer engineering solutions to our clients in most all Civil Engineering disciplines. Our goal is not just to meet the needs of our clients, but also to exceed them. SEPI offers sustainable, earnest, practical, and innovative service lines to a wide range of clients. We have offices in Raleigh, Charlotte, and Wilmington in North Carolina; Charleston and Beaufort in South Carolina; and Palmetto and Fort Lauderdale in Florida.



APPENDIX A

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
ALPHABETICAL LIST OF SEGMENTS



Appendix A - Alphabetical List of Segments

SectionID	Street Name	CL	BEG_DESC	END_DESC	P	FC	TC	PP	SD	RR	RC	BC	Sidewalk	Length (ft)	Width (ft)	SqYd	PCI	Cost
9640	ALMOND DR	A	GLENNEAGLES AVE	GLENALMOND CT	A	LOW/10-25	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	152.25	22	372.16	81.11	Crack Seal: \$144 Preservation: \$1,489
2364	ANNE ST	A	ELDRIDGE DR	FAIRGROUND RD	A	MEDIUM/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	551.70	17	1042.1	66.94	Minor Rehab: \$14,589 Surface Patching: \$3,126
2365	ANNE ST	A	BEASLEY ST	ELDRIDGE DR	A	LOW/0-5	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	342.00	16	608	67.69	Minor Rehab: \$8,512 Surface Patching: \$608
1112	ASHLEY LN	A	WINTERLOCHEN DR	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	LOW/0-5	No	383.28	23	979.49	52.20	Minor Rehab: \$13,713 Surface Patching: \$7,835 Crack Seal: \$363
7741	BASIN ST	A	FAIRGROUND RD	DEAD END	A	MEDIUM/0-5	HIGH/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	1021.62	30	3405.4	55.72	Minor Rehab: \$47,676 Surface Patching: \$6,810 Crack Seal: \$967
7745	BEALE ST	A	FAIRGROUND RD	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	960.65	36	3842.6	55.40	Minor Rehab: \$53,796 Crack Seal: \$910
2366	BEASLEY ST	A	FAIRGROUND RD	ANNE ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	405.39	18	810.78	66.20	Minor Rehab: \$11,351 Surface Patching: \$6,486 Crack Seal: \$384
2367	BEASLEY ST	A	ANNE ST	MEADOWLARK RD	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	786.56	18	1573.12	66.36	Minor Rehab: \$22,024 Crack Seal: \$745
10410	BEAUFORT CIR	A	CRESCENT DR	CUL-DE-SAC	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	234.24	22	572.59	100.00	No Treatment
4814	BEST ST	A	S CLINTON AVE	S MAGNOLIA AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	376.98	20	837.74	51.07	Minor Rehab: \$11,728 Surface Patching: \$5,864 Crack Seal: \$357
4901	BEST ST	A	S MAGNOLIA AVE	S ELM AVE	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/10-25	No	447.76	20	995.01	64.71	Minor Rehab: \$13,930 Surface Patching: \$7,960 Crack Seal: \$424
2204	BISHOP LN	A	VILLAGE SQUARE DR	CUL-DE-SAC	A	HIGH/0-5	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	367.35	26	1061.23	52.96	Full Depth Patching: \$2,653 Minor Rehab: \$14,857 Surface Patching: \$1,061 Crack Seal: \$348
2205	BISHOP LN	A	VILLAGE SQUARE DR	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	617.27	26	1783.23	52.78	Minor Rehab: \$24,965 Surface Patching: \$5,350 Crack Seal: \$585
2379	BRANDYWOOD DR	A	WOODRIDGE DR	CUL-DE-SAC	A	NONE	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	467.54	22	1142.87	68.00	Minor Rehab: \$16,000
3375	BRANDYWOOD DR	A	ROLLINGWOOD DR	WOODRIDGE DR	A	HIGH/25-50	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	127.85	28	397.76	40.28	Major Rehab: \$9,148
2178	BRIARCLIFF DR	A	MARLOWE DR	DEAD END	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/50-75	No	718.77	36	2875.08	48.48	Major Rehab: \$66,127
7644	BRIARCLIFF DR	A	W CUMBERLAND ST	MARLOWE DR	A	LOW/5-10	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	542.60	36	2170.38	78.49	Crack Seal: \$514 Preservation: \$8,682
2382	BRIGHTWOOD CIR	A	ROLLINGWOOD DR	CUL-DE-SAC	A	HIGH/10-25	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	233.48	30	49.36	Full Depth Patching: \$13,620 Major Rehab: \$17,900 Surface Patching: \$778 Crack Seal: \$221	
6306	BROOKWOOD AVE	A	DELANO ST	FRIENDLY RD	A	MEDIUM/25-50	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	619.89	20	1377.53	49.99	Major Rehab: \$31,683 Crack Seal: \$587
5008	BRUCE DR	A	ERWIN RD	EOM	A	LOW/0-5	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	LOW/0-5	No	604.65	21	1410.84	81.99	Surface Patching: \$7,054 Preservation: \$5,643
8991	BRUNSWICK DR	A	CURRITUCK AVE	ROWAN ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	1270.39	30	4234.64	100.00	No Treatment
7901	BURKE ST	A	MOORE ST	CLAYTON ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	443.93	20	986.52	67.32	Minor Rehab: \$13,811 Crack Seal: \$420
7903	BURKE ST	A	E JOHNSON ST	MOORE ST	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	325.98	21	760.62	66.32	Minor Rehab: \$10,649 Crack Seal: \$309
7905	BURKE ST	A	CLAYTON ST	LINCOLN ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	335.05	20	744.56	67.32	Minor Rehab: \$10,424 Crack Seal: \$317
7907	BURKE ST	A	LINCOLN ST	DEAD END	A	LOW/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	285.28	21	665.65	66.36	Minor Rehab: \$9,319
7489	BURNETTE ST	A	FAIRVIEW ST	N MCKAY AVE	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	363.66	21	848.54	65.86	Minor Rehab: \$11,880 Surface Patching: \$2,546 Crack Seal: \$344
2214	BYRD DR	A	W COLE ST	FRIENDLY RD	A	LOW/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	1130.67	25	3140.74	51.65	Minor Rehab: \$43,970 Surface Patching: \$18,844 Crack Seal: \$1,071
7747	BYRON ST	A	BEALE ST	SAINT ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	524.73	36	2098.93	65.57	Minor Rehab: \$29,385 Surface Patching: \$6,297 Crack Seal: \$497
7742	BYRON ST	A	BASIN ST	DEAD END	A	HIGH/10-25	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	228.38	36	913.51	64.33	Full Depth Patching: \$15,986 Minor Rehab: \$12,789
7746	BYRON ST	A	BASIN ST	BEALE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	389.34	36	1557.38	65.31	Minor Rehab: \$21,803 Surface Patching: \$4,672 Crack Seal: \$369
3415	CAMBRIDGE CT	A	CANTERBURY DR	DEAD END	A	LOW/0-5	NONE	LOW/5-10	LOW/EXTREME	NONE	NONE	NONE	No	179.57	30	598.57	82.61	Preservation: \$2,394
2371	CANAL DR	A	FAIRVIEW ST	MEMORIAL AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	No	481.96	22	1178.11	81.94	Preservation: \$4,712
2372	CANAL DR	A	MEMORIAL AVE	FAIRGROUND RD	A	NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	345.70	22	845.04	82.67	Preservation: \$3,380
2188	CANTERBURY DR	A	PARLIAMENT PL	KINGSWAY DR	A	MEDIUM/5-10	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	402.08	30	1340.25	64.94	Minor Rehab: \$18,764 Surface Patching: \$4,021
2189	CANTERBURY DR	A	KINGSWAY DR	CAMBRIDGE CT	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	246.64	30	822.14	66.25	Minor Rehab: \$11,510 Surface Patching: \$822 Crack Seal: \$234
3414	CANTERBURY DR	A	CAMBRIDGE CT	QUEENSBURY CT	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	175.77	30	585.89	65.69	Minor Rehab: \$8,202
5047	CANTERBURY DR	A	W POPE ST	PARLIAMENT PL	A	LOW/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	228.85	30	762.83	67.61	Minor Rehab: \$10,680
5052	CANTERBURY DR	A	QUEENSBURY CT	DEAD END	A	LOW/0-5	HIGH/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	545.18	30	1817.25	67.11	Minor Rehab: \$25,442 Crack Seal: \$516
2309	CARLIE C'S DR	A	N ASHE AVE	DEAD END	A	MEDIUM/25-50	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	1111.20	24	2963.2	48.78	Major Rehab: \$68,154 Surface Patching: \$2,963 Crack Seal: \$1,052
2283	CARRIAGE CT	A	STEEPLECHASE DR	CUL-DE-SAC	A	HIGH/0-5	MEDIUM/MEDIUM	HIGH/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	290.75	23	743.03	51.83	Full Depth Patching: \$1,858 Minor Rehab: \$10,402 Crack Seal: \$275
2285	CASCADE CIR	A	CRESTVIEW DR	DEAD END	A	MEDIUM/10-25	NONE	LOW/25-50	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	299.36	30	997.88	50.61	Minor Rehab: \$13,970 Surface Patching: \$11,974 Crack Seal: \$283
2498	CASWELL ST	A	E TOWNSEND															

971	DAVIS AVE	A	LAKESHORE DR	WADE AVE	A	LOW/0-5	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	618.33	34	2335.92	51.69	Minor Rehab: \$32,703
2209	DELANO ST	A	MAPLE AVE	OAKWOOD AVE	A	MEDIUM/10-25	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	340.09	20	755.75	50.04	Minor Rehab: \$10,581 Surface Patching: \$5,290 Crack Seal: \$322
6307	DELANO ST	A	BROOKWOOD AVE	MAPLE AVE	A	HIGH/25-50	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	320.53	20	712.29	38.78	Major Rehab: \$16,383 Crack Seal: \$304
935	DOGWOOD KNOLL ST	A	FAIRGROUND RD	DEAD END	A	LOW/0-5	MEDIUM/MEDIUM	LOW/5-10	LOW/EXTREME	NONE	NONE	NONE	No	234.09	18	468.17	79.32	Crack Seal: \$222 Preservation: \$1,873
5091	DUBOIS CIR	A	E VANCE ST	CUL-DE-SAC	A	MEDIUM/0-5	HIGH/MEDIUM	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	380.14	20	844.76	51.01	Minor Rehab: \$11,827 Surface Patching: \$5,069
4827	E BAY ST	A	E BAY ST	S WASHINGTON AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	362.13	17	684.03	65.78	Minor Rehab: \$9,576 Surface Patching: \$4,788 Crack Seal: \$343
4864	E BAY ST	A	S WILSON AVE	E BAY ST	A	LOW/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	362.68	20	805.96	66.41	Full Depth Patching: \$2,015 Minor Rehab: \$11,283 Surface Patching: \$4,030 Crack Seal: \$343
4867	E BAY ST	A	E BAY ST	S MAGNOLIA AVE	A	NONE	NONE	NONE	LOW/EXTREME	LOW/LOW	NONE	NONE	No	367.93	20	817.63	82.42	Preservation: \$3,271
4868	E BAY ST	A	S MAGNOLIA AVE	E BAY ST	A	LOW/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	363.77	17	687.12	52.65	Minor Rehab: \$9,620 Surface Patching: \$3,436 Crack Seal: \$344
4870	E BAY ST	A	S WASHINGTON AVE	DEAD END	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	401.69	28	1249.72	82.61	Preservation: \$4,999
4638	E BROAD ST	A	N LEE AVE	N HOLLAND AVE	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	824.05	44	4028.67	49.74	Major Rehab: \$92,659 Surface Patching: \$12,086 Crack Seal: \$780
4920	E BROAD ST	A	W BROAD ST	N WILSON AVE	A	LOW/0-5	HIGH/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	392.76	44	1920.14	82.11	Crack Seal: \$372 Preservation: \$7,681
4944	E BROAD ST	A	N WILSON AVE	N CLINTON AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	363.88	44	1778.96	82.92	Preservation: \$7,116
4948	E BROAD ST	A	S CLINTON AVE	N MAGNOLIA AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	371.50	44	1816.23	82.92	Preservation: \$7,265
4949	E BROAD ST	A	N MAGNOLIA AVE	N ELM AVE	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	359.42	44	1757.15	83.00	Preservation: \$7,029
4952	E BROAD ST	A	N ELM AVE	N WASHINGTON AVE	A	LOW/5-10	LOW/LOW	LOW/0-5	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	Yes	368.90	44	1803.53	81.93	Crack Seal: \$349 Preservation: \$7,214
4954	E BROAD ST	A	N WASHINGTON AVE	N WILMINGTON AVE	A	LOW/5-10	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	448.23	44	2191.36	82.33	Crack Seal: \$424 Preservation: \$8,765
4955	E BROAD ST	A	N WILMINGTON AVE	N SAMPSON AVE	A	HIGH/10-25	HIGH/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	893.16	44	4366.55	49.05	Full Depth Patching: \$76,415 Major Rehab: \$100,431 Crack Seal: \$846
4958	E BROAD ST	A	N SAMPSON AVE	N LEE AVE	A	HIGH/0-5	HIGH/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	449.59	44	2198.02	49.91	Full Depth Patching: \$5,495 Major Rehab: \$50,554 Crack Seal: \$426
4959	E BROAD ST	A	N HOLLAND AVE	STONEY RUN DR	A	MEDIUM/5-10	HIGH/HIGH	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	277.94	20	617.64	49.64	Major Rehab: \$14,206 Surface Patching: \$2,471 Crack Seal: \$263
7163	E BROAD ST	A	STONEY RUN DR	EXIT RAMP 73 S	A	LOW/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	LOW/LOW	NONE	NONE	No	137.15	28	426.69	50.03	Minor Rehab: \$5,974
2290	E CANARY ST	A	S WILSON AVE	E CANARY ST	A	HIGH/0-5	MEDIUM/HIGH	HIGH/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	372.24	21	868.56	49.95	Full Depth Patching: \$2,171 Major Rehab: \$19,977 Crack Seal: \$352
2291	E CANARY ST	A	E CANARY ST	S MAGNOLIA AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	360.55	20	801.23	81.85	Crack Seal: \$341 Preservation: \$3,205
4871	E CANARY ST	A	E CANARY ST	S WASHINGTON AVE	A	MEDIUM/5-10	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	LOW/10-25	No	367.07	21	856.49	81.15	Surface Patching: \$2,569 Preservation: \$3,426
4873	E CANARY ST	A	S MAGNOLIA AVE	E CANARY ST	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	368.67	26	1065.03	81.78	Surface Patching: \$3,195 Crack Seal: \$349 Preservation: \$4,260
4890	E CANARY ST	A	SPRING BRANCH RD	S SAMPSON AVE	A	LOW/0-5	HIGH/MEDIUM	NONE	LOW/MEDIUM	NONE	NONE	NONE	No	371.24	20	824.97	72.28	Preservation: \$3,300
5092	E CANARY ST	A	S WASHINGTON AVE	DEAD END	A	MEDIUM/5-10	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	684.84	27	2054.53	80.58	Surface Patching: \$6,164 Crack Seal: \$649 Preservation: \$8,218
2334	E CARR ST	A	N MAGNOLIA AVE	N ELM AVE	A	LOW/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	402.29	20	893.99	82.56	Crack Seal: \$381 Preservation: \$3,576
5083	E CARR ST	A	N ELM AVE	N WASHINGTON AVE	A	MEDIUM/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	366.46	20	814.35	82.17	Surface Patching: \$2,443 Preservation: \$3,257
5084	E CARR ST	A	N WASHINGTON AVE	E TOWNSEND ST	A	LOW/5-10	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	345.65	20	768.12	67.53	Minor Rehab: \$10,754 Crack Seal: \$327
7440	E CARR ST	A	N WILSON AVE	E CARR ST	A	HIGH/25-50	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	No	353.88	23	904.37	38.39	Major Rehab: \$20,801 Crack Seal: \$335
7441	E CARR ST	A	E CARR ST	N MAGNOLIA AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	No	377.92	20	839.83	81.94	Preservation: \$3,359
1053	E CLEVELAND ST	A	N MAGNOLIA AVE	N ELM AVE	A	MEDIUM/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	362.44	20	805.43	67.42	Minor Rehab: \$11,276 Surface Patching: \$805 Crack Seal: \$343
2293	E CLEVELAND ST	A	N RAILROAD AVE	N WILSON AVE	A	MEDIUM/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	LOW/0-5	No	349.88	21	816.38	82.46	Surface Patching: \$816 Preservation: \$3,266
5086	E CLEVELAND ST	A	N ELM AVE	N WASHINGTON AVE	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	358.13	20	795.84	81.75	Full Depth Patching: \$1,990 Surface Patching: \$3,979 Preservation: \$3,183
7436	E CLEVELAND ST	A	N WILSON AVE	E CLEVELAND ST	A	LOW/0-5	MEDIUM/HIGH	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	359.22	20	798.26	68.30	Surface Patching: \$798 Crack Seal: \$340 Preservation: \$3,193
7437	E CLEVELAND ST	A	E CLEVELAND ST	N MAGNOLIA AVE	A	MEDIUM/10-25	HIGH/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	374.28	20	831.74	50.91	Minor Rehab: \$11,644 Surface Patching: \$5,822 Crack Seal: \$354
1007	E COLE ST	A	N WILSON AVE	DEAD END	A	HIGH/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	283.17	18	566.34	66.08	Full Depth Patching: \$1,416 Minor Rehab: \$7,929 Crack Seal: \$268
1032	E COLE ST	A	N MAGNOLIA AVE	N JACKSON ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	HIGH/LOW	NONE	NONE	No	282.32	18	564.64	52.29	Minor Rehab: \$7,905 Crack Seal: \$267
7448	E COLE ST	A	N WILSON AVE	E COLE ST	A	NONE	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	354.26	18	708.52	67.75	Minor Rehab: \$9,919 Surface Patching: \$709
7449	E COLE ST	A	E COLE ST	N MAGNOLIA AVE	A	LOW/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	369.37	18	738.75	51.87	Minor Rehab: \$10,343 Surface Patching: \$739 Crack Seal: \$350
4480	E DIVINE ST	A	W DIVINE ST	S WILSON AVE	A	MEDIUM/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	39.07	43	186.		

2298	E HARNETT ST	A	N LITTLE AVE	N SAMPSON AVE	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	450.80	21	1051.87	56.18	Minor Rehab: \$14,726 Crack Seal: \$427
4556	E HARNETT ST	A	N RAILROAD AVE	W HARNETT ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	401.30	44	1961.93	64.18	Minor Rehab: \$27,467 Surface Patching: \$5,886 Crack Seal: \$380
4824	E HARNETT ST	A	N WILMINGTON AVE	N LITTLE AVE	A	LOW/5-10	HIGH/HIGH	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	466.50	27	1399.51	56.07	Minor Rehab: \$19,593
5079	E HARNETT ST	A	N MAGNOLIA AVE	N ELM AVE	A	MEDIUM/0-5	MEDIUM/HIGH	HIGH/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	No	357.06	24	952.16	64.71	Full Depth Patching: \$2,380 Minor Rehab: \$13,330 Surface Patching: \$952 Crack Seal: \$338
5080	E HARNETT ST	A	N ELM AVE	N WASHINGTON AVE	A	HIGH/10-25	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	373.79	21	872.17	62.89	Full Depth Patching: \$15,263 Minor Rehab: \$12,210 Crack Seal: \$354
5089	E HARNETT ST	A	N WASHINGTON AVE	N WILMINGTON AVE	A	HIGH/0-5	MEDIUM/HIGH	LOW/0-5	LOW/EXTREME	LOW/LOW	NONE	NONE	No	438.09	21	1022.21	67.91	Full Depth Patching: \$2,556 Minor Rehab: \$14,311
7430	E HARNETT ST	A	E HARNETT ST	N MAGNOLIA AVE	A	HIGH/10-25	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	373.52	22	913.06	63.55	Full Depth Patching: \$15,979 Minor Rehab: \$12,783 Surface Patching: \$913 Crack Seal: \$354
7431	E HARNETT ST	A	N WILSON AVE	E HARNETT ST	A	HIGH/50-75	NONE	LOW/0-5	HIGH/HIGH	NONE	NONE	NONE	No	357.57	44	1748.13	20.03	Major Rehab: \$40,207
1037	E JOHNSON ST	A	N MAGNOLIA AVE	E TOWNSEND ST	A	MEDIUM/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	No	314.49	23	803.7	49.82	Major Rehab: \$18,485 Surface Patching: \$804 Crack Seal: \$298
2111	E JOHNSON ST	A	E GRANVILLE ST	E WAKE ST	A	MEDIUM/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	524.51	20	1165.58	52.90	Minor Rehab: \$16,318 Surface Patching: \$1,166 Crack Seal: \$497
2112	E JOHNSON ST	A	E WAKE ST	SATURN ST	A	MEDIUM/0-5	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	1752.42	20	3894.26	50.49	Minor Rehab: \$54,520 Surface Patching: \$3,894 Crack Seal: \$1,659
2113	E JOHNSON ST	A	SATURN ST	CAROLINA DR	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	735.41	20	1634.25	49.28	Major Rehab: \$37,588 Surface Patching: \$4,903 Crack Seal: \$696
2294	E JOHNSON ST	A	N RAILROAD AVE	N WILSON AVE	A	HIGH/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	351.09	20	780.21	67.28	Full Depth Patching: \$1,951 Minor Rehab: \$10,923
5915	E JOHNSON ST	A	E TOWNSEND ST	E SURLES ST	A	NONE	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	251.60	25	698.89	64.36	Minor Rehab: \$9,784 Crack Seal: \$238
7442	E JOHNSON ST	A	E JOHNSON ST	N MAGNOLIA AVE	A	HIGH/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	374.03	26	1080.53	66.03	Full Depth Patching: \$2,701 Minor Rehab: \$15,127 Crack Seal: \$354
7444	E JOHNSON ST	A	N WILSON AVE	E JOHNSON ST	A	HIGH/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	357.29	18	714.58	67.08	Full Depth Patching: \$1,786 Minor Rehab: \$10,004 Crack Seal: \$338
7902	E JOHNSON ST	A	E SURLES ST	BURKE ST	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	334.70	25	929.72	64.29	Minor Rehab: \$13,016 Crack Seal: \$317
7909	E JOHNSON ST	A	BURKE ST	E GRANVILLE ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/50-75	No	298.37	21	696.2	49.59	Major Rehab: \$16,013 Crack Seal: \$283
2493	E MORRIS CIR	A	W MORRIS CIR	W SURLES ST	A	LOW/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	522.54	30	1741.78	66.15	Minor Rehab: \$24,385 Crack Seal: \$495
2494	E MORRIS CIR	A	W SURLES ST	W COLE ST	A	LOW/5-10	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	347.63	30	1158.75	64.16	Minor Rehab: \$16,223 Surface Patching: \$1,159 Crack Seal: \$329
2495	E MORRIS CIR	A	W COLE ST	W GRANVILLE ST	A	HIGH/5-10	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	413.16	30	1377.21	66.30	Full Depth Patching: \$10,329 Minor Rehab: \$19,281 Surface Patching: \$1,377 Crack Seal: \$391
4640	E PEARSALL ST	A	S RAILROAD AVE	W PEARSALL ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	392.45	27	1177.36	50.32	Minor Rehab: \$16,483 Crack Seal: \$372
4644	E PEARSALL ST	A	S WASHINGTON AVE	S WILMINGTON AVE	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	458.02	20	1017.82	80.82	Surface Patching: \$3,053 Crack Seal: \$434 Preservation: \$4,071
4645	E PEARSALL ST	A	S WILMINGTON AVE	S LITTLE AVE	A	LOW/5-10	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	439.50	20	976.66	78.99	Crack Seal: \$416 Preservation: \$3,907
4646	E PEARSALL ST	A	S LITTLE AVE	E POPE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	825.57	28	2568.43	66.02	Minor Rehab: \$35,958 Surface Patching: \$7,705 Crack Seal: \$782
4655	E PEARSALL ST	A	E POPE ST	S SAMPSON AVE	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	416.75	20	926.1	78.65	Crack Seal: \$395 Preservation: \$3,704
4847	E PEARSALL ST	A	S ELM AVE	S WASHINGTON AVE	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	359.49	20	798.86	81.49	Surface Patching: \$2,397 Crack Seal: \$340 Preservation: \$3,195
4860	E PEARSALL ST	A	S MAGNOLIA AVE	S ELM AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	369.51	20	821.14	82.26	Crack Seal: \$350 Preservation: \$3,285
7423	E PEARSALL ST	A	S WILSON AVE	E PEARSALL ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	365.35	21	852.49	51.49	Minor Rehab: \$11,935 Crack Seal: \$346
7425	E PEARSALL ST	A	E PEARSALL ST	S MAGNOLIA AVE	A	NONE	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	362.36	20	805.24	82.42	Crack Seal: \$343 Preservation: \$3,221
4845	E POPE ST	A	S WILSON AVE	DEAD END	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	341.99	20	759.97	82.92	Preservation: \$3,040
4846	E POPE ST	A	S WILSON AVE	S CLINTON AVE	A	NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	363.87	24	970.31	82.67	Preservation: \$3,881
4856	E POPE ST	A	SPRING BRANCH RD	S LITTLE AVE	A	LOW/0-5	MEDIUM/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	300.76	20	668.35	668.35	Minor Rehab: \$9,357
4858	E POPE ST	A	S LITTLE AVE	E PEARSALL ST	A	HIGH/10-25	HIGH/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	1403.20	30	4677.33	48.43	Full Depth Patching: \$81,853 Major Rehab: \$107,579 Crack Seal: \$1,329
2336	E SURLES ST	A	N WILSON AVE	DEAD END	A	NONE	NONE	LOW/0-5	NONE	NONE	NONE	NONE	No	264.67	20	588.16	99.00	No Treatment
5914	E SURLES ST	A	N MAGNOLIA AVE	E JOHNSON ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	541.77	18	1083.55	52.45	Minor Rehab: \$15,170 Surface Patching: \$3,251 Crack Seal: \$513
7446	E SURLES ST	A	N WILSON AVE	E SURLES ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	No	357.59	21	834.38	79.53	Crack Seal: \$339 Preservation: \$3,338
7447	E SURLES ST	A	E SURLES ST	N MAGNOLIA AVE	A	MEDIUM/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	374.31	18	748.63	52.11	Minor Rehab: \$10,481 Surface Patching: \$2,246 Crack Seal: \$354
2500	E TOWNSEND ST	A	E CARR ST	DEAD END	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	878.56	21	2049.97	51.03	Minor Rehab: \$28,700 Surface Patching: \$26,650 Crack Seal: \$832
2501	E TOWNSEND ST	A	CASWELL ST	E JOHNSON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	282.39	20	627.54	50.79	Minor Rehab: \$8,786 Surface Patching: \$2,511 Crack Seal: \$267
2328	E VANCE ST	A	N MAGNOLIA AVE	N ELM AVE	A	HIGH/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME</									

915	FRIENDLY RD	A BYRD DR	CURRITUCK AVE	A MEDIUM/5-10	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	575.87	27	1727.6	50.90	Minor Rehab: \$24,186 Surface Patching: \$6,911
2213	FRIENDLY RD	A MOSES TRIPP LN	N POWELL AVE	A LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	526.61	20	1170.24	82.92	Preservation: \$4,681
5001	FRIENDLY RD	A FRIENDLY RD	FRIENDLY RD	A HIGH/5-10	MEDIUM/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	NONE	NONE	MEDIUM/0-5	No	331.01	20	735.58	51.04	Full Depth Patching: \$5,517 Minor Rehab: \$10,298 Surface Patching: \$2,207 Crack Seal: \$313
5003	FRIENDLY RD	A OAKWOOD AVE	FRIENDLY RD	A MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	204.33	23	522.16	66.74	Minor Rehab: \$7,310 Surface Patching: \$1,566 Crack Seal: \$193
5004	FRIENDLY RD	A MAPLE AVE	OAKWOOD AVE	A LOW/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	364.11	23	930.49	51.36	Minor Rehab: \$13,027
9680	FRIENDLY RD	A FAIRGROUND RD	TRACY LN	A MEDIUM/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	661.18	21	1542.76	67.03	Minor Rehab: \$21,599 Surface Patching: \$4,628
2370	GEORGE ST	A FAIRGROUND RD	MEADOWLARK RD	A MEDIUM/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	958.26	18	1916.52	66.94	Minor Rehab: \$26,831 Surface Patching: \$5,750
3332	GLENALMOND CT	A ALMOND DR	ALMOND DR	A MEDIUM/10-25	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	1168.26	22	2855.76	77.15	Surface Patching: \$19,990 Crack Seal: \$1,106 Preservation: \$11,423
3215	GLENEAGLES AVE	A CRESCENT DR	N POWELL AVE	A LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	387.48	31	1334.66	82.92	Preservation: \$5,339
9641	GLENEAGLES AVE	A ALMOND DR	GLENFIELD DR	A HIGH/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	879.57	12	1172.76	81.44	Full Depth Patching: \$8,796 Preservation: \$4,691
9642	GLENEAGLES AVE	A N POWELL AVE	CHADBURY DR	A LOW/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	372.97	12	497.29	82.19	Crack Seal: \$353 Preservation: \$1,989
10264	GLENEAGLES AVE	A N POWELL AVE	N POWELL AVE	A LOW/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	25.40	24	67.74	67.92	Minor Rehab: \$948
10268	GLENEAGLES AVE	A CHADBURY DR	GLENFIELD DR	A MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	883.87	12	1178.49	81.78	Surface Patching: \$3,535 Crack Seal: \$837 Preservation: \$4,714
10269	GLENEAGLES AVE	A N POWELL AVE	CHADBURY DR	A MEDIUM/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	372.40	12	496.53	82.75	Surface Patching: \$497 Preservation: \$1,986
2532	GLENFIELD DR	A GLENEAGLES AVE	CUL-DE-SAC	A MEDIUM/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	514.19	22	1256.91	82.25	Surface Patching: \$1,257 Crack Seal: \$487 Preservation: \$5,028
4338	GLENFIELD DR	A GLENEAGLES AVE	CUL-DE-SAC	A LOW/0-5	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	720.72	22	1761.75	82.69	Surface Patching: \$1,762 Preservation: \$7,047
9254	GOLDEN WILLOW CT	A WILLOW LEAF CT	CUL-DE-SAC	A NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	211.69	25	588.04	82.67	Preservation: \$2,352
2362	GREENFIELD DR	A CAROLINA DR	GREENFIELD DR	B HIGH/0-5	NONE	NONE	NONE	NONE	NONE	NONE	Yes	1219.49	20	2709.99	94.00	Full Depth Patching: \$6,775
1691	GREENWICH CT	A VILLAGE SQUARE DR	CUL-DE-SAC	A LOW/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	380.89	26	1100.35	53.36	Minor Rehab: \$15,405 Crack Seal: \$361
821	GULF DR	A SAINT ST	SAINT ST	A MEDIUM/5-10	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	1010.99	30	3369.96	64.09	Minor Rehab: \$47,179 Surface Patching: \$13,480 Crack Seal: \$957
2389	GUM RD	A HOLLY AVE	SAINT ST	A MEDIUM/0-5	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	NONE	No	703.80	30	2345.98	52.80	Minor Rehab: \$32,844 Surface Patching: \$4,692 Crack Seal: \$666
2219	GUY AVE	A WESTHAVEN ST	FRIENDLY RD	A MEDIUM/0-5	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	373.36	30	1244.52	64.89	Minor Rehab: \$17,423 Surface Patching: \$2,490 Crack Seal: \$354
2220	GUY AVE	A JONES DR	JONES DR	A MEDIUM/10-25	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	478.73	23	1223.42	65.36	Minor Rehab: \$17,128 Surface Patching: \$8,564 Crack Seal: \$453
2221	GUY AVE	A W GRANVILLE ST	JONES DR	A LOW/0-5	NONE	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	54.82	30	182.74	81.69	Preservation: \$731
2222	GUY AVE	A JONES DR	WESTHAVEN ST	A LOW/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	409.62	23	1046.8	52.11	Minor Rehab: \$14,655 Crack Seal: \$388
4899	HODGES AVE	A E DUKE ST	S WASHINGTON AVE	A MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	539.18	20	1198.18	65.57	Minor Rehab: \$16,775 Surface Patching: \$8,387 Crack Seal: \$511
809	HOLLY AVE	A SAINT ST	DEAD END	A MEDIUM/0-5	HIGH/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	627.80	36	2511.19	50.57	Minor Rehab: \$35,157 Surface Patching: \$22,601 Crack Seal: \$595
810	HOLLY AVE	A PINE ST	SAINT ST	A MEDIUM/0-5	HIGH/HIGH	MEDIUM/5-10	HIGH/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	366.98	36	1467.93	49.18	Major Rehab: \$33,762 Surface Patching: \$5,872 Crack Seal: \$348
811	HOLLY AVE	A FAIRGROUND RD	PINE ST	A MEDIUM/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	512.60	36	2050.41	50.42	Minor Rehab: \$28,706 Surface Patching: \$2,050
2180	HOLMES ST	A ERWIN RD	DEAD END	A MEDIUM/0-5	MEDIUM/LOW	HIGH/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	496.01	17	936.92	52.96	Full Depth Patching: \$2,342 Minor Rehab: \$13,117 Surface Patching: \$937 Crack Seal: \$470
4154	HUNT DR	A HUNT VALLEY DR	DEAD END	A LOW/0-5	NONE	LOW/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	413.65	22	1011.13	53.86	Minor Rehab: \$14,156
2526	HUNT VALLEY DR	A TILGHMAN DR	DEAD END	A MEDIUM/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	582.90	22	1424.86	53.17	Minor Rehab: \$19,948 Surface Patching: \$4,275
1693	JACKSON RD	A ZACHARY LN	S SAMPSON AVE	A MEDIUM/10-25	HIGH/HIGH	MEDIUM/0-5	HIGH/EXTREME	NONE	HIGH/HIGH	MEDIUM/10-25	No	989.62	20	2199.15	29.40	Surface Patching: \$17,593 Crack Seal: \$937
4912	JACKSON RD	A JACKSON RD	STEWART ST	A MEDIUM/25-50	NONE	LOW/0-5	HIGH/EXTREME	NONE	HIGH/MEDIUM	MEDIUM/10-25	No	336.13	20	746.95	47.49	Crack Seal: \$318
4913	JACKSON RD	A STEWART ST	S SAMPSON AVE	A NONE	HIGH/HIGH	MEDIUM/0-5	HIGH/EXTREME	NONE	HIGH/HIGH	MEDIUM/10-25	No	498.45	20	1107.67	30.12	Surface Patching: \$1,108 Crack Seal: \$472
4914	JACKSON RD	A S SAMPSON AVE	ZACHARY LN	A NONE	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	HIGH/HIGH	MEDIUM/10-25	No	321.96	20	715.47	30.22	Crack Seal: \$305
4918	JACKSON RD	A SUNSET DR	JACKSON RD	A LOW/0-5	MEDIUM/HIGH	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	1953.87	22	4776.13	68.30	Surface Patching: \$4,776 Crack Seal: \$1,850 Preservation: \$19,105
4941	JACKSON RD	A COVINGTON LN	SUNSET DR	A MEDIUM/0-5	MEDIUM/HIGH	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	872.50	22	2132.79	68.30	Surface Patching: \$2,133 Crack Seal: \$826 Preservation: \$8,531
4967	JERNIGAN TER	A W CUMBERLAND ST	W DIVINE ST	A LOW/0-5	NONE	LOW/10-25	MEDIUM/EXTREME	NONE	NONE	NONE	No	375.64	19	793.02	67.11	Minor Rehab: \$11,102
18992	JESS LN	A TILGHMAN DR	JUDE CT	A NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	Yes	484.71	22	1184.84	82.92	Preservation: \$4,739
18994	JESS LN	A JUDE CT	CUL-DE-SAC	A NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	Yes	240.89	22	588.84	82.92	Preservation: \$2,355
4018	JESSIE TART CIR	A E CUMBERLAND ST	DEAD END	A MEDIUM/25-50	NONE	HIGH/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	397.38	35	1545.36	50.03	Full Depth Patching: \$3,863 Minor Rehab: \$21,635 Crack Seal: \$376
2215	JONES DR	A GUY AVE	A GUY AVE	A MEDIUM/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	MEDIUM/MEDIUM	NONE	NONE	No	1191.20	20	2647.11	60.61	Minor Rehab: \$37,060 Surface Patching: \$7,941
5042	JOY ST	A SUE AVE	S POWELL AVE	A LOW/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	No	1054.20	30	3514.01	48.82	Major Rehab: \$80,822
18995	JUDE CT	A JESS LN	CUL-DE-SAC	A NONE												

1017	MOON CIR	A	PLUTO ST	VENUS DR	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	293.38	36	1173.53	65.86	Minor Rehab: \$16,429 Surface Patching: \$3,521 Crack Seal: \$278
1019	MOON CIR	A	JUPITER DR	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	101.56	36	406.22	56.28	Minor Rehab: \$5,687
1020	MOON CIR	A	MARS DR	JUPITER DR	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	298.83	36	1195.32	65.86	Minor Rehab: \$16,734 Crack Seal: \$283
1021	MOON CIR	A	VENUS DR	MARS DR	A	LOW/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	299.01	36	1196.04	65.16	Minor Rehab: \$16,745 Crack Seal: \$283
7904	MOORE ST	A	BURKE ST	E GRANVILLE ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	No	286.29	21	668	96.00	No Treatment
2177	MURCHISON DR	A	BRIARCLIFF DR	CUL-DE-SAC	A	LOW/0-5	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	607.14	30	2023.8	51.69	Minor Rehab: \$28,333
7451	N CLINTON AVE	A	CAROLINA DR	E WAKE ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	701.38	22	1714.49	67.13	Minor Rehab: \$24,003 Surface Patching: \$1,714 Crack Seal: \$664
2395	N ELLIS AVE	A	W EDGERTON ST	W HARNETT ST	A	LOW/5-10	HIGH/LOW	MEDIUM/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	Yes	365.08	26	1054.67	66.21	Minor Rehab: \$14,765 Surface Patching: \$6,328 Crack Seal: \$346
2396	N ELLIS AVE	A	W HARNETT ST	W VANCE ST	A	LOW/5-10	HIGH/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	370.59	26	1070.6	66.94	Minor Rehab: \$14,988 Crack Seal: \$351
2397	N ELLIS AVE	A	W VANCE ST	W CARR ST	A	MEDIUM/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	Yes	717.12	26	2071.67	66.34	Full Depth Patching: \$5,179 Minor Rehab: \$29,003 Surface Patching: \$12,430 Crack Seal: \$679
2398	N ELLIS AVE	A	W CARR ST	W JOHNSON ST	A	MEDIUM/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	344.46	26	995.1	82.75	Surface Patching: \$995 Preservation: \$3,980
2403	N ELLIS AVE	A	W JOHNSON ST	W SURLES ST	A	MEDIUM/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	335.80	26	970.08	82.75	Surface Patching: \$970 Preservation: \$3,880
2404	N ELLIS AVE	A	W SURLES ST	W COLE ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	347.97	26	1005.25	82.92	Preservation: \$4,021
4928	N ELLIS AVE	A	W BROAD ST	W EDGERTON ST	A	LOW/0-5	NONE	NONE	NONE	NONE	NONE	NONE	Yes	365.88	26	1056.99	99.00	No Treatment
7476	N ELLIS AVE	A	W COLE ST	W GRANVILLE ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	380.39	26	1098.91	82.92	Preservation: \$4,396
1060	N ELM AVE	A	E VANCE ST	E CARR ST	A	MEDIUM/0-5	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	540.13	20	1200.28	67.13	Minor Rehab: \$16,804 Surface Patching: \$2,400 Crack Seal: \$511
5078	N ELM AVE	A	E BROAD ST	E EDGERTON ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	370.09	43	1768.22	100.00	No Treatment
5081	N ELM AVE	A	E EDGERTON ST	E HARNETT ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	363.49	33	1332.78	100.00	No Treatment
5082	N ELM AVE	A	E HARNETT ST	E VANCE ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	377.56	22	922.92	65.64	Minor Rehab: \$12,921 Surface Patching: \$923 Crack Seal: \$358
1009	N FAYETTEVILLE AVE	A	W JOHNSON ST	W COLE ST	A	LOW/0-5	HIGH/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	682.54	21	1592.6	71.43	Crack Seal: \$646 Preservation: \$6,370
2476	N FAYETTEVILLE AVE	A	W CARR ST	W JOHNSON ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	346.02	21	807.38	79.07	Surface Patching: \$807 Crack Seal: \$328 Preservation: \$3,230
2477	N FAYETTEVILLE AVE	A	W VANCE ST	W CARR ST	A	MEDIUM/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	714.10	21	1666.24	80.94	Surface Patching: \$4,999 Crack Seal: \$676 Preservation: \$6,665
4807	N FAYETTEVILLE AVE	A	W HARNETT ST	W VANCE ST	A	HIGH/5-10	NONE	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/25-50	Yes	363.75	44	1778.31	50.24	Full Depth Patching: \$13,337 Minor Rehab: \$24,896
4808	N FAYETTEVILLE AVE	A	W EDGERTON ST	W HARNETT ST	A	MEDIUM/25-50	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	374.85	44	1832.59	48.15	Major Rehab: \$42,150 Crack Seal: \$355
4921	N FAYETTEVILLE AVE	A	W BROAD ST	W EDGERTON ST	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	366.55	44	1792.02	81.99	Crack Seal: \$347 Preservation: \$7,168
7463	N FAYETTEVILLE AVE	A	N FAYETTEVILLE AVE	W WAKE ST	A	LOW/0-5	MEDIUM/LOW	HIGH/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	947.41	21	2210.61	81.35	Full Depth Patching: \$5,527 Surface Patching: \$11,053 Crack Seal: \$897 Preservation: \$8,842
7464	N FAYETTEVILLE AVE	A	W COLE ST	N FAYETTEVILLE AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	381.38	21	889.89	79.33	Surface Patching: \$890 Crack Seal: \$361 Preservation: \$3,560
2394	N GENERAL LEE AVE	A	W EDGERTON ST	W HARNETT ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	Yes	380.88	23	973.35	96.00	No Treatment
2482	N GENERAL LEE AVE	A	W CARR ST	DEAD END	A	NONE	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	283.19	23	723.71	66.25	Minor Rehab: \$10,132 Surface Patching: \$724 Crack Seal: \$268
2483	N GENERAL LEE AVE	A	W COLE ST	W GRANVILLE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	369.26	24	984.7	82.61	Preservation: \$3,939
6304	N GENERAL LEE AVE	A	W GRANVILLE ST	W BARRINGTON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	342.26	22	836.62	65.57	Minor Rehab: \$11,713 Surface Patching: \$2,510 Crack Seal: \$324
9014	N GENERAL LEE AVE	A	W CARR ST	W SURLES ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	688.53	23	1759.58	51.99	Minor Rehab: \$24,634 Crack Seal: \$652
9015	N GENERAL LEE AVE	A	W SURLES ST	W COLE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	337.49	24	899.97	79.43	Crack Seal: \$320 Preservation: \$3,600
3900	N HOLLAND AVE	A	E HARNETT ST	DEAD END	A	LOW/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	355.29	20	789.53	67.92	Minor Rehab: \$11,053
4839	N HOLLAND AVE	A	E BROAD ST	E EDGERTON ST	A	LOW/0-5	LOW/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	359.36	20	798.58	52.94	Minor Rehab: \$11,180
4840	N HOLLAND AVE	A	E EDGERTON ST	E HARNETT ST	A	HIGH/10-25	LOW/LOW	HIGH/0-5	HIGH/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	361.13	20	802.5	49.98	Full Depth Patching: \$14,044 Major Rehab: \$18,458 Crack Seal: \$342
1694	N JACKSON ST	A	E COLE ST	E GRANVILLE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	336.57	18	673.15	82.61	Preservation: \$2,693
1695	N JACKSON ST	A	E SURLES ST	E COLE ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	345.57	18	691.15	100.00	No Treatment
1012	N KING AVE	A	W CARR ST	W JOHNSON ST	A	LOW/0-5	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	340.56	21	794.64	67.57	Minor Rehab: \$11,125
1035	N KING AVE	A	W VANCE ST	W CARR ST	A	HIGH/5-10	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	713.44	26	2061.04	66.08	Full Depth Patching: \$15,458 Minor Rehab: \$28,855 Crack Seal: \$676
2471	N KING AVE	A	W JOHNSON ST	W COLE ST	A	MEDIUM/25-50	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	679.75	20	1510.56	50.50	Minor Rehab: \$21,148 Surface Patching: \$1,511
2472	N KING AVE	A	W HARNETT ST	W VANCE ST	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	367.93	26	1062.91	81.85	Crack Seal: \$348 Preservation: \$4,252
2473	N KING AVE	A	W EDGERTON ST	W HARNETT ST	A	LOW/10-25	LOW/LOW	NONE										

7473	N MCKAY AVE	A	N MCKAY AVE	W BARRINGTON ST	A	MEDIUM/0-5	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	335.09	28	1042.52	82.13	Surface Patching: \$2,086 Crack Seal: \$317 Preservation: \$4,170
7474	N MCKAY AVE	A	W COLE ST	N MCKAY AVE	A	MEDIUM/10-25	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	Yes	378.40	38	1597.69	50.58	Minor Rehab: \$22,368 Surface Patching: \$11,184
2406	N ORANGE AVE	A	W VANCE ST	W CARR ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	713.73	30	2379.09	65.74	Minor Rehab: \$33,307 Surface Patching: \$9,516 Crack Seal: \$676
2407	N ORANGE AVE	A	W CARR ST	W JOHNSON ST	A	LOW/0-5	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	Yes	354.22	30	1180.74	66.81	Minor Rehab: \$16,530 Surface Patching: \$1,181 Crack Seal: \$335
2408	N ORANGE AVE	A	W JOHNSON ST	W SURLES ST	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	Yes	336.52	24	897.4	65.11	Minor Rehab: \$12,564 Surface Patching: \$10,769 Crack Seal: \$319
2409	N ORANGE AVE	A	W SURLES ST	W COLE ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	339.89	29	1095.2	66.45	Minor Rehab: \$15,333 Surface Patching: \$3,286 Crack Seal: \$322
2410	N ORANGE AVE	A	W COLE ST	W GRANVILLE ST	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	377.16	31	1299.12	64.99	Minor Rehab: \$18,188 Crack Seal: \$357
2411	N ORANGE AVE	A	W GRANVILLE ST	W BARRINGTON ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	Yes	335.60	21	783.08	100.00	No Treatment
2474	N ORANGE AVE	A	W EDGERTON ST	W HARNETT ST	A	NONE	HIGH/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	375.02	29	1208.4	49.78	Major Rehab: \$27,793 Crack Seal: \$355
2475	N ORANGE AVE	A	W HARNETT ST	W VANCE ST	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	373.06	30	1243.52	65.32	Minor Rehab: \$17,409 Crack Seal: \$353
4930	N ORANGE AVE	A	W BROAD ST	W EDGERTON ST	A	MEDIUM/0-5	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	361.56	29	1165.02	64.39	Minor Rehab: \$16,310 Surface Patching: \$2,330 Crack Seal: \$342
2227	N PARK AVE	A	W CARR ST	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/LOW	NONE	NONE	NONE	No	274.82	24	732.85	58.53	Minor Rehab: \$10,260
2228	N PARK AVE	A	W CARR ST	W SURLES ST	A	HIGH/5-10	MEDIUM/MEDIUM	HIGH/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	690.90	23	1765.64	50.66	Full Depth Patching: \$13,242 Minor Rehab: \$24,719 Crack Seal: \$654
2229	N PARK AVE	A	W SURLES ST	W COLE ST	A	MEDIUM/10-25	MEDIUM/MEDIUM	MEDIUM/0-5	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	336.91	23	860.99	75.49	Surface Patching: \$6,888 Crack Seal: \$319 Preservation: \$3,444
2230	N PARK AVE	A	W COLE ST	W GRANVILLE ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	375.99	23	960.87	67.04	Minor Rehab: \$13,452 Surface Patching: \$961 Crack Seal: \$356
2231	N PARK AVE	A	WESTHAVEN ST	DEAD END	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	538.11	30	1793.7	50.72	Minor Rehab: \$25,112 Surface Patching: \$14,350
2232	N PARK AVE	A	WESTHAVEN ST	FRIENDLY RD	A	LOW/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	398.07	30	1326.89	50.53	Minor Rehab: \$18,576
2184	N POWELL AVE	A	GLENEAGLES AVE	N POWELL AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	409.74	12	546.33	82.92	Preservation: \$2,185
6389	N POWELL AVE	A	CRESCENT DR	N POWELL AVE	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	424.69	12	566.25	82.50	Full Depth Patching: \$1,416 Preservation: \$2,265
6388	N POWELL AVE	A	N POWELL AVE	GLENEAGLES AVE	A	MEDIUM/5-10	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	172.97	24	461.25	67.17	Minor Rehab: \$6,458 Surface Patching: \$1,384
10263	N POWELL AVE	A	GLENEAGLES AVE	TRAFFIC CIRCLE	A	HIGH/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	975.94	12	1301.25	81.56	Full Depth Patching: \$9,759 Crack Seal: \$924 Preservation: \$5,205
10265	N POWELL AVE	A	N POWELL AVE	GLENEAGLES AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	417.11	12	556.14	82.92	Preservation: \$2,225
10266	N POWELL AVE	A	N POWELL AVE	FRIENDLY RD	A	LOW/0-5	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	201.33	48	1073.75	82.03	Surface Patching: \$5,369 Preservation: \$4,295
10411	N POWELL AVE	A	TRAFFIC CIRCLE	CRESCENT DR	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	371.70	12	495.61	81.33	Full Depth Patching: \$1,239 Crack Seal: \$352 Preservation: \$1,982
4494	N RAILROAD AVE	A	E EDGERTON ST	E HARNETT ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	367.78	20	817.29	51.54	Minor Rehab: \$11,442 Surface Patching: \$2,452 Crack Seal: \$348
10684	N RAILROAD AVE	A	E BROAD ST	E EDGERTON ST	A	LOW/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	372.56	24	993.5	50.03	Minor Rehab: \$13,909 Crack Seal: \$353
2492	N SAMPSON AVE	A	E EDGERTON ST	E HARNETT ST	A	LOW/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	367.84	24	980.91	81.78	Crack Seal: \$348 Preservation: \$3,924
4818	N SAMPSON AVE	A	E BROAD ST	E EDGERTON ST	A	HIGH/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	362.03	22	884.96	52.44	Full Depth Patching: \$2,212 Minor Rehab: \$12,389 Surface Patching: \$4,425 Crack Seal: \$343
1069	N WASHINGTON AVE	A	E HARNETT ST	E VANCE ST	A	MEDIUM/25-50	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	372.83	20	828.52	56.90	Minor Rehab: \$11,599 Crack Seal: \$353
4836	N WASHINGTON AVE	A	E EDGERTON ST	E HARNETT ST	A	MEDIUM/10-25	NONE	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	363.44	20	807.65	65.54	Minor Rehab: \$11,307 Surface Patching: \$5,654 Crack Seal: \$344
4953	N WASHINGTON AVE	A	E BROAD ST	E EDGERTON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	378.12	21	882.28	65.13	Minor Rehab: \$12,352 Surface Patching: \$7,058 Crack Seal: \$358
5087	N WASHINGTON AVE	A	E VANCE ST	E CARR ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/10-25	No	463.86	21	1082.35	65.41	Minor Rehab: \$15,153 Surface Patching: \$1,082 Crack Seal: \$439
987	N WATAUGA AVE	A	W VANCE ST	W COLE ST	A	HIGH/5-10	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	1585.89	20	3524.19	65.89	Full Depth Patching: \$26,431 Minor Rehab: \$49,339 Surface Patching: \$3,524 Crack Seal: \$1,502
994	N WATAUGA AVE	A	W HARNETT ST	W VANCE ST	A	MEDIUM/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	373.10	20	829.1	66.90	Minor Rehab: \$11,607 Surface Patching: \$829 Crack Seal: \$353
4934	N WATAUGA AVE	A	W BROAD ST	W HARNETT ST	A	LOW/0-5	MEDIUM/LOW	LOW/5-10	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	No	766.54	21	1788.58	49.74	Major Rehab: \$41,137 Crack Seal: \$726
2278	N WAYNE AVE	A	W EDGERTON ST	W HARNETT ST	A	MEDIUM/5-10	MEDIUM/HIGH	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	426.30	20	947.34	64.62	Minor Rehab: \$13,263 Surface Patching: \$2,842
2279	N WAYNE AVE	A	W HARNETT ST	W VANCE ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/5-10	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	379.70	45	1898.51	64.10	Minor Rehab: \$26,579 Surface Patching: \$5,696 Crack Seal: \$360
4933	N WAYNE AVE	A	W BROAD ST	W EDGERTON ST	A	HIGH/0-5	HIGH/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	336.69	20	748.21	55.81	Full Depth Patching: \$1,871 Minor Rehab: \$10,475 Surface Patching: \$748 Crack Seal: \$319
4825	N WILMINGTON AVE	A	E EDGERTON ST	E HARNETT ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	366.20	19	773.1	66.26	Minor Rehab: \$10,823 Crack Seal: \$347
4826	N WILMINGTON AVE	A	E HARNETT ST	E VANCE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	369.56	19	780.19	66.36	Minor Rehab: \$10,923 Crack Seal: \$350
4956	N WILMINGTON AVE	A	E BROAD ST	E EDGERTON ST	A	LOW/0-5	HIGH/HIGH	LOW										

1058	S ELLIS AVE	A	W DIVINE ST	W PEARSALL ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	368.63	20	819.18	78.58	Surface Patching: \$4,915 Crack Seal: \$349 Preservation: \$3,277
1072	S ELLIS AVE	A	W CANARY ST	W GODWIN ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	LOW/LOW	NONE	NONE	No	341.36	26	986.15	82.36	Preservation: \$3,945
2452	S ELLIS AVE	A	W BAY ST	W CANARY ST	A	NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	338.60	26	978.17	82.67	Preservation: \$3,913
2453	S ELLIS AVE	A	W GODWIN ST	W DUKE ST	A	LOW/0-5	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	NONE	No	299.78	37	1232.41	68.53	Preservation: \$4,930
4976	S ELLIS AVE	A	W BROAD ST	W CUMBERLAND ST	A	MEDIUM/5-10	LOW/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/0-5	No	377.86	36	1511.43	52.86	Minor Rehab: \$21,160 Surface Patching: \$4,534 Crack Seal: \$358
4977	S ELLIS AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	No	368.53	35	1433.17	63.94	Minor Rehab: \$20,064 Surface Patching: \$4,300 Crack Seal: \$349
4643	S ELM AVE	A	S ELM AVE	E DIVINE ST	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	373.32	21	871.08	79.12	Crack Seal: \$354 Preservation: \$3,484
4848	S ELM AVE	A	E DIVINE ST	E PEARSALL ST	A	MEDIUM/0-5	MEDIUM/LOW	HIGH/0-5	LOW/EXTREME	NONE	NONE	NONE	No	369.29	21	861.67	81.96	Full Depth Patching: \$2,154 Surface Patching: \$862 Crack Seal: \$350 Preservation: \$3,447
4849	S ELM AVE	A	E PEARSALL ST	E POPE ST	A	MEDIUM/5-10	LOW/LOW	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	367.43	21	857.33	81.29	Surface Patching: \$6,859 Crack Seal: \$348 Preservation: \$3,429
4950	S ELM AVE	A	E BROAD ST	E CUMBERLAND ST	A	LOW/5-10	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	368.52	20	818.93	50.11	Minor Rehab: \$11,465
2420	S FAYETTEVILLE AVE	A	W DIVINE ST	W PEARSALL ST	A	HIGH/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	358.95	21	837.55	81.97	Full Depth Patching: \$2,094 Crack Seal: \$340 Preservation: \$3,350
2421	S FAYETTEVILLE AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	365.21	21	852.17	66.36	Minor Rehab: \$11,930 Crack Seal: \$346
2422	S FAYETTEVILLE AVE	A	W POPE ST	W BAY ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	347.16	24	925.76	79.15	Crack Seal: \$329 Preservation: \$3,703
2423	S FAYETTEVILLE AVE	A	W BAY ST	W CANARY ST	A	LOW/0-5	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	344.92	21	804.82	82.21	Surface Patching: \$805 Crack Seal: \$327 Preservation: \$3,219
2424	S FAYETTEVILLE AVE	A	W CANARY ST	W DUKE ST	A	NONE	LOW/LOW	MEDIUM/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	642.02	21	1498.05	81.74	Surface Patching: \$8,988 Preservation: \$5,992
4483	S FAYETTEVILLE AVE	A	W GREENWOOD ST	DEAD END	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	446.74	30	1489.13	82.92	Preservation: \$5,957
4988	S FAYETTEVILLE AVE	A	W BROAD ST	W CUMBERLAND ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	370.14	42	1727.31	79.53	Crack Seal: \$351 Preservation: \$6,909
4989	S FAYETTEVILLE AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	373.94	32	1329.56	64.90	Minor Rehab: \$18,614 Surface Patching: \$3,989 Crack Seal: \$354
2427	S GENERAL LEE AVE	A	W DIVINE ST	W PEARSALL ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	368.10	23	940.7	65.99	Minor Rehab: \$13,170 Crack Seal: \$349
2428	S GENERAL LEE AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	356.10	23	910.02	65.54	Minor Rehab: \$12,740 Crack Seal: \$337
2432	S GENERAL LEE AVE	A	W POPE ST	W BAY ST	A	HIGH/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	340.86	23	871.1	81.67	Full Depth Patching: \$6,533 Preservation: \$3,484
4968	S GENERAL LEE AVE	A	W BROAD ST	W CUMBERLAND ST	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	371.47	22	908.04	49.28	Major Rehab: \$20,885 Surface Patching: \$2,724 Crack Seal: \$352
4969	S GENERAL LEE AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	372.44	23	951.8	66.17	Minor Rehab: \$13,325 Surface Patching: \$952 Crack Seal: \$353
2436	S KING AVE	A	W DIVINE ST	W PEARSALL ST	A	NONE	MEDIUM/LOW	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	Yes	365.82	26	1056.81	51.99	Minor Rehab: \$14,795 Crack Seal: \$346
2437	S KING AVE	A	W PEARSALL ST	W POPE ST	A	MEDIUM/10-25	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	359.39	26	1038.25	63.93	Minor Rehab: \$14,536 Surface Patching: \$7,268 Crack Seal: \$340
2438	S KING AVE	A	W POPE ST	W BAY ST	A	MEDIUM/10-25	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	352.73	26	1018.99	51.04	Minor Rehab: \$14,266 Surface Patching: \$7,133 Crack Seal: \$334
2440	S KING AVE	A	W BAY ST	W CANARY ST	A	HIGH/10-25	NONE	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	344.12	26	994.12	50.82	Full Depth Patching: \$17,397 Minor Rehab: \$13,918 Crack Seal: \$326
2442	S KING AVE	A	W CANARY ST	W GODWIN ST	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	333.63	26	963.83	51.74	Minor Rehab: \$13,494 Surface Patching: \$7,711 Crack Seal: \$316
2446	S KING AVE	A	W GREENWOOD ST	DEAD END	A	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	NONE	No	371.35	22	907.74	67.92	Minor Rehab: \$12,708
4022	S KING AVE	A	W DUKE ST	W GREENWOOD ST	A	LOW/5-10	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	327.64	28	1019.31	65.19	Minor Rehab: \$14,270 Crack Seal: \$310
4486	S KING AVE	A	W GODWIN ST	W DUKE ST	A	HIGH/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	334.21	28	1039.75	66.78	Full Depth Patching: \$2,599 Minor Rehab: \$14,557 Crack Seal: \$316
4984	S KING AVE	A	W BROAD ST	W CUMBERLAND ST	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	Yes	371.34	42	1732.93	50.21	Minor Rehab: \$24,261 Surface Patching: \$5,199 Crack Seal: \$352
4985	S KING AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/5-10	HIGH/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	374.08	42	1745.72	64.80	Minor Rehab: \$24,440 Surface Patching: \$6,983 Crack Seal: \$354
2429	S LAYTON AVE	A	W DIVINE ST	W PEARSALL ST	A	NONE	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	368.77	25	1024.35	51.15	Minor Rehab: \$14,341 Crack Seal: \$349
2430	S LAYTON AVE	A	W PEARSALL ST	W POPE ST	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/75-100	Yes	362.84	25	1007.89	39.58	Major Rehab: \$23,181
2431	S LAYTON AVE	A	W POPE ST	W BAY ST	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	350.91	25	974.76	50.90	Minor Rehab: \$13,647 Surface Patching: \$2,924 Crack Seal: \$332
2439	S LAYTON AVE	A	W BAY ST	W CANARY ST	A	MEDIUM/5-10	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	Yes	334.27	40	1485.62	50.59	Minor Rehab: \$20,799 Surface Patching: \$5,943 Crack Seal: \$317
2441	S LAYTON AVE	A	W CANARY ST	W GODWIN ST	A	HIGH/25-50	HIGH/LOW	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	Yes	341.30	28	1061.81	37.54	Major Rehab: \$24,422 Surface Patching: \$1,062 Crack Seal: \$323
2443	S LAYTON AVE	A	W GODWIN ST	W DUKE ST	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	336.99	28	1048.4	66.19	Minor Rehab: \$14,678 Crack Seal: \$319
2444	S LAYTON AVE	A	W DUKE ST	W GREENWOOD ST	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	323.10	28	1005.19	66.99	Minor Rehab: \$14,073 Crack Seal: \$306
2445	S LAYTON AVE	A	W GREENWOOD ST	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	399.19	28	1241.91		

4830	S WASHINGTON AVE	A	E PEARSSALL ST	S WASHINGTON AVE	A	MEDIUM/5-10	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	361.39	21	843.24	64.65	Minor Rehab: \$11,805 Surface Patching: \$2,530 Crack Seal: \$342
4832	S WASHINGTON AVE	A	E DIVINE ST	E PEARSSALL ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	371.39	21	866.57	79.43	Crack Seal: \$352 Preservation: \$3,466
4835	S WASHINGTON AVE	A	S WASHINGTON AVE	E DIVINE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	372.04	21	868.1	82.51	Crack Seal: \$352 Preservation: \$3,472
4872	S WASHINGTON AVE	A	E BAY ST	E CANARY ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	348.02	20	773.39	79.43	Crack Seal: \$330 Preservation: \$3,094
4881	S WASHINGTON AVE	A	E CANARY ST	E GODWIN ST	A	LOW/10-25	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	341.39	28	1062.1	81.15	Crack Seal: \$323 Preservation: \$4,248
4882	S WASHINGTON AVE	A	E GODWIN ST	E DUKE ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	367.14	28	1142.21	100.00	No Treatment
4902	S WASHINGTON AVE	A	E DUKE ST	HODGES AVE	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	636.11	28	1979.02	100.00	No Treatment
4951	S WASHINGTON AVE	A	E BROAD ST	E CUMBERLAND ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	369.96	30	1233.2	82.51	Crack Seal: \$350 Preservation: \$4,933
5055	S WATAUGA AVE	A	W DIVINE ST	W PEARSALL ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	351.53	21	820.23	82.92	Preservation: \$3,281
5056	S WATAUGA AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	362.64	44	1772.9	82.61	Preservation: \$7,092
7659	S WATAUGA AVE	A	W BROAD ST	W CUMBERLAND ST	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	344.48	44	1684.15	64.97	Minor Rehab: \$23,578 Surface Patching: \$13,473 Crack Seal: \$326
7660	S WATAUGA AVE	A	S WATAUGA AVE	W DIVINE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	370.72	20	823.82	81.40	Crack Seal: \$351 Preservation: \$3,295
4965	S WAYNE AVE	A	W BROAD ST	W CUMBERLAND ST	A	HIGH/0-5	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	346.34	24	923.58	64.76	Full Depth Patching: \$2,309 Minor Rehab: \$12,930 Surface Patching: \$924 Crack Seal: \$328
4966	S WAYNE AVE	A	S WAYNE AVE	W DIVINE ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	376.16	23	961.29	81.54	Surface Patching: \$5,767 Crack Seal: \$356 Preservation: \$3,845
4654	S WILMINGTON AVE	A	E PEARSALL ST	E POPE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	366.39	23	936.33	79.43	Crack Seal: \$347 Preservation: \$3,745
4852	S WILMINGTON AVE	A	S WILMINGTON AVE	E DIVINE ST	A	MEDIUM/0-5	LOW/LOW	MEDIUM/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	366.66	20	814.8	66.68	Minor Rehab: \$11,407 Surface Patching: \$1,630 Crack Seal: \$347
4853	S WILMINGTON AVE	A	E DIVINE ST	E PEARSALL ST	A	HIGH/0-5	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	373.55	20	830.1	66.22	Full Depth Patching: \$2,075 Minor Rehab: \$11,621
4906	S WILMINGTON AVE	A	E GODWIN ST	E DUKE ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	No	538.05	23	1375.03	96.00	No Treatment
2490	S WILMINGTON AVE	A	E DUKE ST	CUL-DE-SAC	A	MEDIUM/10-25	MEDIUM/LOW	LOW/5-10	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	161.66	56	1005.91	51.00	Minor Rehab: \$14,083 Surface Patching: \$12,071 Crack Seal: \$153
4957	S WILMINGTON AVE	A	E BROAD ST	E CUMBERLAND ST	A	MEDIUM/5-10	NONE	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/25-50	No	368.75	23	942.36	64.54	Minor Rehab: \$13,193 Surface Patching: \$2,827
2447	S WILSON AVE	A	E PEARSALL ST	E POPE ST	A	MEDIUM/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	357.89	20	795.32	65.82	Minor Rehab: \$11,134 Surface Patching: \$2,386 Crack Seal: \$339
2448	S WILSON AVE	A	E POPE ST	E BAY ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	353.17	21	824.07	66.45	Minor Rehab: \$11,537 Surface Patching: \$2,472 Crack Seal: \$334
4013	S WILSON AVE	A	PURDIE RD	DEAD END	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	675.02	20	1500.03	81.32	Crack Seal: \$639 Preservation: \$6,000
4641	S WILSON AVE	A	E DIVINE ST	E PEARSALL ST	A	LOW/5-10	HIGH/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	Yes	364.05	42	1698.88	64.26	Minor Rehab: \$23,784 Surface Patching: \$8,494 Crack Seal: \$345
4874	S WILSON AVE	A	E BAY ST	E CANARY ST	A	HIGH/10-25	HIGH/LOW	HIGH/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	343.31	21	801.05	63.53	Full Depth Patching: \$14,018 Minor Rehab: \$11,215 Crack Seal: \$325
4875	S WILSON AVE	A	E GODWIN ST	E DUKE ST	A	MEDIUM/10-25	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	386.01	21	900.69	65.86	Minor Rehab: \$12,610 Surface Patching: \$6,305 Crack Seal: \$366
4877	S WILSON AVE	A	E CANARY ST	E GODWIN ST	A	MEDIUM/0-5	HIGH/LOW	LOW/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	337.02	21	786.38	81.31	Surface Patching: \$4,718 Crack Seal: \$319 Preservation: \$3,146
6916	S WILSON AVE	A	E BROAD ST	E CUMBERLAND ST	A	NONE	NONE	LOW/0-5	NONE	NONE	NONE	NONE	Yes	368.23	38	1554.77	99.00	No Treatment
6917	S WILSON AVE	A	S WILSON AVE	E DIVINE ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	375.74	42	1753.47	63.47	Minor Rehab: \$24,549 Surface Patching: \$5,260
2384	SAINT ST	A	GULF DR	BYRON ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	293.93	36	1175.71	65.08	Minor Rehab: \$16,460 Surface Patching: \$3,527 Crack Seal: \$278
2385	SAINT ST	A	BYRON ST	GULF DR	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	664.93	36	2659.72	65.57	Minor Rehab: \$37,236 Surface Patching: \$7,979 Crack Seal: \$630
2386	SAINT ST	A	GULF DR	SYCAMORE ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	332.56	36	1330.23	66.25	Minor Rehab: \$18,623 Surface Patching: \$1,330 Crack Seal: \$315
2387	SAINT ST	A	SYCAMORE ST	GUM RD	A	HIGH/5-10	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	358.59	36	1434.35	66.15	Full Depth Patching: \$10,758 Minor Rehab: \$20,081 Surface Patching: \$1,434 Crack Seal: \$340
2388	SAINT ST	A	GUM RD	HOLLY AVE	A	MEDIUM/0-5	HIGH/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	347.36	36	1389.46	66.04	Minor Rehab: \$19,452 Surface Patching: \$1,389 Crack Seal: \$329
2349	SATURN ST	A	E JOHNSON ST	MOON CIR	A	MEDIUM/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	320.66	36	1282.62	66.69	Minor Rehab: \$17,957 Surface Patching: \$3,848 Crack Seal: \$304
2350	SATURN ST	A	MOON CIR	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	582.11	34	2199.08	56.08	Minor Rehab: \$30,787 Surface Patching: \$2,199 Crack Seal: \$551
2351	SATURN ST	A	MARS DR	DEAD END	A	LOW/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	433.96	36	1735.86	53.36	Minor Rehab: \$24,302 Crack Seal: \$411
2354	SATURN ST	A	VENUS DR	DEAD END	A	HIGH/10-25	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	455.55	36	1822.19	63.19	Full Depth Patching: \$31,888 Minor Rehab: \$25,511 Crack Seal: \$431
4048	SAWYER CIR	A	SUSAN TART RD	SUSAN TART RD	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	1110.92	23	2839.02	82.32	Crack Seal: \$1,052 Preservation: \$11,356
2171	SHELLY DR	A	MARLOWE DR	CUL-DE-SAC	A	LOW/0-5	HIGH/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	376.02	31	1295.18	50.49	Minor Rehab: \$18,133
2277	SHORT ST	A	S MCKAY AVE	DEAD END	A	NONE	MEDIUM/LOW	NONE	HIGH/EXTREME	HIGH/LOW	NONE	NONE	No	146.11	12	194.81	52.36	Minor Rehab: \$2,727 Crack Seal: \$138
9639	STAFFORD CT	A	CHADBURY DR	CUL-DE-SAC	A	LOW/5-10</												

4931	W BROAD ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	349.94	40	1555.28	63.88	Minor Rehab: \$21,774
4935	W BROAD ST	A	N WAYNE AVE	N WATAUGA AVE	A	LOW/5-10	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	380.64	28	1184.22	65.19	Minor Rehab: \$16,579 Crack Seal: \$360
4937	W BROAD ST	A	N WATAUGA AVE	N ASHE AVE	A	LOW/5-10	HIGH/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	190.34	33	697.93	65.40	Minor Rehab: \$9,771 Surface Patching: \$698
4938	W BROAD ST	A	N ASHE AVE	S ASHE AVE	A	LOW/10-25	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	151.67	24	404.44	64.44	Minor Rehab: \$5,662 Crack Seal: \$144
4939	W BROAD ST	A	S ASHE AVE	ERWIN RD	A	MEDIUM/5-10	HIGH/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	959.78	34	3625.84	65.59	Minor Rehab: \$50,762 Surface Patching: \$14,504 Crack Seal: \$909
6805	W BROAD ST	A	LUCKNOW SQ	N FAYETTEVILLE AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	210.63	44	1029.75	82.36	Crack Seal: \$199 Preservation: \$4,119
6806	W BROAD ST	A	E BROAD ST	LUCKNOW SQ	A	MEDIUM/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	195.01	44	953.38	82.25	Surface Patching: \$953 Crack Seal: \$185 Preservation: \$3,814
8905	W BROAD ST	A	N GENERAL LEE AVE	N WAYNE AVE	A	MEDIUM/5-10	HIGH/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	972.03	30	3240.09	64.41	Minor Rehab: \$45,361 Surface Patching: \$29,161 Crack Seal: \$920
2251	W CANARY ST	A	S LAYTON AVE	W CANARY ST	A	HIGH/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	361.71	26	1044.95	63.15	Full Depth Patching: \$18,287 Minor Rehab: \$14,629 Crack Seal: \$343
2253	W CANARY ST	A	W CANARY ST	S ELLIS AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	345.38	26	997.76	82.61	Preservation: \$3,991
2260	W CANARY ST	A	S FAYETTEVILLE AVE	S KING AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	363.76	18	727.52	66.25	Minor Rehab: \$10,185 Surface Patching: \$728 Crack Seal: \$344
2261	W CANARY ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	363.87	26	1051.17	82.51	Crack Seal: \$345 Preservation: \$4,205
986	W CARR ST	A	N PARK AVE	CUL-DE-SAC	A	NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	325.75	23	832.48	82.67	Preservation: \$3,330
991	W CARR ST	A	N GENERAL LEE AVE	N PARK AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	336.40	23	859.7	81.85	Crack Seal: \$319 Preservation: \$3,439
998	W CARR ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	HIGH/LOW	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	354.34	21	826.79	66.62	Minor Rehab: \$11,575 Surface Patching: \$827 Crack Seal: \$336
1002	W CARR ST	A	N MCKAY AVE	N ELLIS AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	351.97	21	821.26	65.57	Minor Rehab: \$11,498 Surface Patching: \$5,749 Crack Seal: \$333
1005	W CARR ST	A	N LAYTON AVE	N MCKAY AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	355.28	21	828.98	65.35	Minor Rehab: \$11,606 Surface Patching: \$9,948 Crack Seal: \$336
1013	W CARR ST	A	N KING AVE	N LAYTON AVE	A	LOW/0-5	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	378.52	21	883.21	51.44	Minor Rehab: \$12,365
1028	W CARR ST	A	N FAYETTEVILLE AVE	N KING AVE	A	MEDIUM/10-25	NONE	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	No	363.50	21	848.17	63.59	Full Depth Patching: \$2,120 Minor Rehab: \$11,874 Surface Patching: \$10,178
2262	W CARR ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/10-25	HIGH/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	347.69	23	888.53	49.10	Full Depth Patching: \$15,549 Major Rehab: \$20,436 Surface Patching: \$2,666 Crack Seal: \$329
956	W COLE ST	A	W MORRIS CIR	N WAUTAGA AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	444.33	24	1184.87	82.61	Preservation: \$4,739
974	W COLE ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/25-50	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	347.15	23	887.17	37.99	Major Rehab: \$20,405 Surface Patching: \$887 Crack Seal: \$329
1493	W COLE ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	353.07	20	784.61	66.32	Minor Rehab: \$10,985 Surface Patching: \$785 Crack Seal: \$334
2193	W COLE ST	A	E MORRIS CIR	W MORRIS CIR	A	HIGH/0-5	LOW/HIGH	HIGH/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	528.36	23	1350.25	65.08	Full Depth Patching: \$3,376 Minor Rehab: \$18,904 Crack Seal: \$500
2194	W COLE ST	A	N PARK AVE	E MORRIS CIR	A	MEDIUM/5-10	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	338.05	23	863.91	64.65	Minor Rehab: \$12,095 Surface Patching: \$2,592 Crack Seal: \$320
2195	W COLE ST	A	N GENERAL LEE AVE	N PARK AVE	A	HIGH/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	353.68	23	903.85	63.18	Full Depth Patching: \$15,817 Minor Rehab: \$12,654 Crack Seal: \$335
2196	W COLE ST	A	N FAYETTEVILLE AVE	N KING AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	No	365.67	20	812.61	81.94	Preservation: \$3,250
2197	W COLE ST	A	N KING AVE	N LAYTON AVE	A	HIGH/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	367.99	19	776.88	78.94	Full Depth Patching: \$1,942 Crack Seal: \$348 Preservation: \$3,108
2198	W COLE ST	A	N LAYTON AVE	N MCKAY AVE	A	MEDIUM/10-25	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	No	359.76	20	799.46	64.84	Minor Rehab: \$11,192 Surface Patching: \$5,596 Crack Seal: \$341
2984	W COLE ST	A	N MCKAY AVE	N ELLIS AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	356.17	20	791.48	66.13	Minor Rehab: \$11,081 Surface Patching: \$1,582 Crack Seal: \$337
6334	W COLE ST	A	N WATAUGA AVE	N ASHE AVE	A	LOW/0-5	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	1566.35	25	4350.98	66.45	Minor Rehab: \$60,914
2310	W DIVINE ST	A	LUCKNOW SQ	S FAYETTEVILLE AVE	A	MEDIUM/50-75	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	Yes	212.50	28	661.11	37.78	Major Rehab: \$15,206 Crack Seal: \$201
4477	W DIVINE ST	A	E DIVINE ST	LUCKNOW SQ	A	MEDIUM/5-10	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	195.96	35	762.07	52.65	Minor Rehab: \$10,669 Surface Patching: \$3,048 Crack Seal: \$186
2311	W DIVINE ST	A	S LAYTON AVE	S MCKAY AVE	A	LOW/0-5	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	360.45	28	1121.41	82.74	Crack Seal: \$341 Preservation: \$4,486
2312	W DIVINE ST	A	S FAYETTEVILLE AVE	S KING AVE	A	LOW/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	360.77	26	1042.24	48.94	Major Rehab: \$23,972
2313	W DIVINE ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	370.31	26	1069.78	49.87	Major Rehab: \$24,605 Crack Seal: \$351
2314	W DIVINE ST	A	S MCKAY AVE	S ELLIS AVE	A	MEDIUM/5-10	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	339.78	35	1321.35	81.24	Surface Patching: \$10,571 Crack Seal: \$322 Preservation: \$5,285
2315	W DIVINE ST	A	S ELLIS AVE	S ORANGE AVE	A	HIGH/5-10	NONE	MEDIUM/0-5	LOW/EXTREME	LOW/LOW	NONE	NONE	Yes	360.45	28	1121.41	81.15	Full Depth Patching: \$8,411 Surface Patching: \$1,121 Preservation: \$4,486
2316	W DIVINE ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	343.94	28	1070.05	65.36	Minor Rehab: \$14,981 Crack Seal: \$326
2317	W DIVINE ST	A	S WAYNE AVE	S WATAUGA AVE	A	LOW/0-5	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	378.34	28	1177.06	82.86	Preservation: \$4,708
2318	W DIVINE ST	A	S GENERAL LEE AVE	JERNIGAN TER	A	MEDIUM/25-50	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	639.35	28	1989.07	57.17	

6703	W HARNETT ST	A	E HARNETT ST	N FAYETTEVILLE AVE	A	HIGH/0-5	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	No	406.33	22	993.26	49.96	Full Depth Patching: \$2,483 Major Rehab: \$22,845
2245	W JOHNSON ST	A	N FAYETTEVILLE AVE	N KING AVE	A	LOW/0-5	NONE	NONE	HIGH/LOW	NONE	NONE	No	362.15	20	804.78	81.69	Preservation: \$3,219	
2246	W JOHNSON ST	A	N KING AVE	N LAYTON AVE	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	No	379.93	19	802.08	79.53	Crack Seal: \$360 Preservation: \$3,208	
2247	W JOHNSON ST	A	N MCKAY AVE	N ELLIS AVE	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	No	346.07	21	807.49	82.92	Preservation: \$3,230	
2248	W JOHNSON ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	NONE	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	358.75	20	797.22	52.79	Minor Rehab: \$11,161 Surface Patching: \$5,580
2250	W JOHNSON ST	A	N LAYTON AVE	N MCKAY AVE	A	HIGH/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	LOW/0-5	No	356.71	20	792.68	67.44	Full Depth Patching: \$1,982 Minor Rehab: \$11,098
2496	W MORRIS CIR	A	E MORRIS CIR	W COLE ST	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	905.41	24	2414.42	65.38	Minor Rehab: \$33,802 Surface Patching: \$12,072 Crack Seal: \$857
1070	W PEARSALL ST	A	E PEARSALL ST	S FAYETTEVILLE AVE	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	403.32	28	1254.77	67.23	Minor Rehab: \$17,567 Crack Seal: \$382
2255	W PEARSALL ST	A	S ELLIS AVE	S ORANGE AVE	A	LOW/5-10	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	356.35	35	1385.82	51.36	Minor Rehab: \$19,401 Crack Seal: \$337
2264	W PEARSALL ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	LOW/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	HIGH/LOW	NONE	MEDIUM/25-50	No	344.63	35	1340.22	66.33	Minor Rehab: \$18,763 Crack Seal: \$326
2467	W PEARSALL ST	A	S LAYTON AVE	S MCKAY AVE	A	MEDIUM/0-5	NONE	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	Yes	358.82	26	1036.58	52.57	Minor Rehab: \$14,512 Surface Patching: \$6,220 Crack Seal: \$340
2468	W PEARSALL ST	A	S MCKAY AVE	S ELLIS AVE	A	MEDIUM/5-10	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	346.64	35	1348.04	50.65	Minor Rehab: \$18,873 Surface Patching: \$4,044 Crack Seal: \$328
2469	W PEARSALL ST	A	S FAYETTEVILLE AVE	S KING AVE	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/25-50	Yes	373.14	28	1160.88	64.16	Minor Rehab: \$16,252 Surface Patching: \$1,161 Crack Seal: \$353
2470	W PEARSALL ST	A	S KING AVE	S LAYTON AVE	A	NONE	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	358.76	26	1036.41	50.33	Minor Rehab: \$14,510
5040	W PEARSALL ST	A	S ANN AVE	DEAD END	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	462.67	30	1542.24	78.43	Crack Seal: \$438 Preservation: \$6,169
1027	W PEARSALL ST	A	S ANN AVE	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	No	363.22	30	1210.73	56.28	Minor Rehab: \$16,950	
5054	W PEARSALL ST	A	S GENERAL LEE AVE	S WATAUGA AVE	A	LOW/5-10	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	1355.41	34	5120.44	81.43	Surface Patching: \$30,723 Crack Seal: \$1,284 Preservation: \$20,482
2268	W POPE ST	A	S FAYETTEVILLE AVE	S KING AVE	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	Yes	364.71	26	1053.59	79.53	Crack Seal: \$345 Preservation: \$4,214	
2269	W POPE ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	369.44	26	1067.26	82.61	Preservation: \$4,269
2270	W POPE ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	NONE	LOW/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	351.54	21	820.26	80.96	Crack Seal: \$333 Preservation: \$3,281
2271	W POPE ST	A	S RAILROAD AVE	S FAYETTEVILLE AVE	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	Yes	346.76	18	693.51	66.88	Minor Rehab: \$9,709 Crack Seal: \$328
2272	W POPE ST	A	S MCKAY AVE	S ORANGE AVE	A	LOW/5-10	MEDIUM/MEDIUM	NONE	LOW/EXTREME	HIGH/LOW	NONE	MEDIUM/25-50	No	700.86	26	2024.7	65.71	Minor Rehab: \$28,346 Crack Seal: \$664
2273	W POPE ST	A	S LAYTON AVE	S MCKAY AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	LOW/0-5	HIGH/EXTREME	LOW/MEDIUM	NONE	MEDIUM/10-25	Yes	355.41	22	868.77	50.32	Minor Rehab: \$12,163 Surface Patching: \$869 Crack Seal: \$337
5044	W POPE ST	A	S POWELL AVE	DEAD END	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	423.15	27	1269.45	79.15	Crack Seal: \$401 Preservation: \$5,078
5048	W POPE ST	A	S WATAUGA AVE	DEAD END	A	HIGH/10-25	NONE	MEDIUM/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	333.65	27	1000.95	63.05	Full Depth Patching: \$17,517 Minor Rehab: \$14,013 Surface Patching: \$1,001 Crack Seal: \$316
5049	W POPE ST	A	S GENERAL LEE AVE	CANTERBURY DR	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	No	1355.10	33	4968.71	63.49	Minor Rehab: \$69,562 Surface Patching: \$44,718 Crack Seal: \$1,283
2241	W SURLES ST	A	N PARK AVE	E MORRIS CIR	A	NONE	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	No	339.54	23	867.7	82.67	Preservation: \$3,471	
2242	W SURLES ST	A	N MCKAY AVE	N ELLIS AVE	A	LOW/0-5	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	No	349.86	19	738.6	53.21	Minor Rehab: \$10,340 Surface Patching: \$739 Crack Seal: \$331	
2244	W SURLES ST	A	N ELLIS AVE	N ORANGE AVE	A	LOW/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	No	353.80	20	786.21	53.36	Minor Rehab: \$11,007 Crack Seal: \$335	
9012	W SURLES ST	A	N GENERAL LEE AVE	N PARK AVE	A	MEDIUM/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	No	358.05	23	915.02	81.83	Surface Patching: \$915 Preservation: \$3,660	
9013	W SURLES ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	No	343.79	23	878.57	82.28	Full Depth Patching: \$2,196 Preservation: \$3,514	
2249	W VANCE ST	A	N FAYETTEVILLE AVE	N KING AVE	A	HIGH/0-5	NONE	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	367.69	20	817.08	52.78	Full Depth Patching: \$2,043 Minor Rehab: \$11,439 Crack Seal: \$348
2256	W VANCE ST	A	N MCKAY AVE	N ELLIS AVE	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	355.61	20	790.24	70.62	Crack Seal: \$337 Preservation: \$3,161
2257	W VANCE ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	HIGH/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	350.98	25	974.93	57.07	Minor Rehab: \$13,649 Surface Patching: \$975 Crack Seal: \$332
2258	W VANCE ST	A	N WAYNE AVE	S WATAUGA AVE	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	No	355.47	19	750.43	65.86	Minor Rehab: \$10,506 Surface Patching: \$2,251 Crack Seal: \$337	
2259	W VANCE ST	A	N WATAUGA AVE	DEAD END	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	No	307.93	19	650.08	65.86	Minor Rehab: \$9,101 Surface Patching: \$1,950 Crack Seal: \$292	
2327	W VANCE ST	A	N FAYETTEVILLE AVE	DEAD END	A	MEDIUM/5-10	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	375.74	19	793.23	64.55	Minor Rehab: \$11,105 Surface Patching: \$3,173 Crack Seal: \$356
4810	W VANCE ST	A	N LAYTON AVE	N MCKAY AVE	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	LOW/LOW	NONE	No	357.06	20	793.47	82.08	Full Depth Patching: \$1,984 Preservation: \$3,174	
4812	W VANCE ST	A	N KING AVE	N LAYTON AVE	A	LOW/0-5	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	No	365.45	20	812.12	82.86	Preservation: \$3,248	
2376	W WAKE ST	A	N RAILROAD AVE	S FAYETTEVILLE AVE	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	No	359.51	21	838.86	82.92	Preservation: \$3,355	
7483	W WAKE ST	A	N MCKAY AVE	N ELLIS AVE	A	MEDIUM/10-25	LOW/MEDIUM	LOW/10-25	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	357.69	21	834.61	51.17	Minor Rehab: \$11,685 Surface Patching: \$5,842 Crack Seal: \$339
9328	WADE AVE	A	DAVIS AVE	COOPER ST	A	MEDIUM/0-5	LOW/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE</td							



APPENDIX B

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
RANKED LIST OF SEGMENTS



Appendix B - Ranked List of Segments

SectionID	Street Name	CL	BEG_DESC	END_DESC	P	FC	TC	PP	SD	RR	RC	BC	Sidewalk	Length (ft)	Width (ft)	SqYd	PCI	Cost
10410	BEAUFORT CIR	A	CRESCENT DR	CUL-DE-SAC	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	234.24	22	572.59	100.00	No Treatment
8991	BRUNSWICK DR	A	CURRITUCK AVE	ROWAN ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	1270.39	30	4234.64	100.00	No Treatment
2185	CHAMPION DR	A	N POWELL AVE	DEAD END	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	427.82	44	2091.58	100.00	No Treatment
1010	MOON CIR	A	SATURN ST	DEAD END	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	138.28	34	522.38	100.00	No Treatment
5078	N ELM AVE	A	E BROAD ST	E EDGERTON ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	370.09	43	1768.22	100.00	No Treatment
5081	N ELM AVE	A	E EDGERTON ST	E HARNETT ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	363.49	33	1332.78	100.00	No Treatment
1695	N JACKSON ST	A	E SURLES ST	E COLE ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	345.57	18	691.15	100.00	No Treatment
6300	N MAGNOLIA AVE	A	E GRANVILLE ST	E WAKE ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	755.13	44	3691.74	100.00	No Treatment
2411	N ORANGE AVE	A	W GRANVILLE ST	W BARRINGTON ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	Yes	335.60	21	783.08	100.00	No Treatment
2399	N WILSON AVE	A	E BROAD ST	E EDGERTON ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	Yes	367.60	38	1552.09	100.00	No Treatment
4882	S WASHINGTON AVE	A	E GODWIN ST	E DUKE ST	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	367.14	28	1142.21	100.00	No Treatment
4902	S WASHINGTON AVE	A	E DUKE ST	HODGES AVE	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	No	636.11	28	1979.02	100.00	No Treatment
4927	W BROAD ST	A	N MCKAY AVE	N ELLIS AVE	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	Yes	349.23	40	1552.15	100.00	No Treatment
4929	W BROAD ST	A	N ELLIS AVE	N ORANGE AVE	A	NONE	NONE	NONE	NONE	NONE	NONE	NONE	Yes	348.83	40	1550.36	100.00	No Treatment
10409	CRESCENT DR	A	BEAUFORT CIR	N POWELL AVE	A	NONE	NONE	LOW/0-5	NONE	NONE	NONE	NONE	No	494.05	22	1207.68	99.00	No Treatment
2336	E SURLES ST	A	N WILSON AVE	DEAD END	A	NONE	NONE	LOW/0-5	NONE	NONE	NONE	NONE	No	264.67	20	588.16	99.00	No Treatment
4928	N ELLIS AVE	A	W BROAD ST	W EDGERTON ST	A	LOW/0-5	NONE	NONE	NONE	NONE	NONE	NONE	Yes	365.88	26	1056.99	99.00	No Treatment
6916	S WILSON AVE	A	E BROAD ST	E CUMBERLAND ST	A	NONE	NONE	LOW/0-5	NONE	NONE	NONE	NONE	Yes	368.23	38	1554.77	99.00	No Treatment
4876	E GODWIN ST	A	S WILSON AVE	E GODWIN ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	No	364.60	20	810.22	96.00	No Treatment
7904	MOORE ST	A	BURKE ST	E GRANVILLE ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	No	286.29	21	668	96.00	No Treatment
2394	N GENERAL LEE AVE	A	W EDGERTON ST	W HARNETT ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	Yes	380.88	23	973.35	96.00	No Treatment
4906	S WILMINGTON AVE	A	E GODWIN ST	E DUKE ST	A	NONE	LOW/LOW	NONE	NONE	NONE	NONE	NONE	No	538.05	23	1375.03	96.00	No Treatment
2362	GREENFIELD DR	A	CAROLINA DR	GREENFIELD DR	B	HIGH/0-5	NONE	NONE	NONE	NONE	NONE	NONE	Yes	1219.49	20	2709.99	94.00	Full Depth Patching: \$6,775
3216	CRESCENT DR	A	GLENEAGLES AVE	BEAUFORT CIR	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	358.93	22	877.39	83.00	Preservation: \$3,510
4949	E BROAD ST	A	N MAGNOLIA AVE	N ELM AVE	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	359.42	44	1757.15	83.00	Preservation: \$7,029
18995	JUDE CT	A	JESS LN	CUL-DE-SAC	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	217.36	22	531.32	83.00	Preservation: \$2,125
4946	N MAGNOLIA AVE	A	E BROAD ST	E EDGERTON ST	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	365.81	28	1138.07	83.00	Preservation: \$4,552
4947	S MAGNOLIA AVE	A	E BROAD ST	E CUMBERLAND ST	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	371.55	39	1610.03	83.00	Preservation: \$6,440
1073	W GODWIN ST	A	S ELLIS AVE	S ORANGE AVE	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	351.74	20	781.66	83.00	Preservation: \$3,127
3911	CRESCENT DR	A	GLENEAGLES AVE	CUL-DE-SAC	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	612.68	22	1497.67	82.92	Preservation: \$5,991
4944	E BROAD ST	A	N WILSON AVE	N CLINTON AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	363.88	44	1778.96	82.92	Preservation: \$7,116
4948	E BROAD ST	A	S CLINTON AVE	N MAGNOLIA AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	371.50	44	1816.23	82.92	Preservation: \$7,265
4845	E POPE ST	A	S WILSON AVE	DEAD END	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	341.99	20	759.97	82.92	Preservation: \$3,040
2213	FRIENDLY RD	A	MOSES TRIPP LN	N POWELL AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	526.61	20	1170.24	82.92	Preservation: \$4,681
3215	GLENEAGLES AVE	A	CRESCENT DR	N POWELL AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	387.48	31	1334.66	82.92	Preservation: \$5,339
18992	JESS LN	A	TILGHMAN DR	JUDE CT	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	Yes	484.71	22	1184.84	82.92	Preservation: \$4,739
18994	JESS LN	A	JUDE CT	CUL-DE-SAC	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	Yes	240.89	22	588.84	82.92	Preservation: \$2,355
2404	N ELLIS AVE	A	W SURLES ST	W COLE ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	347.97	26	1005.25	82.92	Preservation: \$4,021
7476	N ELLIS AVE	A	W COLE ST	W GRANVILLE ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	380.39	26	1098.91	82.92	Preservation: \$4,396
2184	N POWELL AVE	A	GLENEAGLES AVE	N POWELL AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	409.74	12	546.33	82.92	Preservation: \$2,185
10265	N POWELL AVE	A	N POWELL AVE	GLENEAGLES AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	417.11	12	556.14	82.92	Preservation: \$2,225
3453	NU HOME ST	A	N MCKAY AVE	N KING AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	301.35	20	669.66	82.92	Preservation: \$2,679
4483	S FAYETTEVILLE AVE	A	W GREENWOOD ST	DEAD END	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	446.74	30	1489.13	82.92	Preservation: \$5,957
5055	S WATAUGA AVE	A	W DIVINE ST	W PEARSALL ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	351.53	21	820.23	82.92	Preservation: \$3,281
2247	W JOHNSON ST	A	N MCKAY AVE	N ELLIS AVE	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	346.07	21	807.49	82.92	Preservation: \$3,230
2376	W WAKE ST	A	N RAILROAD AVE	N FAYETTEVILLE AVE	A	NONE	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	359.51	21	838.86	82.92	Preservation: \$3,355
2317	W DIVINE ST	A	S WAYNE AVE	S WATAUGA AVE	A	LOW/0-5	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	378.34	28	1177.06	82.86	Preservation: \$4,708
4812	W VANCE ST	A	N KING AVE</td															

2415	N MCKAY AVE	A	W CARR ST	W JOHNSON ST	A	NONE	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	359.15	20	798.1	82.61	Preservation: \$3,192
8990	ROWAN ST	A	WELLONS AVE	BRUNSWICK DR	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	346.12	30	1153.73	82.61	Preservation: \$4,615
4896	S MAGNOLIA AVE	A	E DUKE ST	BEST ST	A	NONE	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	607.36	20	1349.7	82.61	Preservation: \$5,399
5056	S WATAUGA AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	362.64	44	1772.9	82.61	Preservation: \$7,092
2460	W BAY ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	365.19	22	892.68	82.61	Preservation: \$3,571
2253	W CANARY ST	A	W CANARY ST	S ELLIS AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	345.38	26	997.76	82.61	Preservation: \$3,991
956	W COLE ST	A	W MORRIS CIR	N WAUTAGA AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	444.33	24	1184.87	82.61	Preservation: \$4,739
2269	W POPE ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	369.44	26	1067.26	82.61	Preservation: \$4,269
2331	E VANCE ST	A	N WASHINGTON AVE	N WILMINGTON AVE	A	MEDIUM/0-5	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	446.83	19	943.32	82.58	Surface Patching: \$1,886 Preservation: \$3,773
4648	S LITTLE AVE	A	E DIVINE ST	E PEARSALL ST	A	LOW/0-5	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	375.54	21	876.26	82.57	Preservation: \$3,505
2334	E CARR ST	A	N MAGNOLIA AVE	N ELM AVE	A	LOW/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	402.29	20	893.99	82.56	Crack Seal: \$381 Preservation: \$3,576
2301	CULBRETH ST	A	MCNEIL CIR	CUL-DE-SAC	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	299.61	27	898.83	82.51	Crack Seal: \$284 Preservation: \$3,595
1066	S ORANGE AVE	A	W POPE ST	W BAY ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	350.15	20	778.12	82.51	Crack Seal: \$332 Preservation: \$3,112
4835	S WASHINGTON AVE	A	S WASHINGTON AVE	E DIVINE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	372.04	21	868.1	82.51	Crack Seal: \$352 Preservation: \$3,472
4951	S WASHINGTON AVE	A	E BROAD ST	E CUMBERLAND ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	369.96	30	1233.2	82.51	Crack Seal: \$350 Preservation: \$4,933
2261	W CANARY ST	A	S KING AVE	S LAYTON AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	363.87	26	1051.17	82.51	Crack Seal: \$345 Preservation: \$4,205
1049	N MAGNOLIA AVE	A	E CLEVELAND ST	E CARR ST	A	NONE	LOW/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	339.64	21	792.49	82.50	Surface Patching: \$792 Preservation: \$3,170
6389	N POWELL AVE	A	CRESCENT DR	N POWELL AVE	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	424.69	12	566.25	82.50	Full Depth Patching: \$1,416 Preservation: \$2,265
1054	S ORANGE AVE	A	W DIVINE ST	W PEARSALL ST	A	MEDIUM/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	367.77	22	898.99	82.50	Surface Patching: \$899 Preservation: \$3,596
4980	S MCKAY AVE	A	W BROAD ST	W CUMBERLAND ST	A	LOW/0-5	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	371.11	28	1154.56	82.48	Crack Seal: \$351 Preservation: \$4,618
2293	E CLEVELAND ST	A	N RAILROAD AVE	N WILSON AVE	A	MEDIUM/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	LOW/0-5	No	349.88	21	816.38	82.46	Surface Patching: \$816 Preservation: \$3,266
1077	S ORANGE AVE	A	W GODWIN ST	CEMETERY	A	LOW/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	614.55	20	1365.66	82.44	Preservation: \$5,463
4867	E BAY ST	A	E BAY ST	S MAGNOLIA AVE	A	NONE	NONE	NONE	LOW/EXTREME	LOW/LOW	NONE	NONE	No	367.93	20	817.63	82.42	Preservation: \$3,271
4639	E DIVINE ST	A	S MAGNOLIA AVE	S ELM AVE	A	NONE	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	375.15	22	917.02	82.42	Crack Seal: \$355 Preservation: \$3,668
7425	E PEARSALL ST	A	E PEARSALL ST	S MAGNOLIA AVE	A	NONE	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	362.36	20	805.24	82.42	Crack Seal: \$343 Preservation: \$3,221
2461	W BAY ST	A	S LAYTON AVE	W BAY ST	A	LOW/5-10	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	354.85	22	867.4	82.40	Preservation: \$3,470
7466	N KING AVE	A	N KING AVE	W BARRINGTON ST	A	MEDIUM/0-5	LOW/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	336.43	20	747.61	82.38	Surface Patching: \$1,496 Preservation: \$2,990
7427	E DIVINE ST	A	E DIVINE ST	S MAGNOLIA AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	364.38	20	809.74	82.36	Crack Seal: \$345 Preservation: \$3,239
7487	EXCHANGE ST	A	FAIRVIEW ST	N ELLIS AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	347.46	32	1235.4	82.36	Crack Seal: \$329 Preservation: \$4,942
4804	N MCKAY AVE	A	W BROAD ST	W EDGERTON ST	A	LOW/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	372.51	26	1076.15	82.36	Crack Seal: \$353 Preservation: \$4,305
1072	S ELLIS AVE	A	W CANARY ST	W GODWIN ST	A	LOW/0-5	NONE	NONE	LOW/EXTREME	LOW/LOW	NONE	NONE	No	341.36	26	986.15	82.36	Preservation: \$3,945
6805	W BROAD ST	A	LUCKNOW SQ	N FAYETTEVILLE AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	210.63	44	1029.75	82.36	Crack Seal: \$199 Preservation: \$4,119
2465	W GODWIN ST	A	W GODWIN ST	S ELLIS AVE	A	HIGH/0-5	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	351.96	21	821.24	82.33	Full Depth Patching: \$2,053 Surface Patching: \$821 Preservation: \$3,285
4954	E BROAD ST	A	N WASHINGTON AVE	N WILMINGTOM AVE	A	LOW/5-10	LOW/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	448.23	44	2191.36	82.33	Crack Seal: \$424 Preservation: \$8,765
4048	SAWYER CIR	A	SUSAN TART RD	SUSAN TART RD	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	NONE	NONE	NONE	No	1110.92	23	2839.02	82.32	Crack Seal: \$1,052 Preservation: \$11,356
2478	N MAGNOLIA AVE	A	E COLE ST	E GRANVILLE ST	A	NONE	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	338.16	21	789.04	82.31	Crack Seal: \$320 Preservation: \$3,156
1061	S ORANGE AVE	A	W PEARSALL ST	W POPE ST	A	NONE	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	358.09	22	875.32	82.31	Crack Seal: \$339 Preservation: \$3,501
9013	W SURLES ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	343.79	23	878.57	82.28	Full Depth Patching: \$2,196 Preservation: \$3,514
4860	E PEARSALL ST	A	S MAGNOLIA AVE	S ELM AVE	A	LOW/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	369.51	20	821.14	82.26	Crack Seal: \$350 Preservation: \$3,285
2532	GLENFIELD DR	A	GLENEAGLES AVE	CUL-DE-SAC	A	MEDIUM/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	514.19	22	1256.91	82.25	Surface Patching: \$1,257 Crack Seal: \$487 Preservation: \$5,028
6806	W BROAD ST	A	E BROAD ST	LUCKNOW SQ	A	MEDIUM/0-5	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	Yes	195.01	44	953.38	82.25	Surface Patching: \$953 Crack Seal: \$185 Preservation: \$3,814
2423	S FAYETTEVILLE AVE	A	W BAY ST	W CANARY ST	A	LOW/0-5	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	344.92	21	804.82	82.21	Surface Patching: \$805 Crack Seal: \$327 Preservation: \$3,219
9642	GLENFIELD AVE	A	N POWELL AVE	CHADBURY DR	A	LOW/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	372.97	12	497.29	82.19	Crack Seal: \$353 Preservation: \$1,989
9639	STAFFORD CT	A	CHADBURY DR	CUL-DE-SAC	A	LOW/5-10	N											

2492	N SAMPSON AVE	A	E EDGERTON ST	E HARNETT ST	A	LOW/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	367.84	24	980.91	81.78	Crack Seal: \$348 Preservation: \$3,924
2299	MCENIR CIR	A	E HARNETT ST	CULBRETH ST	A	LOW/10-25	LOW/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	1097.50	27	3292.49	81.75	Surface Patching: \$3,292 Crack Seal: \$1,039 Preservation: \$13,170
5086	E CLEVELAND ST	A	N ELM AVE	N WASHINGTON AVE	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	358.13	20	795.84	81.75	Full Depth Patching: \$1,990 Surface Patching: \$3,979 Preservation: \$3,183
1031	N WILSON AVE	A	E JOHNSON ST	E SURLES ST	A	MEDIUM/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	349.50	20	776.66	81.75	Surface Patching: \$777 Crack Seal: \$331 Preservation: \$3,107
1036	N WILSON AVE	A	E CARR ST	E JOHNSON ST	A	MEDIUM/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	339.71	21	792.66	81.75	Surface Patching: \$793 Crack Seal: \$322 Preservation: \$3,171
2424	S FAYETTEVILLE AVE	A	W CANARY ST	W DUKE ST	A	NONE	LOW/LOW	MEDIUM/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	642.02	21	1498.05	81.74	Surface Patching: \$8,988 Preservation: \$5,992
2221	GUY AVE	A	W GRANVILLE ST	JONES DR	A	LOW/0-5	NONE	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	54.82	30	182.74	81.69	Preservation: \$731
2245	W JOHNSON ST	A	N FAYETTEVILLE AVE	N KING AVE	A	LOW/0-5	NONE	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	362.15	20	804.78	81.69	Preservation: \$3,219
2432	S GENERAL LEE AVE	A	W POPE ST	W BAY ST	A	HIGH/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	NONE	No	340.86	23	871.1	81.67	Full Depth Patching: \$6,533 Preservation: \$3,484
4805	N MCKAY AVE	A	W EDGERTON ST	W HARNETT ST	A	LOW/5-10	LOW/LOW	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	368.03	22	899.63	81.63	Surface Patching: \$4,498 Crack Seal: \$349 Preservation: \$3,599
2473	N KING AVE	A	W EDGERTON ST	W HARNETT ST	A	LOW/10-25	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	375.83	26	1085.74	81.61	Crack Seal: \$356 Preservation: \$4,343
2239	W GRANVILLE ST	A	N GENERAL LEE AVE	N PARK AVE	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	350.07	23	894.63	81.57	Crack Seal: \$332 Preservation: \$3,579
10263	N POWELL AVE	A	GLENEAGLES AVE	TRAFFIC CIRCLE	A	HIGH/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	975.94	12	1301.25	81.56	Full Depth Patching: \$9,759 Crack Seal: \$924 Preservation: \$5,205
4966	S WAYNE AVE	A	S WAYNE AVE	W DIVINE ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	376.16	23	961.29	81.54	Surface Patching: \$5,767 Crack Seal: \$356 Preservation: \$3,845
2236	W BARRINGTON ST	A	N LAYTON AVE	N MCKAY AVE	A	NONE	LOW/LOW	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	353.09	21	823.87	81.53	Preservation: \$3,295
4972	S ORANGE AVE	A	W BROAD ST	W CUMBERLAND ST	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	Yes	370.42	24	987.79	81.49	Crack Seal: \$351 Preservation: \$3,951
7456	E GRANVILLE ST	A	N CLINTON AVE	N MAGNOLIA AVE	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	369.73	21	862.71	81.49	Preservation: \$3,451
4847	E PEARSALL ST	A	S ELM AVE	S WASHINGTON AVE	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	359.49	20	798.86	81.49	Surface Patching: \$2,397 Crack Seal: \$340 Preservation: \$3,195
9641	GLENEAGLES AVE	A	ALMOND DR	GLENFIELD DR	A	HIGH/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	NONE	No	879.57	12	1172.76	81.44	Full Depth Patching: \$8,796 Preservation: \$4,691
2240	W GRANVILLE ST	A	N PARK AVE	E MORRIS CIR	A	LOW/5-10	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	289.60	25	804.43	81.44	Crack Seal: \$274 Preservation: \$3,218
5054	W PEARSALL ST	A	S GENERAL LEE AVE	S WATAUGA AVE	A	LOW/5-10	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	1355.41	34	5120.44	81.43	Surface Patching: \$30,723 Crack Seal: \$1,284 Preservation: \$20,482
6299	N LAYTON AVE	A	W CARR ST	W JOHNSON ST	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	No	354.98	31	1222.72	81.42	Surface Patching: \$3,668 Crack Seal: \$336 Preservation: \$4,891
7660	SWATAUGA AVE	A	S WATAUGA AVE	W DIVINE ST	A	LOW/0-5	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	370.72	20	823.82	81.40	Crack Seal: \$351 Preservation: \$3,295
7463	N FAYETTEVILLE AVE	A	N FAYETTEVILLE AVE	W WAKE ST	A	LOW/0-5	MEDIUM/LOW	HIGH/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	947.41	21	2210.61	81.35	Full Depth Patching: \$5,527 Surface Patching: \$11,053 Crack Seal: \$897 Preservation: \$8,842
10411	N POWELL AVE	A	TRAFFIC CIRCLE	CRESCENT DR	A	HIGH/0-5	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	371.70	12	495.61	81.33	Full Depth Patching: \$1,239 Crack Seal: \$352 Preservation: \$1,982
4013	S WILSON AVE	A	PURDIE RD	DEAD END	A	LOW/0-5	LOW/MEDIUM	NONE	LOW/EXTREME	HIGH/LOW	NONE	NONE	No	675.02	20	1500.03	81.32	Crack Seal: \$639 Preservation: \$6,000
4877	S WILSON AVE	A	E CANARY ST	E GODWIN ST	A	MEDIUM/0-5	HIGH/LOW	LOW/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	337.02	21	786.38	81.31	Surface Patching: \$4,718 Crack Seal: \$319 Preservation: \$3,146
4849	S ELM AVE	A	E PEARSALL ST	E POPE ST	A	MEDIUM/5-10	LOW/LOW	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	367.43	21	857.33	81.29	Surface Patching: \$6,859 Crack Seal: \$348 Preservation: \$3,429
2314	W DIVINE ST	A	S MCKAY AVE	S ELLIS AVE	A	MEDIUM/5-10	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	339.78	35	1321.35	81.24	Surface Patching: \$10,571 Crack Seal: \$322 Preservation: \$5,285
9643	CHADBURY DR	A	GLENEAGLES AVE	CHADBURY DR	A	LOW/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	818.33	22	2000.36	81.17	Surface Patching: \$10,002 Crack Seal: \$775 Preservation: \$8,001
2414	N MCKAY AVE	A	W JOHNSON ST	W SURLES ST	A	MEDIUM/0-5	LOW/MEDIUM	MEDIUM/0-5	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	335.21	21	782.16	81.16	Surface Patching: \$5,475 Preservation: \$3,129
4871	E CANARY ST	A	E CANARY ST	S WASHINGTON AVE	A	MEDIUM/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	LOW/10-25	No	367.07	21	856.49	81.15	Surface Patching: \$2,569 Preservation: \$3,426
4881	S WASHINGTON AVE	A	E CANARY ST	E GODWIN ST	A	LOW/10-25	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	341.39	28	1062.1	81.15	Crack Seal: \$323 Preservation: \$4,248
2315	W DIVINE ST	A	S ELLIS AVE	S ORANGE AVE	A	HIGH/5-10	NONE	MEDIUM/0-5	LOW/EXTREME	LOW/LOW	NONE	NONE	Yes	360.45	28	1121.41	81.15	Full Depth Patching: \$8,411 Surface Patching: \$1,121 Preservation: \$4,486
9640	ALMOND DR	A	GLENEAGLES AVE	GLENALMOND CT	A	LOW/10-25	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	152.25	22	372.16	81.11	Crack Seal: \$144 Preservation: \$1,489
2416	N MCKAY AVE	A	W VANCE ST	W CARR ST	A	HIGH/5-10	NONE	NONE	LOW/EXTREME	MEDIUM/LOW	NONE	NONE	No	709.71	22	1734.85	81.06	Full Depth Patching: \$13,011 Surface Patching: \$8,674 Preservation: \$6,939
2270	W POPE ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	NONE	LOW/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	351.54	21	820.26	80.96	Crack Seal: \$333 Preservation: \$3,281
2477	N FAYETTEVILLE AVE	A	W VANCE ST	W CARR ST	A	MEDIUM/5-10	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	714.10	21	1666.24	80.94	Surface Patching: \$4,999 Crack Seal: \$676 Preservation: \$6,665
4644	E PEARSALL ST	A	S WASHINGTON AVE	S WILMINGTON AVE	A	MEDIUM/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	458.02	20	1017.82	80.82	Surface Patching: \$3,053 Crack Seal: \$434 Preservation: \$4,071
5092	E CANARY ST	A	S WASHINGTON AVE	DEAD END	A	MEDIUM/5-10	LOW/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	684.84	27	2054.53	80.58	Surface Patching: \$6,164 Crack Seal: \$649 Preservation: \$8,218
7446	E SURLES ST	A	N WILSON AVE	E SURLES ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	NONE	No	357.59	21	834.38		

5040	W PEARSALL ST	A	S ANN AVE	DEAD END	A	LOW/0-5	MEDIUM/MEDIUM	NONE	LOW/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	462.67	30	1542.24	78.43	Crack Seal: \$438 Preservation: \$6,169
2303	W HARNETT ST	A	N MCKAY AVE	N ELLIS AVE	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No yes	352.16	30	1173.86	78.24	Surface Patching: \$3,522 Crack Seal: \$333 Preservation: \$4,695
2481	N LAYTON AVE	A	W JOHNSON ST	W COLE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	683.58	21	1595.01	78.02	Surface Patching: \$4,785 Crack Seal: \$647 Preservation: \$6,380
3332	GLENALMOND CT	A	ALMOND DR	ALMOND DR	A	MEDIUM/10-25	NONE	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	1168.26	22	2855.76	77.15	Surface Patching: \$19,990 Crack Seal: \$1,106 Preservation: \$11,423
9937	CHERRY LN	A	CHERRY LN	CHERRY LN	A	MEDIUM/10-25	LOW/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	No	1053.09	20	2340.2	77.03	Surface Patching: \$16,381 Crack Seal: \$997 Preservation: \$9,361
4806	W HARNETT ST	A	N FAYETTEVILLE AVE	N KING AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	354.57	30	1181.89	76.90	Surface Patching: \$8,273 Crack Seal: \$336 Preservation: \$4,728
2229	N PARK AVE	A	W SURLES ST	W COLE ST	A	MEDIUM/10-25	MEDIUM/MEDIUM	MEDIUM/0-5	LOW/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	336.91	23	860.99	75.49	Surface Patching: \$6,888 Crack Seal: \$319 Preservation: \$3,444
4890	E CANARY ST	A	SPRING BRANCH RD	S SAMPSON AVE	A	LOW/0-5	HIGH/MEDIUM	NONE	LOW/MEDIUM	NONE	NONE	MEDIUM/10-25	No	371.24	20	824.97	72.28	Preservation: \$3,300
1009	N FAYETTEVILLE AVE	A	W JOHNSON ST	W COLE ST	A	LOW/0-5	HIGH/MEDIUM	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	682.54	21	1592.6	71.43	Crack Seal: \$646 Preservation: \$6,370
2400	N LAYTON AVE	A	W EDGERTON ST	W HARNETT ST	A	LOW/5-10	HIGH/MEDIUM	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	374.20	31	1288.93	71.17	Surface Patching: \$1,289 Crack Seal: \$354 Preservation: \$5,156
2256	W VANCE ST	A	N MCKAY AVE	N ELLIS AVE	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	355.61	20	790.24	70.62	Crack Seal: \$337 Preservation: \$3,161
4831	E DIVINE ST	A	S ELM AVE	S WASHINGTON AVE	A	LOW/0-5	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	NONE	No	346.42	20	769.82	68.53	Preservation: \$3,079
2453	S ELLIS AVE	A	W GODWIN ST	W DUKE ST	A	LOW/0-5	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	NONE	No	299.78	37	1232.41	68.53	Preservation: \$4,930
7436	E CLEVELAND ST	A	N WILSON AVE	E CLEVELAND ST	A	LOW/0-5	MEDIUM/HIGH	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	359.22	20	798.26	68.30	Surface Patching: \$798 Crack Seal: \$340 Preservation: \$3,193
4918	JACKSON RD	A	SUNSET DR	JACKSON RD	A	LOW/0-5	MEDIUM/HIGH	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	1953.87	22	4776.13	68.30	Surface Patching: \$4,776 Crack Seal: \$1,850 Preservation: \$19,105
4941	JACKSON RD	A	COVINGTON LN	SUNSET DR	A	MEDIUM/0-5	MEDIUM/HIGH	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/0-5	No	872.50	22	2132.79	68.30	Surface Patching: \$2,133 Crack Seal: \$826 Preservation: \$8,531
2379	BRANDYWOOD DR	A	WOODRIDGE DR	CUL-DE-SAC	A	NONE	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	467.54	22	1142.87	68.00	Minor Rehab: \$16,000
4632	S LEHMON AVE	A	N LEHMON AVE	WHITE LINE RD	A	NONE	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	432.20	36	1728.79	68.00	Minor Rehab: \$24,203
3462	EAST POINTE WAY	A	N LEHMON AVE	EAST POINTE WAY	A	LOW/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	743.15	30	2477.16	67.92	Minor Rehab: \$34,680
10264	GLENEAGLES AVE	A	N POWELL AVE	N POWELL AVE	A	LOW/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	25.40	24	67.74	67.92	Minor Rehab: \$948
3900	N HOLLAND AVE	A	E HARNETT ST	DEAD END	A	LOW/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	355.29	20	789.53	67.92	Minor Rehab: \$11,053
2446	S KING AVE	A	W GREENWOOD ST	DEAD END	A	NONE	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	371.35	22	907.74	67.92	Minor Rehab: \$12,708
5089	E HARNETT ST	A	N WASHINGTON AVE	N WILMINGTON AVE	A	HIGH/0-5	MEDIUM/HIGH	LOW/0-5	LOW/EXTREME	LOW/LOW	NONE	NONE	No	438.09	21	1022.21	67.91	Full Depth Patching: \$2,556 Minor Rehab: \$14,311
7448	E COLE ST	A	N WILSON AVE	E COLE ST	A	NONE	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	354.26	18	708.52	67.75	Minor Rehab: \$9,919 Surface Patching: \$709
2365	ANNE ST	A	BEASLEY ST	ELDRIDGE DR	A	LOW/0-5	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	342.00	16	608	67.69	Minor Rehab: \$8,512 Surface Patching: \$608
5047	CANTERBURY DR	A	W POPE ST	PARLIAMENT PL	A	LOW/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	228.85	30	762.83	67.61	Minor Rehab: \$10,680
1012	N KING AVE	A	W CARR ST	W JOHNSON ST	A	LOW/0-5	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	340.56	21	794.64	67.57	Minor Rehab: \$11,125
5084	E CARR ST	A	N WASHINGTON AVE	E TOWNSEND ST	A	LOW/5-10	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	345.65	20	768.12	67.53	Minor Rehab: \$10,754 Crack Seal: \$327
2345	COOPER ST	A	QUEENS AVE	WESTBROOK AVE	A	LOW/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	358.83	25	996.74	67.51	Minor Rehab: \$13,954 Crack Seal: \$340
2190	S ANN AVE	A	W DIVINE ST	W PEARSALL ST	A	MEDIUM/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	291.41	30	971.38	67.50	Minor Rehab: \$13,599 Surface Patching: \$971
2274	W BAY ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	MEDIUM/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	348.42	22	851.69	67.50	Minor Rehab: \$11,924 Surface Patching: \$852
2235	W BARRINGTON ST	A	N KING AVE	N LAYTON AVE	A	HIGH/0-5	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	377.20	21	880.13	67.44	Full Depth Patching: \$2,200 Minor Rehab: \$12,322
2250	W JOHNSON ST	A	N LAYTON AVE	N MCKAY AVE	A	HIGH/0-5	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	LOW/0-5	No	356.71	20	792.68	67.44	Full Depth Patching: \$1,982 Minor Rehab: \$11,098
1053	E CLEVELAND ST	A	N MAGNOLIA AVE	N ELM AVE	A	MEDIUM/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	362.44	20	805.43	67.42	Minor Rehab: \$11,276 Surface Patching: \$805 Crack Seal: \$343
2234	ROWAN ST	A	CURRITUCK AVE	DEAD END	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	225.95	30	753.18	67.36	Minor Rehab: \$10,545 Crack Seal: \$214
5039	S ANN AVE	A	W PEARSALL ST	DEAD END	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	359.61	30	1198.7	67.36	Minor Rehab: \$16,782 Crack Seal: \$341
7901	BURKE ST	A	MOORE ST	CLAYTON ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	443.93	20	986.52	67.32	Minor Rehab: \$13,811 Crack Seal: \$420
7905	BURKE ST	A	CLAYTON ST	LINCOLN ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	335.05	20	744.56	67.32	Minor Rehab: \$10,424 Crack Seal: \$317
2294	E JOHNSON ST	A	N RAILROAD AVE	N WILSON AVE	A	HIGH/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	351.09	20	780.21	67.28	Full Depth Patching: \$1,951 Minor Rehab: \$10,923
7479	W BARRINGTON ST	A	W BARRINGTON ST	N ORANGE AVE	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	353.16	21	824.04	67.26	Minor Rehab: \$11,537 Crack Seal: \$334
1018	N WILSON AVE	A	E SURLES ST	E COLE ST	A	MEDIUM/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	329.22	21	768.19	67.25	Minor Rehab: \$10,755 Surface Patching: \$768 Crack Seal: \$312
1070	W PEARSALL ST	A	E PEARSALL ST	S FAYETTEVILLE AVE	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	Yes	403.32	28	1254.77	67.23	Minor Rehab: \$17,567 Crack Seal: \$382
2466	W GODWIN ST																	

4633	N LEHMON AVE	A	S LEHMON AVE	EAST POINTE WAY	A	MEDIUM/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	345.31	64	2455.51	66.69	Minor Rehab: \$34,377 Surface Patching: \$7,367 Crack Seal: \$327
2349	SATURN ST	A	E JOHNSON ST	MOON CIR	A	MEDIUM/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	320.66	36	1282.62	66.69	Minor Rehab: \$17,957 Surface Patching: \$3,848 Crack Seal: \$304
4857	S LITTLE AVE	A	E POPE ST	SPRING BRANCH RD	A	MEDIUM/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	320.22	25	889.51	66.68	Full Depth Patching: \$2,224 Minor Rehab: \$12,453 Surface Patching: \$890 Crack Seal: \$303
4852	S WILMINGTON AVE	A	S WILMINGTON AVE	E DIVINE ST	A	MEDIUM/0-5	LOW/LOW	MEDIUM/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	366.66	20	814.8	66.68	Minor Rehab: \$11,407 Surface Patching: \$1,630 Crack Seal: \$347
8993	MERRY ST	A	ROWAN ST	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	840.93	35	3270.27	66.66	Minor Rehab: \$45,784 Surface Patching: \$9,811 Crack Seal: \$796
2341	E WAKE ST	A	CAROLINA DR	N CLINTON AVE	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	393.80	20	875.11	66.65	Minor Rehab: \$12,252 Surface Patching: \$4,376 Crack Seal: \$373
998	W CARR ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	HIGH/LOW	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	354.34	21	826.79	66.62	Minor Rehab: \$11,175 Surface Patching: \$827 Crack Seal: \$336
7471	N LAYTON AVE	A	W COLE ST	N LAYTON AVE	A	MEDIUM/0-5	NONE	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	379.90	24	1013.07	66.58	Minor Rehab: \$14,183 Surface Patching: \$1,013
2409	N ORANGE AVE	A	W SURLES ST	W COLE ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	339.89	29	1095.2	66.45	Minor Rehab: \$15,333 Surface Patching: \$3,286 Crack Seal: \$322
2445	S LAYTON AVE	A	W GREENWOOD ST	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	399.19	28	1241.91	66.45	Minor Rehab: \$17,387 Surface Patching: \$3,726 Crack Seal: \$378
2448	S WILSON AVE	A	E POPE ST	E BAY ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	353.17	21	824.07	66.45	Minor Rehab: \$11,537 Surface Patching: \$2,472 Crack Seal: \$334
6334	W COLE ST	A	N WATAUGA AVE	N ASHE AVE	A	LOW/0-5	LOW/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	1566.35	25	4350.98	66.45	Minor Rehab: \$60,914
2218	MERRY ST	A	WELLONS AVE	WELLONS AVE	A	NONE	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	202.36	30	674.53	66.42	Minor Rehab: \$9,443 Crack Seal: \$192
2361	PLUTO ST	A	MOON CIR	DEAD END	A	NONE	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	247.05	29	796.06	66.42	Minor Rehab: \$11,145 Crack Seal: \$234
2211	WELLONS AVE	A	FRIENDLY RD	MERRY ST	A	NONE	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	355.20	30	1184	66.42	Minor Rehab: \$16,576 Crack Seal: \$336
4864	E BAY ST	A	S WILSON AVE	E BAY ST	A	LOW/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	362.68	20	805.96	66.41	Full Depth Patching: \$2,015 Minor Rehab: \$11,283 Surface Patching: \$4,030 Crack Seal: \$343
2368	ELDRIDGE DR	A	ANNE ST	DEAD END	A	LOW/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	811.18	17	1532.23	66.41	Full Depth Patching: \$5,831 Minor Rehab: \$21,451 Surface Patching: \$7,661 Crack Seal: \$768
4907	E DUKE ST	A	S WASHINGTON AVE	S WILMINGTON AVE	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	408.71	30	1362.38	66.40	Minor Rehab: \$19,073 Crack Seal: \$387
7906	LINCOLN ST	A	BURKE ST	DEAD END	A	MEDIUM/0-5	NONE	MEDIUM/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	276.58	20	614.62	66.39	Minor Rehab: \$8,605 Surface Patching: \$1,230 Crack Seal: \$262
4897	E DUKE ST	A	E DUKE ST	S MAGNOLIA AVE	A	MEDIUM/5-10	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	365.08	19	770.73	66.39	Minor Rehab: \$10,790 Surface Patching: \$3,083 Crack Seal: \$346
2464	W GODWIN ST	A	S LAYTON AVE	W GODWIN ST	A	NONE	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	361.26	26	1043.63	66.37	Minor Rehab: \$14,611 Surface Patching: \$5,218 Crack Seal: \$342
2367	BEASLEY ST	A	ANNE ST	MEADOWLARK RD	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	786.56	18	1573.12	66.36	Minor Rehab: \$22,024 Crack Seal: \$745
7907	BURKE ST	A	LINCOLN ST	DEAD END	A	LOW/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	285.28	21	665.65	66.36	Minor Rehab: \$9,319
2344	COOPER ST	A	CAROLINA DR	QUEENS AVE	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	408.48	25	1134.66	66.36	Minor Rehab: \$15,885 Crack Seal: \$387
4826	N WILMINGTON AVE	A	E HARNETT ST	E VANCE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	369.56	19	780.19	66.36	Minor Rehab: \$10,923 Crack Seal: \$350
2421	S FAYETTEVILLE AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	365.21	21	852.17	66.36	Minor Rehab: \$11,930 Crack Seal: \$346
2397	N ELLIS AVE	A	W VANCE ST	W CARR ST	A	MEDIUM/0-5	MEDIUM/LOW	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	Yes	717.12	26	2071.67	66.34	Full Depth Patching: \$5,179 Minor Rehab: \$29,003 Surface Patching: \$12,430 Crack Seal: \$679
2264	W PEARSALL ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	LOW/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	HIGH/LOW	NONE	MEDIUM/25-50	No	344.63	35	1340.22	66.33	Minor Rehab: \$18,763 Crack Seal: \$326
7903	BURKE ST	A	E JOHNSON ST	MOORE ST	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	325.98	21	760.62	66.32	Minor Rehab: \$10,649 Crack Seal: \$309
7469	N LAYTON AVE	A	N LAYTON AVE	W BARRINGTON ST	A	LOW/0-5	MEDIUM/LOW	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	337.10	21	786.56	66.32	Minor Rehab: \$11,012 Crack Seal: \$319
4823	S SAMPSON AVE	A	S SAMPSON AVE	E DIVINE ST	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	309.12	20	686.94	66.32	Minor Rehab: \$9,617 Crack Seal: \$293
1493	W COLE ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	353.07	20	784.61	66.32	Minor Rehab: \$10,985 Surface Patching: \$785 Crack Seal: \$334
909	FRIENDLY RD	A	N PARK AVE	GUY AVE	A	MEDIUM/10-25	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	681.93	20	1515.39	66.31	Minor Rehab: \$21,215 Surface Patching: \$10,608
2495	E MORRIS CIR	A	W COLE ST	W GRANVILLE ST	A	HIGH/5-10	MEDIUM/LOW	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	413.16	30	1377.21	66.30	Full Depth Patching: \$10,329 Minor Rehab: \$19,281 Surface Patching: \$1,377 Crack Seal: \$391
2191	PARLIAMENT PL	A	CANTERBURY DR	DEAD END	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	LOW/0-5	No	715.37	24	1907.65	66.29	Minor Rehab: \$26,707 Crack Seal: \$677
2328	E VANCE ST	A	N MAGNOLIA AVE	N ELM AVE	A	HIGH/5-10	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	363.39	20	807.54	66.28	Full Depth Patching: \$6,057 Minor Rehab: \$11,306 Crack Seal: \$344
4825	N WILMINGTON AVE	A	E EDGERTON ST	E HARNETT ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	366.20	19	773.1	66.26	Minor Rehab: \$10,823 Crack Seal: \$347
4020	W DIVINE ST	A	S ANN AVE	CUL-DE-SAC	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	436.29	28	1357.33	66.26	Minor Rehab: \$19,003 Crack Seal: \$413
2189	CANTERBURY DR	A	KINGSWAY DR	CAMBRIDGE CT	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	246.64	30	822.14	66.25	Minor Rehab: \$11,510 Surface Patching: \$822 Crack Seal: \$234
2482	N GENERAL LEE AVE	A	W CARR ST	DEAD END	A	NONE	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	283.19	23	723.71	66.25	Minor Rehab: \$10,132 Surface Patching: \$724 Crack Seal: \$268
7457	N WILSON AVE	A	E COLE ST	N WILSON AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE							

7900	E GRANVILLE ST	A	MOORE ST	CLAYTON ST	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	500.55	21	1167.96	65.69	Minor Rehab: \$16,351
822	EVERGREEN LN	A	BYRON ST	DEAD END	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	170.57	36	682.29	65.68	Minor Rehab: \$9,552 Surface Patching: \$4,093 Crack Seal: \$162
5082	N ELM AVE	A	E HARNETT ST	E VANCE ST	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	377.56	22	922.92	65.64	Minor Rehab: \$12,921 Surface Patching: \$923 Crack Seal: \$358
2374	EXCHANGE ST	A	FAIRGROUND RD	FAIRVIEW ST	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	269.36	21	628.5	65.60	Minor Rehab: \$8,799 Crack Seal: \$255
4939	W BROAD ST	A	S ASHE AVE	ERWIN RD	A	MEDIUM/5-10	HIGH/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	959.78	34	3625.84	65.59	Minor Rehab: \$50,762 Surface Patching: \$14,504 Crack Seal: \$909
7747	BYRON ST	A	BEALE ST	SAINT ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	524.73	36	2098.93	65.57	Minor Rehab: \$29,385 Surface Patching: \$6,297 Crack Seal: \$497
4899	HODGES AVE	A	E DUKE ST	S WASHINGTON AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	539.18	20	1198.18	65.57	Minor Rehab: \$16,775 Surface Patching: \$8,387 Crack Seal: \$511
6304	N GENERAL LEE AVE	A	W GRANVILLE ST	W BARRINGTON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	342.26	22	836.62	65.57	Minor Rehab: \$11,713 Surface Patching: \$2,510 Crack Seal: \$324
2385	SAINT ST	A	BYRON ST	GULF DR	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	664.93	36	2659.72	65.57	Minor Rehab: \$37,236 Surface Patching: \$7,979 Crack Seal: \$630
1002	W CARR ST	A	N MCKAY AVE	N ELLIS AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	351.97	21	821.26	65.57	Minor Rehab: \$11,498 Surface Patching: \$5,749 Crack Seal: \$333
2201	ROSE CIR	A	VIOLET RD	DEAD END	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	547.78	30	1825.95	65.56	Minor Rehab: \$25,563 Crack Seal: \$519
2428	S GENERAL LEE AVE	A	W PEARSALL ST	W POPE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	HIGH/LOW	NONE	NONE	No	356.10	23	910.02	65.54	Minor Rehab: \$12,740 Crack Seal: \$337
7655	ELEANOR AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	460.14	33	1687.19	65.54	Minor Rehab: \$23,621 Surface Patching: \$5,062 Crack Seal: \$436
4836	N WASHINGTON AVE	A	E EDGERTON ST	E HARNETT ST	A	MEDIUM/10-25	NONE	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	363.44	20	807.65	65.54	Minor Rehab: \$11,307 Surface Patching: \$5,654 Crack Seal: \$344
2167	MARLOWE DR	A	SHELLY DR	COLERIDGE DR	A	LOW/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	497.26	32	1768.04	65.49	Minor Rehab: \$24,753 Crack Seal: \$471
1011	MOON CIR	A	SATURN ST	PLUTO ST	A	LOW/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	440.58	36	1762.3	65.49	Minor Rehab: \$24,672
4488	W DUKE ST	A	S FAYETTEVILLE AVE	S KING AVE	A	MEDIUM/0-5	NONE	MEDIUM/10-25	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	365.05	28	1135.7	65.47	Minor Rehab: \$15,900 Surface Patching: \$9,086 Crack Seal: \$346
5473	WESTBROOK AVE	A	LAKESHORE DR	COOPER ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/5-10	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	1616.35	34	6106.22	65.44	Minor Rehab: \$85,487 Surface Patching: \$18,319 Crack Seal: \$1,531
5087	N WASHINGTON AVE	A	E VANCE ST	E CARR ST	A	MEDIUM/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/10-25	No	463.86	21	1082.35	65.41	Minor Rehab: \$15,153 Surface Patching: \$1,082 Crack Seal: \$439
4937	W BROAD ST	A	N WATAUGA AVE	N ASHE AVE	A	LOW/5-10	HIGH/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	Yes	190.34	33	697.93	65.40	Minor Rehab: \$9,771 Surface Patching: \$698
6706	W EDGERTON ST	A	E EDGERTON ST	N FAYETTEVILLE AVE	A	MEDIUM/0-5	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	406.00	44	1984.88	65.40	Minor Rehab: \$27,788 Surface Patching: \$1,985 Crack Seal: \$384
2496	W MORRIS CIR	A	E MORRIS CIR	W COLE ST	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	905.41	24	2414.42	65.38	Minor Rehab: \$33,802 Surface Patching: \$12,072 Crack Seal: \$857
2220	GUY AVE	A	JONES DR	JONES DR	A	MEDIUM/10-25	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	478.73	23	1223.42	65.36	Minor Rehab: \$17,128 Surface Patching: \$8,564 Crack Seal: \$453
2316	W DIVINE ST	A	S ORANGE AVE	S GENERAL LEE AVE	A	LOW/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	343.94	28	1070.05	65.36	Minor Rehab: \$14,981 Crack Seal: \$326
1005	W CARR ST	A	N LAYTON AVE	N MCKAY AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	NONE	No	355.28	21	828.98	65.35	Minor Rehab: \$11,606 Surface Patching: \$9,948 Crack Seal: \$336
6804	LUCKNOW SQ.	A	W BROAD ST	W CUMBERLAND ST	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	370.50	30	1235.01	65.32	Minor Rehab: \$17,290 Crack Seal: \$351
2475	N ORANGE AVE	A	W HARNETT ST	W VANCE ST	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	373.06	30	1243.52	65.32	Minor Rehab: \$17,409 Crack Seal: \$353
7746	BYRON ST	A	BASIN ST	BEALE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	389.34	36	1557.38	65.31	Minor Rehab: \$21,803 Surface Patching: \$4,672 Crack Seal: \$369
4022	S KING AVE	A	W DUKE ST	W GREENWOOD ST	A	LOW/5-10	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	327.64	28	1019.31	65.19	Minor Rehab: \$14,270 Crack Seal: \$310
4935	W BROAD ST	A	N WAYNE AVE	N WATAUGA AVE	A	LOW/5-10	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	380.64	28	1184.22	65.19	Minor Rehab: \$16,579 Crack Seal: \$360
1021	MOON CIR	A	VENUS DR	MARS DR	A	LOW/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	299.01	36	1196.04	65.16	Minor Rehab: \$16,745 Crack Seal: \$283
4953	N WASHINGTON AVE	A	E BROAD ST	E EDGERTON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	378.12	21	882.28	65.13	Minor Rehab: \$12,352 Surface Patching: \$7,058 Crack Seal: \$358
2408	N ORANGE AVE	A	W JOHNSON ST	W SURLES ST	A	MEDIUM/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	Yes	336.52	24	897.4	65.11	Minor Rehab: \$12,564 Surface Patching: \$10,769 Crack Seal: \$319
4656	S SAMPSON AVE	A	E PEARSALL ST	ENT RAMP 73 S	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	606.42	24	1617.13	65.11	Minor Rehab: \$22,640 Surface Patching: \$4,851 Crack Seal: \$574
966	LAKESHORE DR	A	CREPE MYRTLE LN	DEAD END	A	MEDIUM/10-25	MEDIUM/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	1002.02	34	3785.41	65.08	Minor Rehab: \$52,996 Surface Patching: \$26,498 Crack Seal: \$949
2384	SAINT ST	A	GULF DR	BYRON ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	293.93	36	1175.71	65.08	Minor Rehab: \$16,460 Surface Patching: \$3,527 Crack Seal: \$278
2193	W COLE ST	A	E MORRIS CIR	W MORRIS CIR	A	HIGH/0-5	LOW/HIGH	HIGH/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	528.36	23	1350.25	65.08	Full Depth Patching: \$3,376 Minor Rehab: \$18,904 Crack Seal: \$500
2459	W BAY ST	A	S FAYETTEVILLE AVE	S KING AVE	A	LOW/0-5	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	358.11	22	875.37	65.07	Minor Rehab: \$12,255 Crack Seal: \$339
6346	POPPY ST	A	WESTFIELD DR	DEAD END	A	MEDIUM/5-10	MEDIUM/MEDIUM	LOW/5-10	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	587.38	30	1957.93	65.04	Minor Rehab: \$27,411 Surface Patching: \$15,664 Crack Seal: \$556
4925	N LAYTON AVE	A	W BROAD ST	E EDGERTON ST	A	MEDIUM/0-5	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	365.90	34	1382.3	64.99	Minor Rehab: \$19,352 Surface Patching: \$1,382 Crack Seal: \$346

2494	E MORRIS CIR	A	W SURLES ST	W COLE ST	A	LOW/5-10	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	347.63	30	1158.75	64.16	Minor Rehab: \$16,223 Surface Patching: \$1,159 Crack Seal: \$329
2279	N WAYNE AVE	A	W HARNETT ST	W VANCE ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/5-10	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	379.70	45	1898.51	64.10	Minor Rehab: \$26,579 Surface Patching: \$5,696 Crack Seal: \$360
821	GULF DR	A	SAINT ST	SAINT ST	A	MEDIUM/5-10	MEDIUM/HIGH	MEDIUM/0-5	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	1010.99	30	3369.96	64.09	Minor Rehab: \$47,179 Surface Patching: \$13,480 Crack Seal: \$957
6347	MARTIN ST	A	N ASHE AVE	POPPY ST	A	MEDIUM/10-25	MEDIUM/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	698.46	30	2328.2	64.04	Minor Rehab: \$32,595 Surface Patching: \$16,297 Crack Seal: \$661
2381	FAIRWOODS CT	A	ROLLINGWOOD DR	CUL-DE-SAC	A	HIGH/10-25	NONE	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	358.10	22	875.36	63.94	Full Depth Patching: \$15,319 Minor Rehab: \$12,255 Crack Seal: \$339
4977	S ELLIS AVE	A	W CUMBERLAND ST	W DIVINE ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	No	368.53	35	1433.17	63.94	Minor Rehab: \$20,064 Surface Patching: \$4,300 Crack Seal: \$349
2437	S KING AVE	A	W PEARSALL ST	W POPE ST	A	MEDIUM/10-25	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	359.39	26	1038.25	63.93	Minor Rehab: \$14,536 Surface Patching: \$7,268 Crack Seal: \$340
4931	W BROAD ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	LOW/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	349.94	40	1555.28	63.88	Minor Rehab: \$21,774
1028	W CARR ST	A	N FAYETTEVILLE AVE	N KING AVE	A	MEDIUM/10-25	NONE	HIGH/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	No	363.50	21	848.17	63.59	Full Depth Patching: \$2,120 Minor Rehab: \$11,874 Surface Patching: \$10,178
7430	E HARNETT ST	A	E HARNETT ST	N MAGNOLIA AVE	A	HIGH/10-25	MEDIUM/LOW	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	373.52	22	913.06	63.55	Full Depth Patching: \$15,979 Minor Rehab: \$12,783 Surface Patching: \$913 Crack Seal: \$354
4874	S WILSON AVE	A	E BAY ST	E CANARY ST	A	HIGH/10-25	HIGH/LOW	HIGH/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	343.31	21	801.05	63.53	Full Depth Patching: \$14,018 Minor Rehab: \$11,215 Crack Seal: \$325
4926	W BROAD ST	A	N LAYTON AVE	N MCKAY AVE	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	No	355.06	40	1578.06	63.50	Minor Rehab: \$22,093 Surface Patching: \$4,734
5049	W POPE ST	A	S GENERAL LEE AVE	CANTERBURY DR	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	No	1355.10	33	4968.71	63.49	Minor Rehab: \$69,562 Surface Patching: \$44,718 Crack Seal: \$1,283
6917	S WILSON AVE	A	S WILSON AVE	E DIVINE ST	A	MEDIUM/5-10	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	375.74	42	1753.47	63.47	Minor Rehab: \$24,549 Surface Patching: \$5,260
2295	E HARNETT ST	A	N SAMPSON AVE	N LEE AVE	A	MEDIUM/10-25	MEDIUM/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/25-50	No	449.41	20	998.69	63.36	Minor Rehab: \$13,982 Surface Patching: \$7,990 Crack Seal: \$426
4841	E EGDERTON ST	A	N WILMINGTON AVE	N SAMPSON AVE	A	MEDIUM/0-5	HIGH/MEDIUM	MEDIUM/0-5	MEDIUM/EXTREME	MEDIUM/LOW	NONE	MEDIUM/25-50	No	916.11	34	3460.88	63.28	Minor Rehab: \$48,452 Surface Patching: \$24,226
2354	SATURN ST	A	VENUS DR	DEAD END	A	HIGH/10-25	MEDIUM/MEDIUM	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	455.55	36	1822.19	63.19	Full Depth Patching: \$31,888 Minor Rehab: \$25,511 Crack Seal: \$431
2195	W COLE ST	A	N GENERAL LEE AVE	N PARK AVE	A	HIGH/10-25	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/25-50	No	353.68	23	903.85	63.18	Full Depth Patching: \$15,817 Minor Rehab: \$12,654 Crack Seal: \$335
2251	W CANARY ST	A	S LAYTON AVE	W CANARY ST	A	HIGH/10-25	MEDIUM/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	No	361.71	26	1044.95	63.15	Full Depth Patching: \$18,287 Minor Rehab: \$14,629 Crack Seal: \$343
5048	W POPE ST	A	S WATAUGA AVE	DEAD END	A	HIGH/10-25	NONE	MEDIUM/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	333.65	27	1000.95	63.05	Full Depth Patching: \$17,517 Minor Rehab: \$14,013 Surface Patching: \$1,001 Crack Seal: \$316
5080	E HARNETT ST	A	N ELM AVE	N WASHINGTON AVE	A	HIGH/10-25	MEDIUM/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	No	373.79	21	872.17	62.89	Full Depth Patching: \$15,263 Minor Rehab: \$12,210 Crack Seal: \$354
4905	PURDIE RD	A	S CLINTON AVE	S WILSON AVE	A	HIGH/10-25	NONE	HIGH/5-10	MEDIUM/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	441.13	24	1176.35	62.59	Full Depth Patching: \$20,586 Minor Rehab: \$16,469 Crack Seal: \$418
2162	COL JOHNSON DR	A	ERWIN RD	DEAD END	A	LOW/0-5	NONE	HIGH/0-5	LOW/EXTREME	MEDIUM/MEDIUM	NONE	NONE	No	759.66	20	1688.12	62.21	Full Depth Patching: \$4,220 Minor Rehab: \$23,634
2215	JONES DR	A	GUY AVE	GUY AVE	A	MEDIUM/5-10	LOW/LOW	NONE	MEDIUM/EXTREME	MEDIUM/MEDIUM	NONE	NONE	No	1191.20	20	2647.11	60.61	Minor Rehab: \$37,060 Surface Patching: \$7,941
2227	N PARK AVE	A	W CARR ST	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/LOW	NONE	NONE	NONE	No	274.82	24	732.85	58.53	Minor Rehab: \$10,260
2296	E HARNETT ST	A	N LEE AVE	MCNEIL CIR	A	LOW/0-5	HIGH/HIGH	NONE	LOW/EXTREME	NONE	NONE	NONE	No	128.51	26	371.26	57.53	Minor Rehab: \$5,198
2210	WELLONS AVE	A	WESTHAVEN ST	FRIENDLY RD	A	LOW/5-10	HIGH/HIGH	NONE	LOW/EXTREME	NONE	NONE	NONE	No	409.06	30	1363.54	57.36	Minor Rehab: \$19,090
2318	W DIVINE ST	A	S GENERAL LEE AVE	JERNIGAN TER	A	MEDIUM/25-50	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	639.35	28	1989.09	57.17	Minor Rehab: \$27,847 Surface Patching: \$1,989
2257	W VANCE ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	HIGH/HIGH	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	350.98	25	974.93	57.07	Minor Rehab: \$13,649 Surface Patching: \$975 Crack Seal: \$332
1069	N WASHINGTON AVE	A	E HARNETT ST	E VANCE ST	A	MEDIUM/25-50	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	372.83	20	828.52	56.90	Minor Rehab: \$11,599 Crack Seal: \$353
2425	W GREENWOOD ST	A	S FAYETTEVILLE AVE	S KING AVE	A	MEDIUM/25-50	NONE	MEDIUM/0-5	MEDIUM/EXTREME	NONE	NONE	MEDIUM/5-10	No	365.20	28	1136.17	56.82	Minor Rehab: \$15,906 Surface Patching: \$1,136 Crack Seal: \$346
4866	S MAGNOLIA AVE	A	E BAY ST	E CANARY ST	A	LOW/0-5	HIGH/HIGH	LOW/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	338.35	42	1578.95	56.62	Minor Rehab: \$22,105 Crack Seal: \$320
1692	FOUNTAIN CIR	A	SUNSET DR	CUL-DE-SAC	A	HIGH/5-10	HIGH/HIGH	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	NONE	No	142.61	30	475.37	56.57	Full Depth Patching: \$3,565 Minor Rehab: \$6,655 Surface Patching: \$475
2346	COOPER ST	A	WESTBROOK AVE	DAVIS AVE	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	357.11	25	991.97	56.28	Minor Rehab: \$13,888
2217	MERRY ST	A	WELLONS AVE	CURRITUCK AVE	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	918.13	30	3060.42	56.28	Minor Rehab: \$42,846
1019	MOON CIR	A	JUPITER DR	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	101.56	36	406.22	56.28	Minor Rehab: \$5,687
7475	W GRANVILLE ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/25-50	LOW/LOW	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	350.26	23	895.11	56.28	Minor Rehab: \$12,532 Crack Seal: \$332
1027	W PEARSALL ST	A	S ANN AVE	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	363.22	30	1210.73	56.28	Minor Rehab: \$16,950
2298	E HARNETT ST	A	N LITTLE AVE	N SAMPSON AVE	A	LOW/0-5	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	MEDIUM/0-5	No	450.80	21	1051.87	56.18	Minor Rehab: \$14,726 Crack Seal: \$427
2288	WEBSTER DR	A	MEADOWLARK RD	DEAD END	A	LOW/5-10	HIGH/HIGH	NONE	MEDIUM/EXTREME	NONE	NONE	NONE	No	1255.94	37	5163.32	56.11	Minor Rehab: \$72,286
7435	E VANCE ST	A																

2389	GUM RD	A	HOLLY AVE	SAINT ST	A	MEDIUM/0-5	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	NONE	No	703.80	30	2345.98	52.80	Minor Rehab: \$32,844 Surface Patching: \$4,692 Crack Seal: \$666
2248	W JOHNSON ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/0-5	NONE	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	358.75	20	797.22	52.79	Minor Rehab: \$11,161 Surface Patching: \$5,580
2205	BISHOP LN	A	VILLAGE SQUARE DR	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	617.27	26	1783.23	52.78	Minor Rehab: \$24,965 Surface Patching: \$5,350 Crack Seal: \$585
4898	E DUKE ST	A	S MAGNOLIA AVE	HODGES AVE	A	MEDIUM/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	164.41	20	365.35	52.78	Minor Rehab: \$5,115 Surface Patching: \$1,096 Crack Seal: \$156
873	VIOLET RD	A	ROSE CIR	FRIENDLY RD	A	MEDIUM/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	377.88	36	1511.54	52.78	Minor Rehab: \$21,162 Surface Patching: \$4,535 Crack Seal: \$358
2249	W VANCE ST	A	N FAYETTEVILLE AVE	N KING AVE	A	HIGH/0-5	NONE	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	367.69	20	817.08	52.78	Full Depth Patching: \$2,043 Minor Rehab: \$11,439 Crack Seal: \$348
2207	VILLAGE SQUARE DR	A	BISHOP LN	GREENWICH CT	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	288.81	26	834.34	52.74	Minor Rehab: \$11,681 Surface Patching: \$2,503 Crack Seal: \$273
4868	E BAY ST	A	S MAGNOLIA AVE	E BAY ST	A	LOW/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	363.77	17	687.12	52.65	Minor Rehab: \$9,620 Surface Patching: \$3,436 Crack Seal: \$344
4477	W DIVINE ST	A	E DIVINE ST	LUCKNOW SQ	A	MEDIUM/5-10	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	195.96	35	762.07	52.65	Minor Rehab: \$10,669 Surface Patching: \$3,048 Crack Seal: \$186
875	WESTFIELD DR	A	DAISY ST	FRIENDLY RD	A	MEDIUM/5-10	HIGH/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	586.12	36	2344.48	52.61	Minor Rehab: \$32,823 Surface Patching: \$7,033 Crack Seal: \$555
2467	W PEARSALL ST	A	S LAYTON AVE	S MCKAY AVE	A	MEDIUM/0-5	NONE	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	Yes	358.82	26	1036.58	52.57	Minor Rehab: \$14,512 Surface Patching: \$6,220 Crack Seal: \$340
5435	KINGSWAY DR	A	QUEENSBURY CT	DEAD END	A	MEDIUM/5-10	HIGH/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/0-5	No	482.24	30	1607.48	52.53	Minor Rehab: \$22,505 Surface Patching: \$4,822 Crack Seal: \$457
4647	S LITTLE AVE	A	E PEARSALL ST	E POPE ST	A	MEDIUM/0-5	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	353.75	20	786.11	52.47	Minor Rehab: \$11,006 Surface Patching: \$5,503 Crack Seal: \$335
5914	E SURLES ST	A	N MAGNOLIA AVE	E JOHNSON ST	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	541.77	18	1083.55	52.45	Minor Rehab: \$15,170 Surface Patching: \$3,251 Crack Seal: \$513
4818	N SAMPSON AVE	A	E BROAD ST	E EDGERTON ST	A	HIGH/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	362.03	22	884.96	52.44	Full Depth Patching: \$2,212 Minor Rehab: \$12,389 Surface Patching: \$4,425 Crack Seal: \$343
7899	CLAYTON ST	A	BURKE ST	E GRANVILLE ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	283.53	18	567.07	52.36	Minor Rehab: \$7,939 Crack Seal: \$268
2277	SHORT ST	A	S MCKAY AVE	DEAD END	A	NONE	MEDIUM/LOW	NONE	HIGH/EXTREME	HIGH/LOW	NONE	NONE	No	146.11	12	194.81	52.36	Minor Rehab: \$2,727 Crack Seal: \$138
4940	SUNSET DR	A	FOUNTAIN CIR	JACKSON RD	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	334.30	30	1114.32	52.36	Minor Rehab: \$15,600 Crack Seal: \$317
2284	CRESTVIEW DR	A	CASCADE CIR	SUNSET DR	A	LOW/0-5	MEDIUM/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	333.83	30	1112.76	52.32	Minor Rehab: \$15,579 Crack Seal: \$316
1082	N LEE AVE	A	E EDGERTON ST	E HARNETT ST	A	MEDIUM/5-10	HIGH/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	375.24	20	833.88	52.32	Minor Rehab: \$11,674 Surface Patching: \$2,502 Crack Seal: \$355
1032	E COLE ST	A	N MAGNOLIA AVE	N JACKSON ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	HIGH/LOW	NONE	NONE	No	282.32	18	564.64	52.29	Minor Rehab: \$7,905 Crack Seal: \$267
2377	ROLLINGWOOD DR	A	FAIRGROUND RD	WOODRIDGE DR	A	LOW/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	283.87	30	946.22	52.21	Minor Rehab: \$13,247 Surface Patching: \$946 Crack Seal: \$269
1112	ASHLEY LN	A	WINTERLOCHEN DR	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	LOW/0-5	No	383.28	23	979.49	52.20	Minor Rehab: \$13,713 Surface Patching: \$7,835 Crack Seal: \$363
2286	SUNSET DR	A	CRESTVIEW DR	FOUNTAIN CIR	A	MEDIUM/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	657.78	30	2192.59	52.13	Minor Rehab: \$30,696 Surface Patching: \$4,386 Crack Seal: \$623
7447	E SURLES ST	A	E SURLES ST	N MAGNOLIA AVE	A	MEDIUM/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	374.31	18	748.63	52.11	Minor Rehab: \$10,481 Surface Patching: \$2,246 Crack Seal: \$354
2222	GUY AVE	A	JONES DR	WESTHAVEN ST	A	LOW/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	409.62	23	1046.8	52.11	Minor Rehab: \$14,655 Crack Seal: \$388
4916	WINTERLOCHEN DR	A	US 421 S	ASHLEY LN	A	MEDIUM/5-10	LOW/LOW	HIGH/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	751.62	30	2505.39	52.09	Full Depth Patching: \$6,263 Minor Rehab: \$35,075 Surface Patching: \$20,043 Crack Seal: \$712
2216	MERRY ST	A	ROWAN ST	WELLONS AVE	A	MEDIUM/5-10	MEDIUM/LOW	MEDIUM/5-10	HIGH/EXTREME	LOW/LOW	NONE	NONE	No	1270.41	30	4234.68	52.09	Minor Rehab: \$59,286 Surface Patching: \$25,408 Crack Seal: \$1,203
946	LAKESHORE DR	A	COOPER ST	DEAD END	A	MEDIUM/10-25	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	104.55	18	209.09	52.08	Minor Rehab: \$2,927 Surface Patching: \$1,673
2187	WINDSOR DR	A	CANTERBURY DR	KINGSWAY DR	A	MEDIUM/10-25	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	615.96	31	2121.66	52.08	Minor Rehab: \$29,703 Surface Patching: \$16,974
2226	TRACY LN	A	FAIRGROUND RD	FRIENDLY RD	A	HIGH/5-10	MEDIUM/LOW	HIGH/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	1219.67	20	2710.39	52.03	Full Depth Patching: \$20,328 Minor Rehab: \$37,945 Crack Seal: \$1,155
2520	MAY ST	A	S ELM AVE	LILLY ST	A	HIGH/0-5	MEDIUM/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	LOW/0-5	No	1328.68	26	3838.42	52.01	Full Depth Patching: \$9,596 Minor Rehab: \$53,738 Crack Seal: \$1,258
9014	N GENERAL LEE AVE	A	W CARR ST	W SURLES ST	A	LOW/0-5	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	688.53	23	1759.58	51.99	Minor Rehab: \$24,634 Crack Seal: \$652
2436	S KING AVE	A	W DIVINE ST	W PEARSALL ST	A	NONE	MEDIUM/LOW	NONE	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	Yes	365.82	26	1056.81	51.99	Minor Rehab: \$14,795 Crack Seal: \$346
7449	E COLE ST	A	E COLE ST	N MAGNOLIA AVE	A	LOW/0-5	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	369.37	18	738.75	51.87	Minor Rehab: \$10,343 Surface Patching: \$739 Crack Seal: \$350
2283	CARRIAGE CT	A	STEEPLECHASE DR	CUL-DE-SAC	A	HIGH/0-5	MEDIUM/MEDIUM	HIGH/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	290.75	23	743.03	51.83	Full Depth Patching: \$1,858 Minor Rehab: \$10,402 Crack Seal: \$275
2348	COOPER ST	A	WADE AVE	LAKESHORE DR	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	362.25	18	724.51	51.74	Minor Rehab: \$10,143 Surface Patching: \$5,797 Crack Seal: \$343
2442	S KING AVE	A	W CANARY ST	W GODWIN ST	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	No	333.63	26	963.83	51.74	Minor Rehab: \$13,494 Surface Patching: \$7,711 Crack Seal: \$316	
2206	VILLAGE SQUARE DR	A	MAPLE AVE	BISHOP LN	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	319.95	26	924.31	51.74	Minor Rehab: \$12,940 Surface Patching: \$7,394 Crack Seal: \$303
2172	COLERIDGE DR	A	MARLOWE DR	THORNDALE DR	A	LOW/0-5	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	890.90	30	2969.66	51.69	Minor Rehab: \$41,575
2202	DAISY ST	A	WESTFIELD DR	DEAD END	A	LOW/0-5												

2359	JUPITER DR	A	MOON CIR	DEAD END	A	MEDIUM/10-25	MEDIUM/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/0-5	No	1424.26	31	4905.78	51.08	Minor Rehab: \$68,681 Surface Patching: \$34,340 Crack Seal: \$1,349
4814	BEST ST	A	S CLINTON AVE	S MAGNOLIA AVE	A	MEDIUM/10-25	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	376.98	20	837.74	51.07	Minor Rehab: \$11,728 Surface Patching: \$5,864 Crack Seal: \$357
4963	S ASHE AVE	A	W BROAD ST	W CUMBERLAND ST	A	LOW/0-5	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	345.97	22	845.7	51.07	Minor Rehab: \$11,840 Crack Seal: \$328
5001	FRIENDLY RD	A	FRIENDLY RD	FRIENDLY RD	A	HIGH/5-10	MEDIUM/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	NONE	NONE	MEDIUM/0-5	No	331.01	20	735.58	51.04	Full Depth Patching: \$5,517 Minor Rehab: \$10,298 Surface Patching: \$2,207 Crack Seal: \$313
2438	S KING AVE	A	W POPE ST	W BAY ST	A	MEDIUM/10-25	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	352.73	26	1018.99	51.04	Minor Rehab: \$14,266 Surface Patching: \$7,133 Crack Seal: \$334
2500	E TOWNSEND ST	A	E CARR ST	DEAD END	A	MEDIUM/10-25	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	878.56	21	2049.97	51.03	Minor Rehab: \$28,700 Surface Patching: \$26,650 Crack Seal: \$832
893	FRIENDLY RD	A	BROOKWOOD AVE	MAPLE AVE	A	LOW/5-10	MEDIUM/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	348.03	20	773.39	51.03	Minor Rehab: \$10,827 Crack Seal: \$330
910	FRIENDLY RD	A	GUY AVE	WELLONS AVE	A	MEDIUM/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	360.61	20	801.36	51.03	Minor Rehab: \$11,219 Surface Patching: \$2,404
2302	W HARNETT ST	A	N LAYTON AVE	N MCKAY AVE	A	MEDIUM/5-10	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	357.00	30	1189.99	51.03	Minor Rehab: \$16,660 Surface Patching: \$3,570
5091	DUBOIS CIR	A	E VANCE ST	CUL-DE-SAC	A	MEDIUM/0-5	HIGH/MEDIUM	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	380.14	20	844.76	51.01	Minor Rehab: \$11,827 Surface Patching: \$5,069
2339	E GRANVILLE ST	A	N JACKSON ST	E JOHNSON ST	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	No	490.70	21	1144.98	51.01	Minor Rehab: \$16,030 Crack Seal: \$465
2490	S WILMINGTON AVE	A	E DUKE ST	CUL-DE-SAC	A	MEDIUM/10-25	MEDIUM/LOW	LOW/5-10	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/5-10	No	161.66	56	1005.91	51.00	Minor Rehab: \$14,083 Surface Patching: \$12,071 Crack Seal: \$153
4923	N KING AVE	A	W BROAD ST	W EDGERTON ST	A	LOW/0-5	HIGH/LOW	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	366.34	26	1058.32	50.99	Minor Rehab: \$14,816 Crack Seal: \$347
7437	E CLEVELAND ST	A	E CLEVELAND ST	N MAGNOLIA AVE	A	MEDIUM/10-25	HIGH/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	374.28	20	831.74	50.91	Minor Rehab: \$11,644 Surface Patching: \$5,822 Crack Seal: \$354
2343	CREPE MYRTLE LN	A	LAKESHORE DR	DEAD END	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	563.37	34	2128.31	50.90	Minor Rehab: \$29,796 Surface Patching: \$6,385 Crack Seal: \$533
914	FRIENDLY RD	A	WELLONS AVE	BYRD DR	A	MEDIUM/5-10	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	611.23	27	1833.7	50.90	Minor Rehab: \$25,672 Surface Patching: \$7,335
915	FRIENDLY RD	A	BYRD DR	CURRITUCK AVE	A	MEDIUM/5-10	NONE	MEDIUM/0-5	LOW/EXTREME	NONE	NONE	MEDIUM/50-75	No	575.87	27	1727.6	50.90	Minor Rehab: \$24,186 Surface Patching: \$6,911
2431	S LAYTON AVE	A	W POPE ST	W BAY ST	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	350.91	25	974.76	50.90	Minor Rehab: \$13,647 Surface Patching: \$2,924 Crack Seal: \$332
2491	N LITTLE AVE	A	E HARNETT ST	E VANCE ST	A	MEDIUM/10-25	HIGH/LOW	MEDIUM/0-5	HIGH/EXTREME	HIGH/LOW	NONE	NONE	No	380.02	20	844.48	50.90	Minor Rehab: \$11,823 Surface Patching: \$6,755 Crack Seal: \$360
4894	E DUKE ST	A	S WILSON AVE	E DUKE ST	A	MEDIUM/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	No	366.41	21	854.95	50.86	Minor Rehab: \$11,969 Surface Patching: \$2,565
3304	E WAKE ST	A	STONEY RUN DR	CORINTH AVE	A	HIGH/10-25	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	402.64	23	1028.96	50.86	Full Depth Patching: \$18,007 Minor Rehab: \$14,405 Crack Seal: \$381
3376	ROLLINGWOOD DR	A	BRIGHTWOOD CIR	BRANDYWOOD DR	A	HIGH/10-25	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	627.73	30	2092.44	50.86	Full Depth Patching: \$36,618 Minor Rehab: \$29,294 Crack Seal: \$594
8953	CURRITUCK AVE	A	BRUNSWICK DR	ROWAN ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	HIGH/LOW	NONE	MEDIUM/5-10	No	922.88	30	3076.27	50.85	Minor Rehab: \$43,068 Surface Patching: \$12,305 Crack Seal: \$874
2440	S KING AVE	A	W BAY ST	W CANARY ST	A	HIGH/10-25	NONE	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	344.12	26	994.12	50.82	Full Depth Patching: \$17,397 Minor Rehab: \$13,918 Crack Seal: \$326
6303	MAPLE AVE	A	FRIENDLY RD	DELANO ST	A	MEDIUM/10-25	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	595.49	18	1190.98	50.80	Minor Rehab: \$16,674 Surface Patching: \$9,528 Crack Seal: \$564
2501	E TOWNSEND ST	A	CASWELL ST	E JOHNSON ST	A	MEDIUM/5-10	MEDIUM/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/10-25	No	282.39	20	627.54	50.79	Minor Rehab: \$8,786 Surface Patching: \$2,511 Crack Seal: \$267
2231	N PARK AVE	A	WESTHAVEN ST	DEAD END	A	MEDIUM/5-10	HIGH/MEDIUM	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	538.11	30	1793.7	50.72	Minor Rehab: \$25,112 Surface Patching: \$14,350
4943	COVINGTON LN	A	S ELM AVE	CUL-DE-SAC	A	MEDIUM/10-25	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	692.31	24	1846.16	50.67	Minor Rehab: \$25,846 Surface Patching: \$22,154 Crack Seal: \$656
2524	E WAKE ST	A	CORINTH AVE	DEAD END	A	MEDIUM/25-50	NONE	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	452.40	23	1156.13	50.67	Minor Rehab: \$16,186
2228	N PARK AVE	A	W CARR ST	W SURLES ST	A	HIGH/5-10	MEDIUM/MEDIUM	HIGH/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	690.90	23	1765.64	50.66	Full Depth Patching: \$13,242 Minor Rehab: \$24,719 Crack Seal: \$654
2468	W PEARSALL ST	A	S MCKAY AVE	S ELLIS AVE	A	MEDIUM/5-10	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	346.64	35	1348.04	50.65	Minor Rehab: \$18,873 Surface Patching: \$4,044 Crack Seal: \$328
2285	CASCADE CIR	A	CRESTVIEW DR	DEAD END	A	MEDIUM/10-25	NONE	LOW/25-50	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	299.36	30	997.88	50.61	Minor Rehab: \$13,970 Surface Patching: \$11,974 Crack Seal: \$283
2439	S LAYTON AVE	A	W BAY ST	W CANARY ST	A	MEDIUM/5-10	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/5-10	Yes	334.27	40	1485.62	50.59	Minor Rehab: \$20,799 Surface Patching: \$5,943 Crack Seal: \$317
7474	N MCKAY AVE	A	W COLE ST	N MCKAY AVE	A	MEDIUM/10-25	HIGH/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	Yes	378.40	38	1597.69	50.58	Minor Rehab: \$22,368 Surface Patching: \$11,184
809	HOLLY AVE	A	SAINT ST	DEAD END	A	MEDIUM/0-5	HIGH/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/0-5	No	627.80	36	2511.19	50.57	Minor Rehab: \$35,157 Surface Patching: \$22,601 Crack Seal: \$595
2176	CHAUCER CT	A	MARLOWE DR	DEAD END	A	LOW/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	429.91	30	1433.03	50.53	Minor Rehab: \$20,062
4884	E GODWIN ST	A	S WASHINGTON AVE	DEAD END	A	HIGH/5-10	MEDIUM/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	494.42	22	1208.59	50.53	Full Depth Patching: \$9,064 Minor Rehab: \$16,920 Surface Patching: \$3,626 Crack Seal: \$468
2232	N PARK AVE	A	WESTHAVEN ST	FRIENDLY RD	A	LOW/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	398.07	30	1326.89	50.53	Minor Rehab: \$18,576
2471	N KING AVE	A	W JOHNSON ST	W COLE ST	A	MEDIUM/25-50	NONE	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	NONE	No	679.75	20	1510.56	50.50	Minor Rehab: \$21,148 Surface Patching: \$1,511
2112	E JOHNSON ST	A	E WAKE ST	SATURN ST	A	MEDIUM/0-5	MEDIUM/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	1752.42	2			

4638	E BROAD ST	A	N LEE AVE	N HOLLAND AVE	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	824.05	44	4028.67	49.74	Major Rehab: \$92,659 Surface Patching: \$12,086 Crack Seal: \$780
2549	QUEENS AVE	A	LAKESHORE DR	COOPER ST	A	MEDIUM/10-25	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/25-50	No	1906.51	34	7202.38	49.70	Major Rehab: \$165,655 Surface Patching: \$50,417 Crack Seal: \$1,805
4983	S LAYTON AVE	A	W CUMBERLAND ST	W DIVINE ST	A	NONE	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	373.11	42	1741.17	49.69	Major Rehab: \$40,047 Crack Seal: \$353
4959	E BROAD ST	A	N HOLLAND AVE	STONEY RUN DR	A	MEDIUM/5-10	HIGH/HIGH	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	277.94	20	617.64	49.64	Major Rehab: \$14,206 Surface Patching: \$2,471 Crack Seal: \$263
2413	N MCKAY AVE	A	W SURLES ST	W COLE ST	A	MEDIUM/25-50	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	NONE	No	341.40	21	796.59	49.61	Major Rehab: \$18,322 Crack Seal: \$323
7909	E JOHNSON ST	A	BURKE ST	E GRANVILLE ST	A	LOW/0-5	MEDIUM/LOW	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/50-75	No	298.37	21	696.2	49.59	Major Rehab: \$16,013 Crack Seal: \$283
2382	BRIGHTWOOD CIR	A	ROLLINGWOOD DR	CUL-DE-SAC	A	HIGH/10-25	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	233.48	30	778.27	49.36	Full Depth Patching: \$13,620 Major Rehab: \$17,900 Surface Patching: \$778 Crack Seal: \$221
2113	E JOHNSON ST	A	SATURN ST	CAROLINA DR	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	735.41	20	1634.25	49.28	Major Rehab: \$37,588 Surface Patching: \$4,903 Crack Seal: \$696
4968	S GENERAL LEE AVE	A	W BROAD ST	W CUMBERLAND ST	A	MEDIUM/5-10	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	No	371.47	22	908.04	49.28	Major Rehab: \$20,885 Surface Patching: \$2,724 Crack Seal: \$352
810	HOLLY AVE	A	PINE ST	SAINT ST	A	MEDIUM/0-5	HIGH/HIGH	MEDIUM/5-10	HIGH/EXTREME	HIGH/LOW	NONE	MEDIUM/0-5	No	366.98	36	1467.93	49.18	Major Rehab: \$33,762 Surface Patching: \$5,872 Crack Seal: \$348
10683	S RAILROAD AVE	A	W CUMBERLAND ST	E BROAD ST	A	NONE	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	370.31	22	905.21	49.17	Major Rehab: \$20,820
2262	W CARR ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/10-25	HIGH/MEDIUM	MEDIUM/5-10	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	347.69	23	888.53	49.10	Full Depth Patching: \$15,549 Major Rehab: \$20,436 Surface Patching: \$2,666 Crack Seal: \$329
4955	E BROAD ST	A	N WILMINGTON AVE	N SAMPSON AVE	A	HIGH/10-25	HIGH/MEDIUM	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	893.16	44	4366.55	49.05	Full Depth Patching: \$76,415 Major Rehab: \$100,431 Crack Seal: \$846
6337	MAPLE AVE	A	N ASHE AVE	VILLAGE SQUARE DR	A	LOW/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	No	774.51	33	2839.88	48.94	Major Rehab: \$65,317
2312	W DIVINE ST	A	S FAYETTEVILLE AVE	S KING AVE	A	LOW/5-10	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	360.77	26	1042.24	48.94	Major Rehab: \$23,972
2265	W HARNETT ST	A	N WAYNE AVE	N WATAUGA AVE	A	MEDIUM/25-50	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	No	377.02	21	879.72	48.94	Major Rehab: \$20,234
5042	JOY ST	A	SUE AVE	S POWELL AVE	A	LOW/0-5	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	No	1054.20	30	3514.01	48.82	Major Rehab: \$80,822
2309	CARLIE C'S DR	A	N ASHE AVE	DEAD END	A	MEDIUM/25-50	HIGH/MEDIUM	MEDIUM/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	1111.20	24	2963.2	48.78	Major Rehab: \$68,154 Surface Patching: \$2,963 Crack Seal: \$1,052
4491	E EDGERTON ST	A	N WILSON AVE	E EDGERTON ST	A	MEDIUM/10-25	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	351.60	44	1718.93	48.75	Major Rehab: \$39,535 Surface Patching: \$12,033 Crack Seal: \$333
2304	W HARNETT ST	A	N ELLIS AVE	N ORANGE AVE	A	MEDIUM/10-25	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/10-25	Yes	347.96	44	1701.14	48.75	Major Rehab: \$39,126 Surface Patching: \$11,908 Crack Seal: \$330
4859	S MAGNOLIA AVE	A	E DIVINE ST	E PEARSALL ST	A	NONE	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	371.47	44	1816.07	48.74	Major Rehab: \$41,770 Crack Seal: \$352
4480	E DIVINE ST	A	W DIVINE ST	S WILSON AVE	A	MEDIUM/0-5	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	Yes	39.07	43	186.68	48.65	Major Rehab: \$4,294 Surface Patching: \$187 Crack Seal: \$37
2203	MAPLE AVE	A	VILLAGE SQUARE DR	FRIENDLY RD	A	LOW/5-10	MEDIUM/LOW	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/50-75	No	625.77	34	2364.02	48.61	Major Rehab: \$54,372 Crack Seal: \$593
2178	BRIARCLIFF DR	A	MARLOWE DR	DEAD END	A	LOW/0-5	HIGH/MEDIUM	LOW/0-5	MEDIUM/EXTREME	LOW/LOW	NONE	MEDIUM/50-75	No	718.77	36	2875.08	48.48	Major Rehab: \$66,127
4858	E POPE ST	A	S LITTLE AVE	E PEARSALL ST	A	HIGH/10-25	HIGH/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	1403.20	30	4677.33	48.43	Full Depth Patching: \$81,853 Major Rehab: \$107,579 Crack Seal: \$1,329
4861	S MAGNOLIA AVE	A	E PEARSALL ST	S MAGNOLIA AVE	A	NONE	MEDIUM/LOW	MEDIUM/0-5	HIGH/EXTREME	MEDIUM/LOW	NONE	MEDIUM/50-75	Yes	361.12	44	1765.49	48.16	Major Rehab: \$40,606 Surface Patching: \$10,593 Crack Seal: \$342
4808	N FAYETTEVILLE AVE	A	W EDGERTON ST	W HARNETT ST	A	MEDIUM/25-50	MEDIUM/MEDIUM	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	374.85	44	1832.59	48.15	Major Rehab: \$42,150 Crack Seal: \$355
2306	W HARNETT ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	MEDIUM/25-50	HIGH/HIGH	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	Yes	349.97	44	1710.95	48.07	Major Rehab: \$39,352 Crack Seal: \$331
2308	W HARNETT ST	A	N GENERAL LEE AVE	N WAYNE AVE	A	MEDIUM/10-25	HIGH/HIGH	LOW/0-5	HIGH/EXTREME	NONE	NONE	MEDIUM/25-50	Yes	973.63	44	4759.96	47.95	Major Rehab: \$109,479 Surface Patching: \$33,320
2523	E WAKE ST	A	CAROLINA DR	N MAGNOLIA AVE	A	NONE	LOW/MEDIUM	NONE	LOW/EXTREME	HIGH/MEDIUM	NONE	NONE	No	346.13	24	923.01	47.92	Major Rehab: \$21,229
4912	JACKSON RD	A	JACKSON RD	STEWART ST	A	MEDIUM/25-50	NONE	LOW/0-5	HIGH/EXTREME	NONE	HIGH/MEDIUM	MEDIUM/10-25	No	336.13	20	746.95	47.49	Crack Seal: \$318
970	DAVIS AVE	A	WADE AVE	COOPER ST	A	MEDIUM/0-5	HIGH/MEDIUM	NONE	MEDIUM/EXTREME	HIGH/MEDIUM	NONE	NONE	No	657.31	34	2483.17	45.71	Major Rehab: \$57,113 Surface Patching: \$2,483
2357	MARS DR	A	MOON CIR	DEAD END	A	MEDIUM/5-10	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	HIGH/MEDIUM	NONE	MEDIUM/0-5	No	1209.33	30	4031.11	45.23	Major Rehab: \$92,716 Surface Patching: \$12,093 Crack Seal: \$1,145
5088	E EDGERTON ST	A	N WASHINGTON AVE	N WILMINGTOM AVE	A	LOW/5-10	HIGH/EXTREME	NONE	MEDIUM/EXTREME	LOW/LOW	NONE	NONE	No	443.15	26	1280.22	43.78	Major Rehab: \$29,445
3375	BRANDYWOOD DR	A	ROLLINGWOOD DR	WOODRIDGE DR	A	HIGH/25-50	NONE	LOW/0-5	MEDIUM/EXTREME	NONE	NONE	NONE	No	127.85	28	397.76	40.28	Major Rehab: \$9,148
2430	S LAYTON AVE	A	W PEARSALL ST	W POPE ST	A	NONE	NONE	NONE	LOW/EXTREME	NONE	NONE	MEDIUM/75-100	Yes	362.84	25	1007.89	39.58	Major Rehab: \$23,181
6307	DELANO ST	A	BROOKWOOD AVE	MAPLE AVE	A	HIGH/25-50	NONE	NONE	HIGH/EXTREME	NONE	NONE	MEDIUM/5-10	No	320.53	20	712.29	38.78	Major Rehab: \$16,383 Crack Seal: \$304
4891	S SAMPSON AVE	A	E GODWIN ST	DEAD END	A	HIGH/25-50	HIGH/LOW	NONE	HIGH/EXTREME	NONE	NONE	No	447.19	18	894.37	38.61	Major Rehab: \$20,571 Crack Seal: \$423	
7440	E CARR ST	A	N WILSON AVE	E CARR ST	A	HIGH/25-50	MEDIUM/LOW	LOW/0-5	HIGH/EXTREME	LOW/LOW	NONE	MEDIUM/0-5	No	353.88	23	904.37	38.39	Major Rehab: \$20,801 Crack Seal: \$335
2282	STEEPLECHASE DR	A	S ELM AVE	DEAD END	A	HIGH/25-50	MEDIUM/LOW	NONE	HIGH/EXTREME	MEDIUM/LOW	NONE	NONE	No	814.97	30	2716.56	38.26	Major Rehab: \$62,481 Surface Patching: \$13,583 Crack Seal: \$772
974	W COLE ST	A	N ORANGE AVE	N GENERAL LEE AVE	A	HIGH/25-50	MEDIUM/MEDIUM	MEDIUM/0-5	H									




APPENDIX C

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
DUNN MAPS_PCI



**City of Dunn
Pavement Condition Survey
PCI Rating**

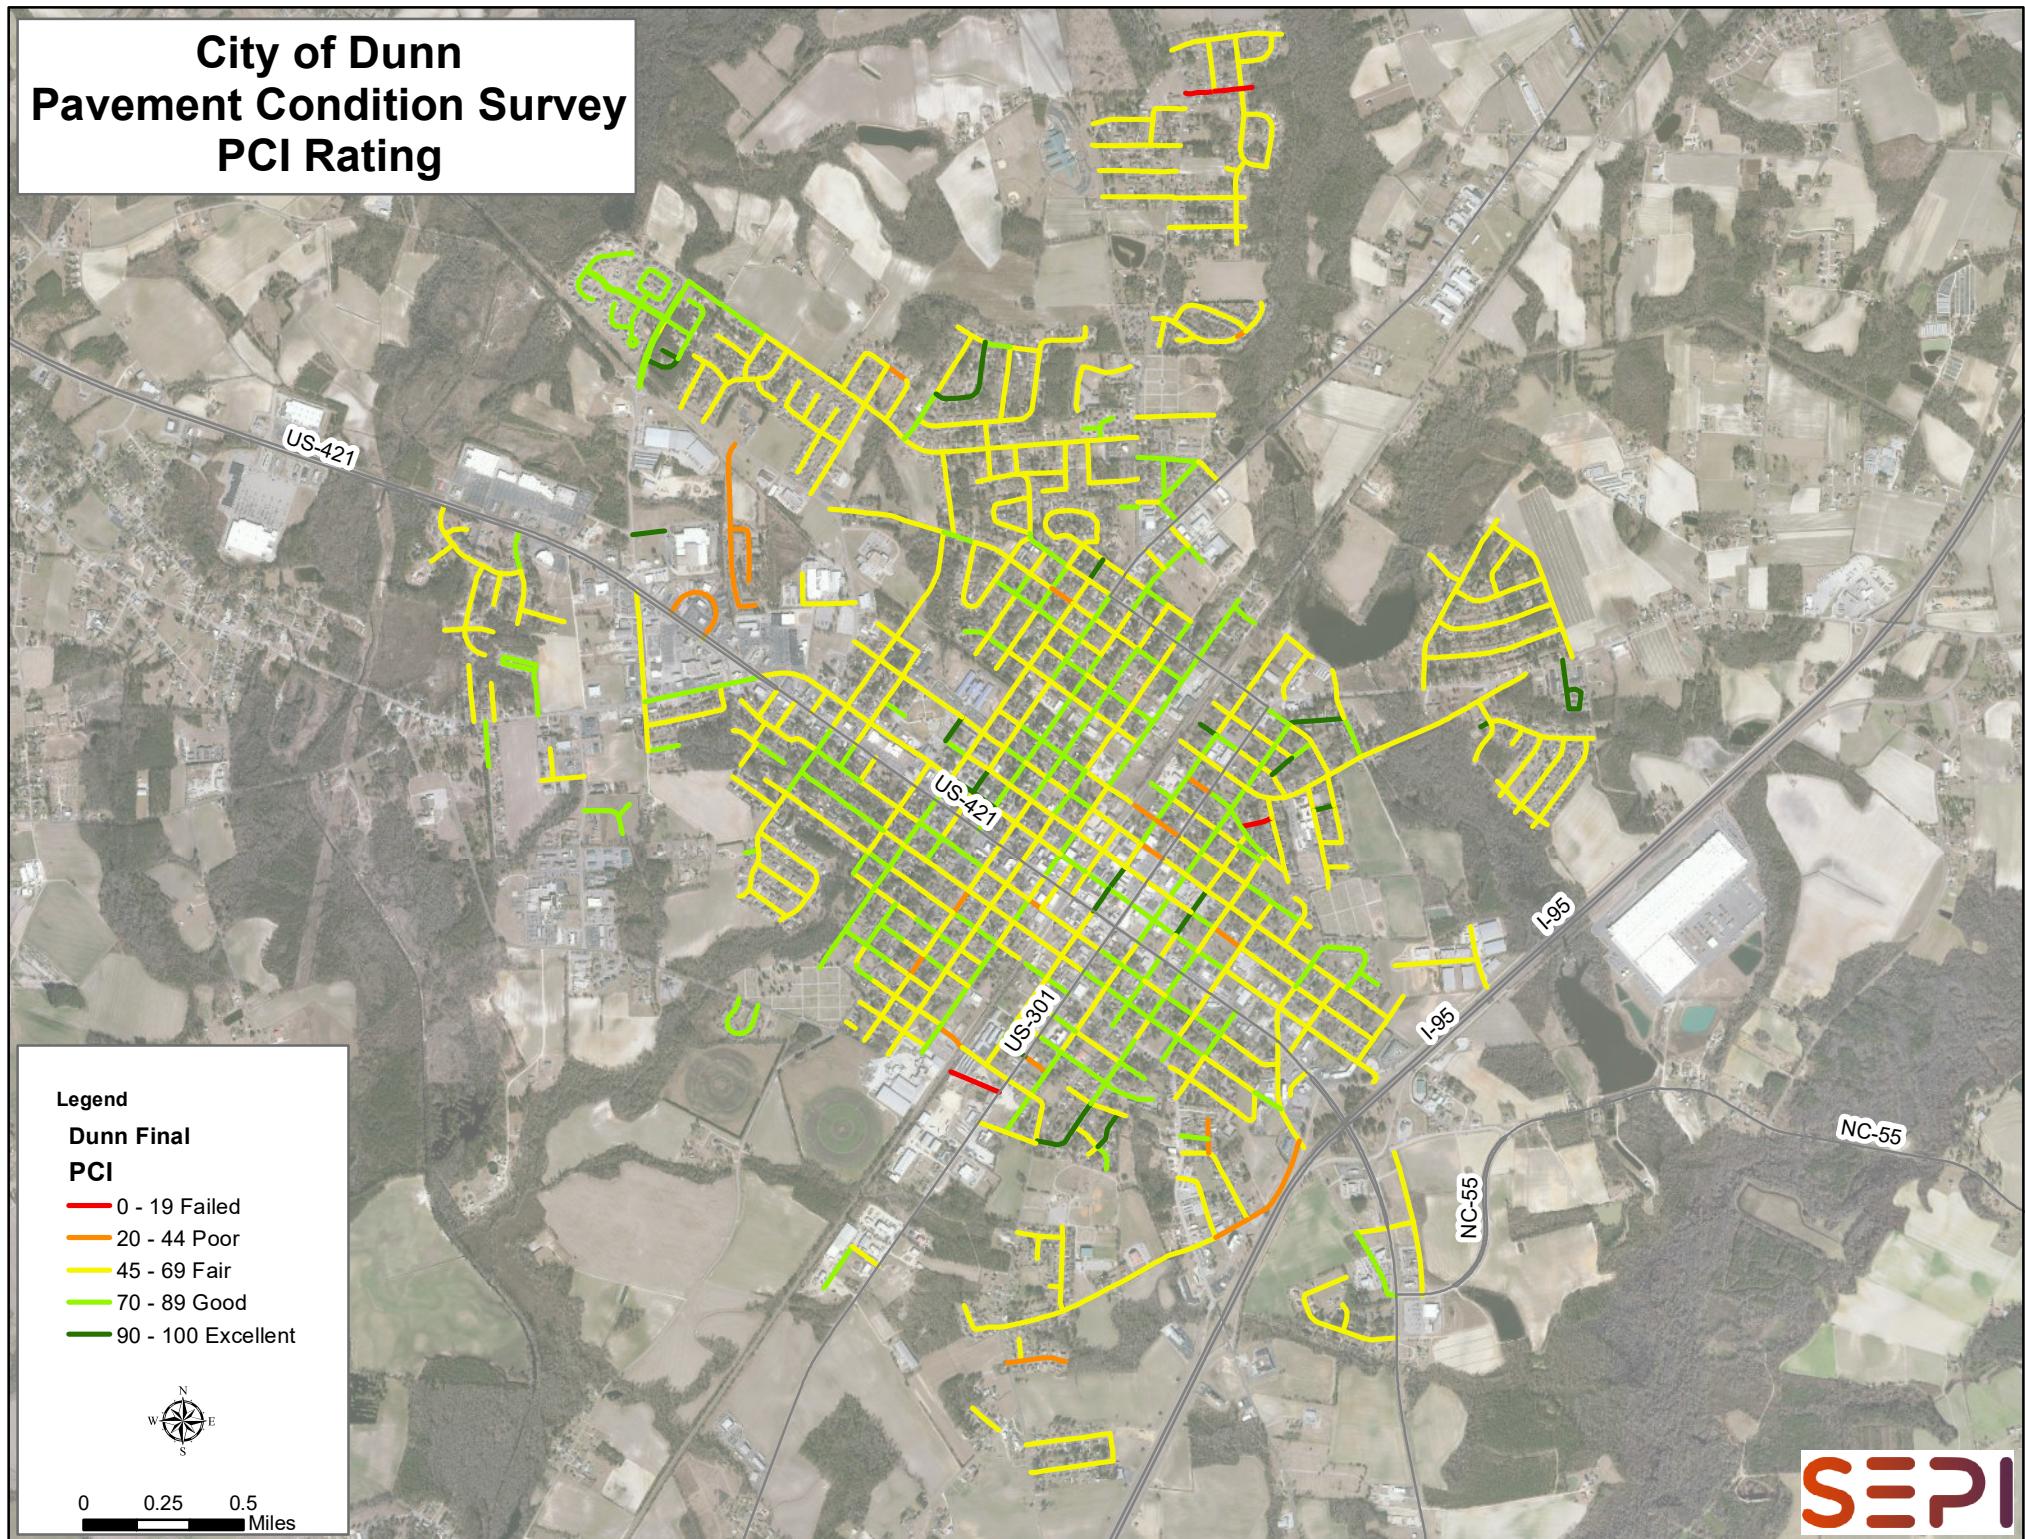

SEPI




APPENDIX D

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
DUNN MAPS_TREATMENTS
PATCHING AND CRACK SEALING



**City of Dunn
Pavement Condition Survey
Treatment Options**

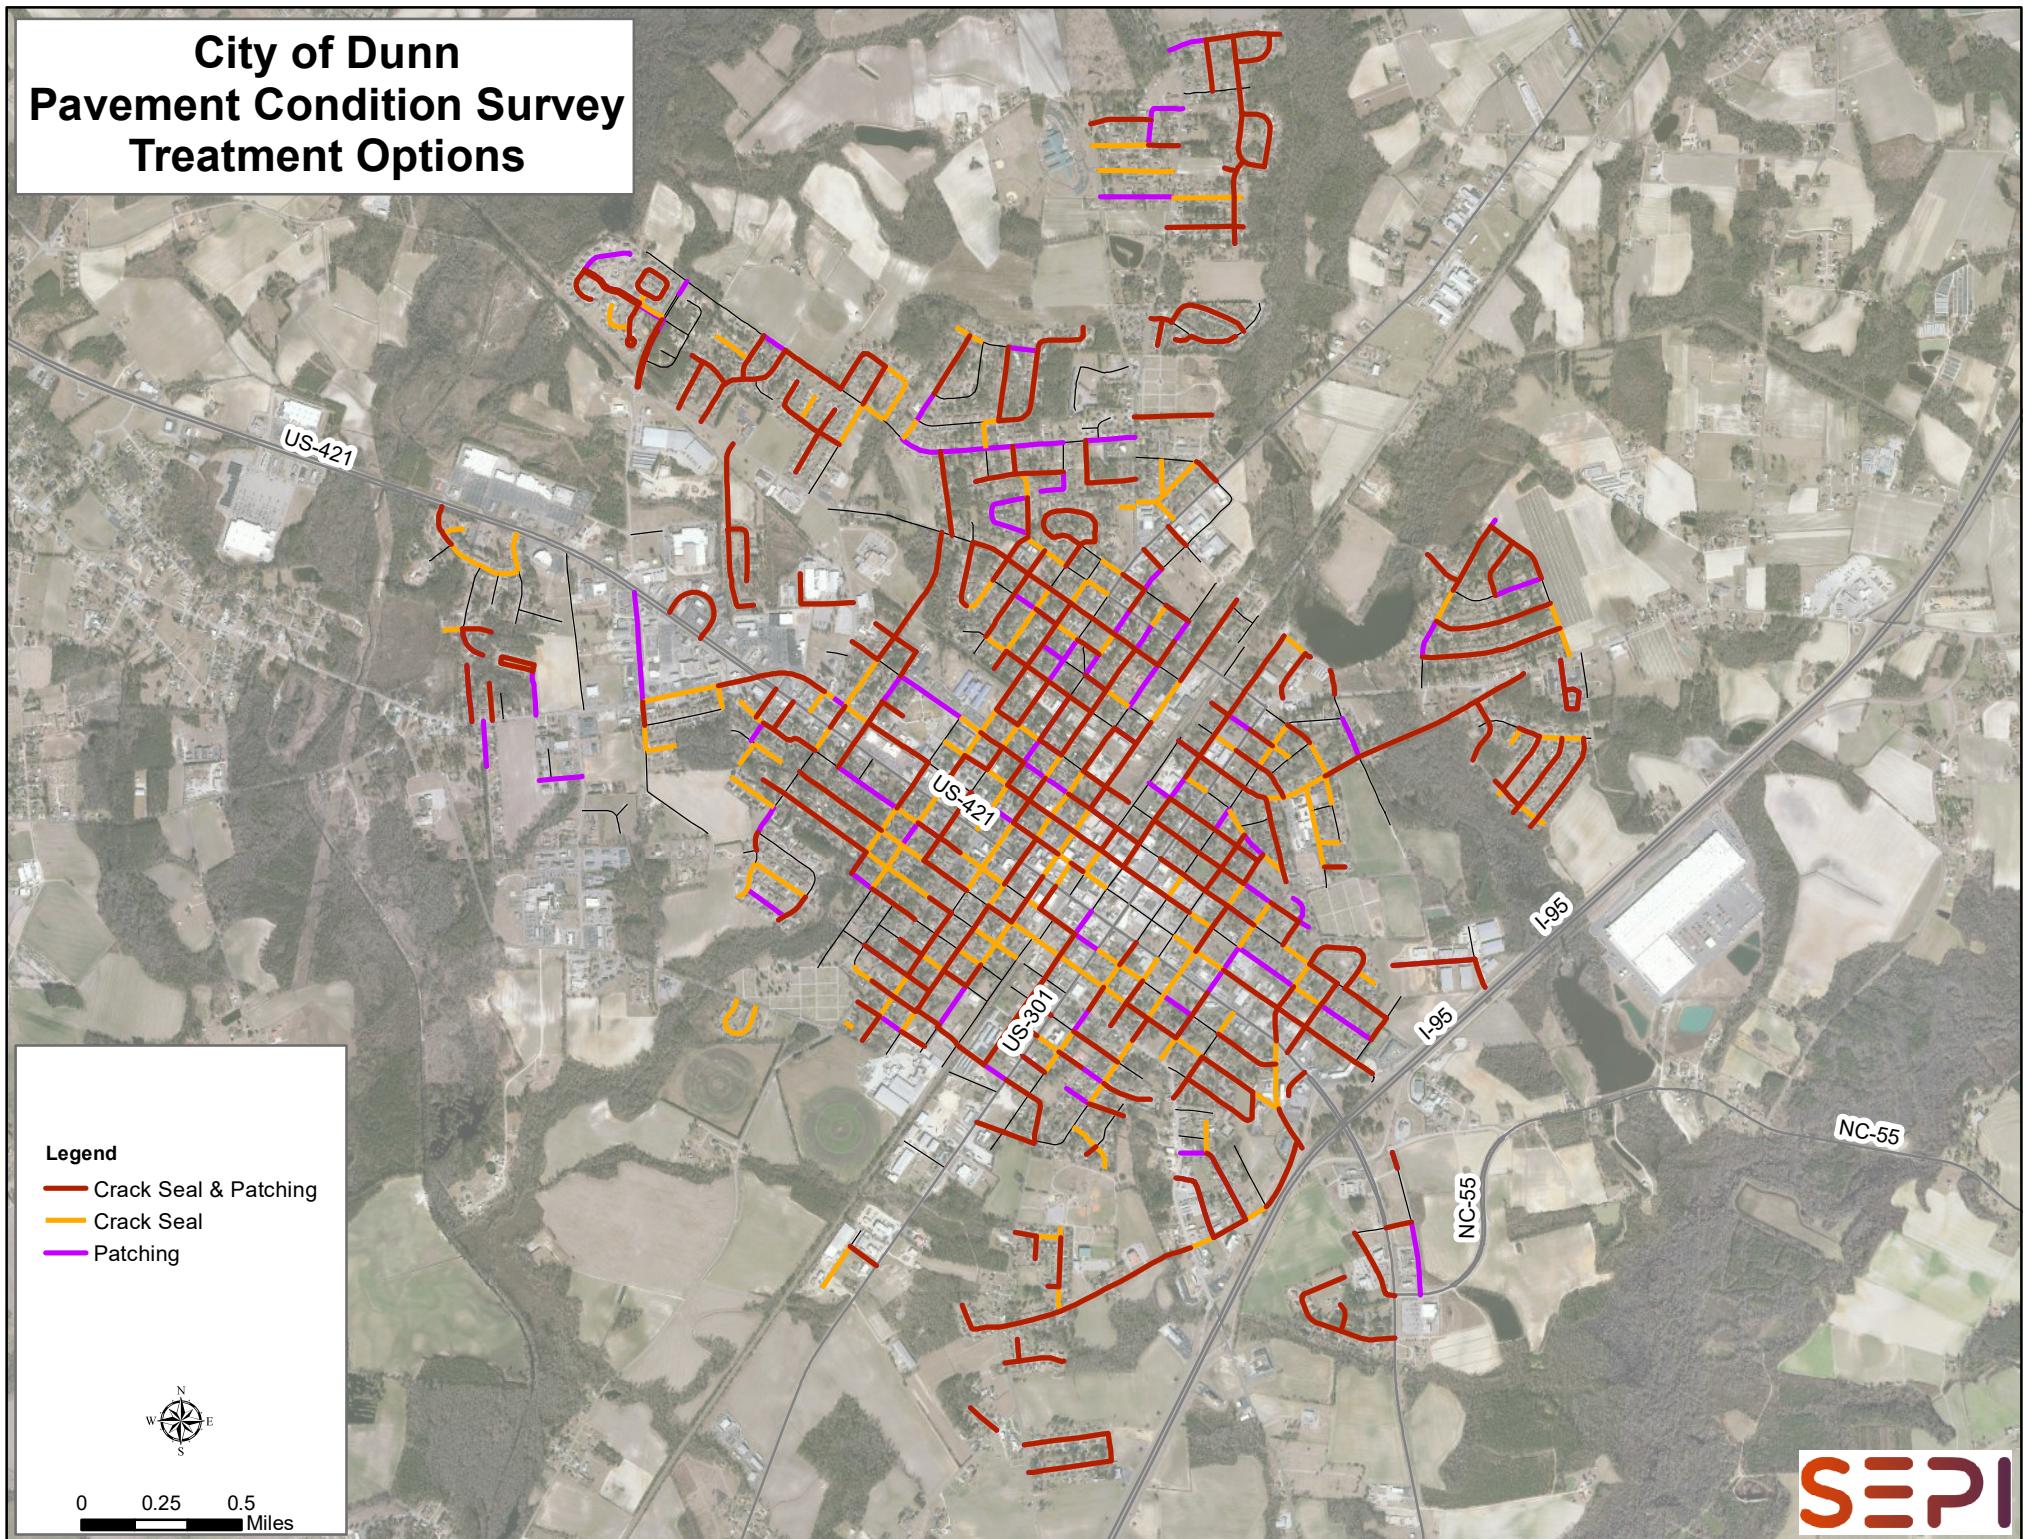




APPENDIX E

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
DUNN MAPS_PAVING
OVERLAYS AND PRESERVATION



**City of Dunn
Pavement Condition Survey
Treatment Options**

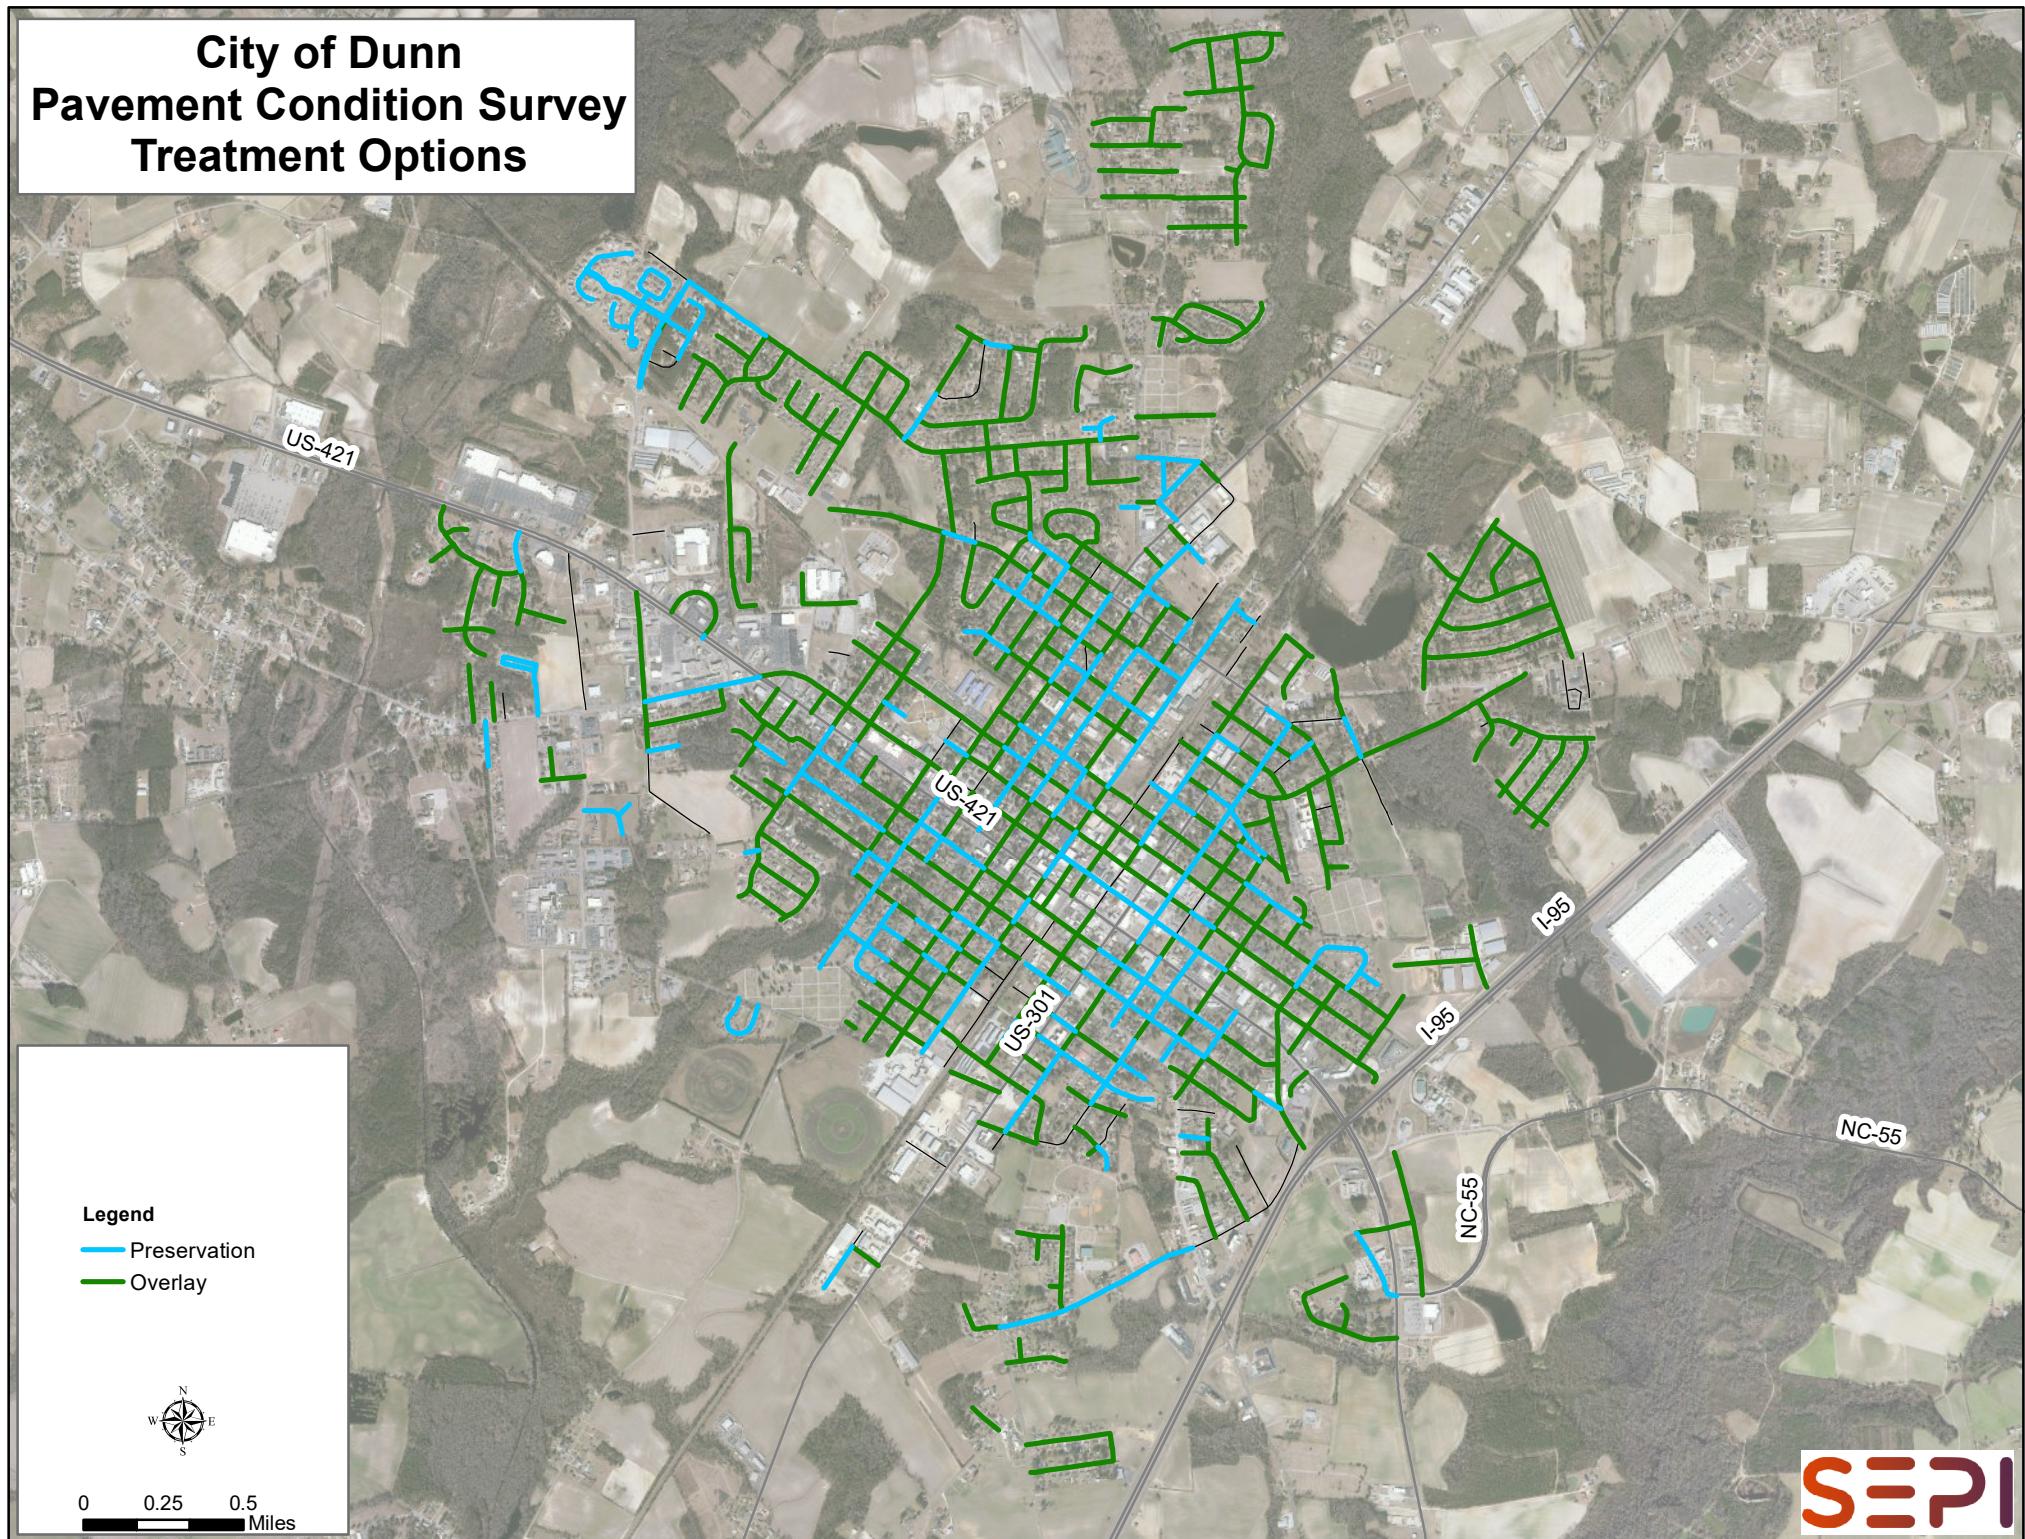



APPENDIX F

2021 CITY OF DUNN PAVEMENT CONDITION SURVEY
DUNN DISTRESS TYPES / EXTENT DEFINITIONS



Distress Severity/Extent Definitions Flexible Pavement (P)						
Distress	Rating Level		Rating Level		Rating Level	
	SEV	EXT	SEV	EXT	SEV	EXT
FATIGUE CRACKING / DEFECTS (FC)	LOW/0-5	0-5%	MEDIUM/0-5	0-5%	HIGH/0-5	0-5%
	LOW/5-10	5-10%	MEDIUM/5-10	5-10%	HIGH/5-10	5-10%
	LOW/10-25	10-25%	MEDIUM/10-25	10-25%	HIGH/10-25	10-25%
	LOW/25-50	25-50%	MEDIUM/25-50	25-50%	HIGH/25-50	25-50%
	LOW/50-75	50-75%	MEDIUM/50-75	50-75%	HIGH/50-75	50-75%
	LOW/75-100	75-100%	MEDIUM/75-100	75-100%	HIGH/75-100	75-100%
TRANSVERSE CRACKING (TC)	SEV	EXT	SEV	EXT	SEV	EXT
	LOW/LOW	>100'	MEDIUM/LOW	>100'	HIGH/LOW	>100'
	LOW/MEDIUM	100'-50'	MEDIUM/MEDIUM	100'-50'	HIGH/MEDIUM	100'-50'
	LOW/HIGH	50'-25'	MEDIUM/HIGH	50'-25'	HIGH/HIGH	50'-25'
BLOCK CRACKING (BC)	LOW/EXTREME	<25'	MEDIUM/EXTREME	<25'	HIGH/EXTREME	<25'
	SEV	EXT	SEV	EXT	SEV	EXT
	LOW/0-5	0-5%	MEDIUM/0-5	0-5%	HIGH/0-5	0-5%
	LOW/5-10	5-10%	MEDIUM/5-10	5-10%	HIGH/5-10	5-10%
	LOW/10-25	10-25%	MEDIUM/10-25	10-25%	HIGH/10-25	10-25%
	LOW/25-50	25-50%	MEDIUM/25-50	25-50%	HIGH/25-50	25-50%
PATCH DETERIORATION / POTHoles (PP)	LOW/50-75	50-75%	MEDIUM/50-75	50-75%	HIGH/50-75	50-75%
	LOW/75-100	75-100%	MEDIUM/75-100	75-100%	HIGH/75-100	75-100%
	SEV	EXT	SEV	EXT	SEV	EXT
	LOW/0-5	0-5%	MEDIUM/0-5	0-5%	HIGH/0-5	0-5%
	LOW/5-10	5-10%	MEDIUM/5-10	5-10%	HIGH/5-10	5-10%
	LOW/10-25	10-25%	MEDIUM/10-25	10-25%	HIGH/10-25	10-25%
SURFACE DEFECTS (SD)	LOW/25-50	25-50%	MEDIUM/25-50	25-50%	HIGH/25-50	25-50%
	LOW/50-75	50-75%	MEDIUM/50-75	50-75%	HIGH/50-75	50-75%
	LOW/75-100	75-100%	MEDIUM/75-100	75-100%	HIGH/75-100	75-100%
	SEV	EXT	SEV	EXT	SEV	EXT
RUTTING/ROUGHNESS (RR)	LOW/LOW	<25%	MEDIUM/LOW	<25%	HIGH/LOW	<25%
	LOW/MEDIUM	25-50%	MEDIUM/MEDIUM	25-50%	HIGH/MEDIUM	25-50%
	LOW/HIGH	50-75%	MEDIUM/HIGH	50-75%	HIGH/HIGH	50-75%
	LOW/EXTREME	75-100%	MEDIUM/EXTREME	75-100%	HIGH/EXTREME	75-100%

